

32 - 5001
MANUAL
of Operating & Maintenance
Procedures
for

Series 2000
Digital Multimeter
Model 2500

C6-83-012



DATA PRECISION

...years ahead .

AUDUBON ROAD, WAKEFIELD, MASSACHUSETTS

A-1, A-2 OPTION SUPPLEMENT

INSERTED AT REAR OF MANUAL



Frontispiece SERIES 2000 DMM Model 2500

CONTENTS

Section Para.	Title	Section Para.	Title
1.	INTRODUCTION	4.	PRINCIPLES OF OPERATION
	Specifications Model 2500	4.1	General
	Specifications Model 2400	4.2	System Block Diagram
2.	OPERATION	4.3	Signal Conditioning Block
2.1	Unpacking	4.4	Tri-Phasic A/D Converter Block
2.2	Operating Controls and Indicators	4.5	Trigger Generator and Clock
2.3	Power Connections	4.6	Decade Counter Chain, Latch, and Decoder
2.4	Guard Connections	4.7	Ranging
2.5	Ranging	4.8	Power Supply Block
2.6	Zeroing	4.9	Detailed Operation
2.7	Voltage Measurements	4.10	Signal Conditioning Details
2.8	Voltage Ratio Measurements	4.11	Ratiohm Resistance Input Conditioning Details
2.9	Resistance Measurements	4.12	A/D Converter Details
2.10	Remote Control/Operation	4.13	Trigger Generator and Counter
3.	CALIBRATION	4.14	Ranging
3.1	Calibration Verification	5.	OPERATOR & FIELD MAINTENANCE
3.2	Preliminary Set Up Conditions	5.1	General
3.3	Calibrating Equipment	5.2	Parts Grouping and The Test Stand-Offs
3.4	Access to Calibration Adjustemnts	5.3	The Troubleshooting Flow Chart
3.5	Calibrating Sequence	5.4	Using the Troubleshooting Flow Chart
3.6	DC Voltage Measurement Mode	6.	REFERENCE MATERIALS
3.7	Resistance Measurement Mode		Parts Lists
3.8	AC Voltage Measurement Mode		Reference Schematics
3.9	Ratio DC Voltage Measurement Mode		
3.10	Post-Calibration		

Section 1

INTRODUCTION

The Series 2000 Digital Multimeter is the first implementation of a new concept in digital instrumentation. It features:

TRI-PHASICTM A/D Conversion,
ISO-POLARTM Reference Generation,
and
RATIOHMICTM Resistance Measurements.

The new design concepts have resulted in a marked increase in technical performance at radically reduced cost.

Every Series 2000 Digital Multimeter includes full capabilities for:

Auto-Ranging for all measurements, which automatically selects the range scale of highest resolution for the input signal (Manual ranging is also included):

BCD Outputs, which remain latched between conversions and which are available for remote data output;

Overload Indicator, which enables the system user to reject invalid measurement indications;

Remote Control, which enables the system user to trigger measurement cycles according to his needs and to change the range on external command.

The measurement functions incorporated in each Model are listed below. The complete specifications for the 5-1/2 digit model are reproduced in the tabular data that follows:

Model	DC Volts	AC Volts	Ohms	DC Ratio
2540	X	X	X	X
2535	X	X		X
2530	X		X	X
2520	X			X

Scope of Instruction Manual for MODEL 2500

This Instruction Manual for Model 2500 DMM contains the general description, principles of operation, operating and maintenance procedures, reference schematics, and parts lists.

This manual also includes information for the operation, calibration, and maintenance of the Model 2500 Digital Multimeter with Option A1 or Option A2. These options are built in at the factory during assembly and the resulting meters are identified as Model 2500A1 or Model 2500A2, respectively.

Model 2500A1 provides a 100 millivolt full scale range capability;

Model 2500A2 provides a battery or AC line power operation.

NOTICE

The information contained herein is derived in part from proprietary and patent data of the Data Precision Corporation and its presentation in this Instruction Manual is solely for the assistance of equipment operating and maintenance personnel. Publication of this information does not convey any rights to reproduce or to use the information for any purpose other than in connection with the installation, operation, and maintenance of the equipments described herein.

INTRODUCTION

SPECIFICATION MODEL 2500 DMM

DC Volts

Nominal Range	Overrange	Resolution	Input Impedance	Maximum Voltage
± 1.00000	± 1.19999	$10\mu\text{V}$	$> 1,000$ megohms	1000V
± 10.0000	± 11.9999	$100\mu\text{V}$	$> 1,000$ megohms	1000V
± 100.000	± 119.999	1mV	10 megohms	1000V
± 1000.00	± 1000.00	10mV	10 megohms	1000V

Accuracy (all ranges, including overrange):

24 hours, $23^\circ\text{C} \pm 1^\circ\text{C}$ $\pm 0.004\%$ rdg $\pm 0.001\%$ f.s. ± 1 l.s.d.

6 months, $23^\circ\text{C} \pm 5^\circ\text{C}$ $\pm 0.007\%$ rdg $\pm 0.001\%$ f.s. ± 1 l.s.d.

Add $\pm 0.00001\%$ rdg/Volt.

Temperature Coefficient (0°C to 50°C , all ranges):

($\pm 0.001\%$ rdg $\pm 0.0002\%$ f.s.)/ $^\circ\text{C}$

Common-Mode Rejection Ratios (minimum):

at DC, 160dB with 1000Ω source-impedance unbalance

at 60Hz, 120 dB with 1000Ω source-impedance unbalance

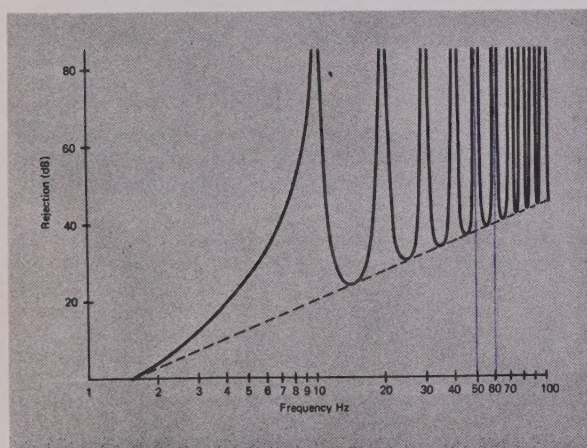


Figure 1-1. Common Mode Rejection

Common-Mode Voltage: 250V DC (or AC peak) maximum.

Normal-Mode Rejection Ratio: 60dB at 10Hz and all integral multiples thereof.

OPTION A1:

Nominal Range	Overrange	Resolution	Input Impedance	Maximum Voltage
± 100000	± 119999	$1\mu\text{V}$	$> 1,000$ megohms	1000V

Accuracy:

24 hours, $23^\circ\text{C} \pm 1^\circ\text{C}$ $\pm 0.005\%$ rdg $\pm 0.004\%$ f.s. ± 1 l.s.d.

6 months, $23^\circ\text{C} \pm 5^\circ\text{C}$ $\pm 0.008\%$ rdg $\pm 0.004\%$ f.s. ± 1 l.s.d.

Temperature Coefficient (0°C to 50°C):

($\pm 0.001\%$ rdg $\pm 0.001\%$ f.s.)/ $^\circ\text{C}$

AC Volts

Nominal Range	Overrange	Resolution
1.00000	1.19999	$10\mu\text{V}$
10.0000	11.9999	$100\mu\text{V}$
100.000	119.999	1mV
1000.00*	1000.00*	10mV

*See maximum voltage limitation, below

Input Impedance (all ranges): 1 megohm in parallel with 100pF or less.

Sensing & Calibration: True-Average sensing, calibrated in RMS of sinewave.

Accuracy (6 months, $23^\circ\text{C} \pm 5^\circ\text{C}$): See curve and specific ratings below.

Temperature Coefficient (0°C to 50°C , all ranges):

30Hz - 1kHz ($\pm 0.005\%$ rdg. $\pm 0.002\%$ f.s.)/ $^\circ\text{C}$

1kHz - 10kHz ($\pm 0.005 \times \text{freq. in kHz}\%$ rdg. $\pm 0.002\%$ f.s.)/ $^\circ\text{C}$

10kHz - 100kHz ($\pm 0.05\%$ rdg. $\pm 0.002\%$ f.s.)/ $^\circ\text{C}$

Maximum Input Voltage (sinewave RMS):

30Hz to 10kHz: 500V

above 10kHz: decreases linearly to 100V at 100kHz

Settling Time (to settle within $\pm 0.05\%$ of final reading for a full-scale step input): 2.5 seconds.

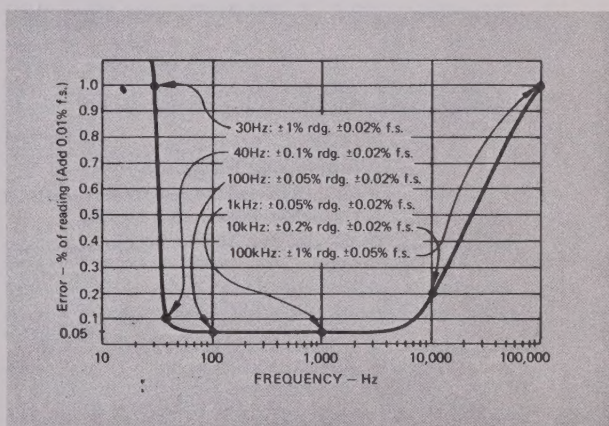


Figure 1-2. Series 2000 DMM AC-Volt Accuracy

Ohms

Nominal Range	Overrange	Resolution	Max Test Current
$1.00000\text{k}\Omega$	$1.19999\text{k}\Omega$	10 milliohms	1 mA
$10.0000\text{k}\Omega$	$11.9999\text{k}\Omega$	100 milliohms	100 μA
$100.000\text{k}\Omega$	$119.999\text{k}\Omega$	1 Ohm	10 μA
$1.00000\text{ meg}\Omega$	$1.19999\text{ meg}\Omega$	10 Ohms	1 μA
$10.0000\text{ meg}\Omega$	$11.9999\text{ meg}\Omega$	100 Ohms	0.1 μA

Configuration: True four-wire.

Maximum Open Circuit Voltage: 6.2 Volts.

Accuracy (6 months, $23^\circ\text{C} \pm 5^\circ\text{C}$):

$1\text{k}\Omega/10\text{k}\Omega/100\text{k}\Omega$ ranges $\pm 0.007\%$ rdg $\pm 0.001\%$ f.s. ± 1 l.s.d.

1 meg Ω range $\pm 0.02\%$ rdg $\pm 0.002\%$ f.s. ± 1 l.s.d.

10 meg Ω range $\pm 0.2\%$ rdg $\pm 0.01\%$ f.s. ± 1 l.s.d.

Temperature Coefficient (0°C to 50°C):

$1\text{k}\Omega/10\text{k}\Omega/100\text{k}\Omega$ ranges ($\pm 0.001\%$ rdg $\pm 0.0004\%$ f.s.)/ $^\circ\text{C}$

1 meg Ω range ($\pm 0.005\%$ rdg $\pm 0.0004\%$ f.s.)/ $^\circ\text{C}$

10 meg Ω range ($\pm 0.02\%$ rdg $\pm 0.005\%$ f.s.)/ $^\circ\text{C}$

Settling Time (to settle to within $\pm 0.01\%$ of final reading):

$1\text{k}\Omega/10\text{k}\Omega/100\text{k}\Omega$ ranges 0.1 sec.

1 meg Ω range 0.4 sec.

10 meg Ω range 3.1 sec.

Settling Time in seconds for any resistance = $0.1 + 0.3 \times \text{Resistance in Megohms}$.

INTRODUCTION

SPECIFICATIONS MODEL 2500 DMM (Continued)

DC Ratio

Selected Range	Nominal Range	Overrange	Actual Display*
1	$\pm 1.00000:1$	$\pm 1.19999:1$	± 1.19999
10	$\pm 1.00000:1$	$\pm 1.19999:1$	± 11.9999
100	$\pm 10.0000:1$	$\pm 11.9999:1$	± 119.999
1000	$\pm 100.000:1$	$\pm 119.999:1$	± 1199.99

*Displayed Ratio is 10 times true ratio

Accuracy:

24 hours, $23^{\circ} \pm 1^{\circ}\text{C}$:

$$[\pm 0.004\% \text{ rdg} \pm 0.001\% \text{ f.s.} \pm 1 \text{ l.s.d.}] \times \frac{10}{\text{Actual Ref. Voltage}}$$

6 months, $23^{\circ}\text{C} \pm 5^{\circ}\text{C}$:

$$[\pm 0.008\% \text{ rdg} \pm 0.001\% \text{ f.s.} \pm 1 \text{ l.s.d.}] \times \frac{10}{\text{Actual Ref. Voltage}}$$

Temperature Coefficient (0°C to 50°C , all ranges):

$$[\pm 0.001\% \text{ rdg} \pm 0.0002\% \text{ f.s.}] \times \frac{10}{\text{Actual Ref. Voltage}}/^{\circ}\text{C}$$

Voltage Coefficient of Ratio: $\pm 0.00001\%$ rdg/Volt

Voltage Range:

Input Signal: 0 to $\pm 1000\text{V}$

Reference Signal: $+1\text{V}$ to $+11\text{V}$

Reference Input Impedance: $100\text{k}\Omega$

Common-Mode Rejection Ratio: Same as DC Volts

Normal Mode Rejection Ratio: Same as DC Volts

Interface & Application Specifications

Signal Interfaces.

Data Outputs (DTL/TTL compatible) BCD 1-2-4-8 coded, positive true.

Logic ONE: $> +2.4\text{V}$

Logic ZERO: $< +0.4\text{V}$ sink for 4mA

Polarity output, ONE = Positive polarity

State Outputs (DTL/TTL compatible)

Range in use = ZERO: $< +0.4$ sink for 4mA

Inactive ranges = ONE: $> +2.4\text{V}$

End of Conversion is transition from ZERO to ONE.

Control Inputs.

Range: Each range is selected by the grounding of the appropriate line, through switch contacts or grounded transistor.

External Trigger:

Positive pulse 2.4 volts with a pulse width of $> 1\mu\text{sec}$, and $< 100\text{ msec}$ will initiate a read command. The command will cause the instrument to perform one measurement. The reading will remain in the memory until a new external trigger pulse is initiated.

Trigger Enable Input (applying logic "0" inhibits conversion in all trigger modes):

Logic "1" $> +2.4\text{V}$

Logic "0" $< +0.4\text{V}$ sink for 40mA

Input Power: 105V–125V AC (or 210–250V AC) at 47–430Hz, less than 12 Watts. Line-voltage range is selected by rear-panel switch.

Environment.

Temperature Ranges: Operating, 0°C to $+50^{\circ}\text{C}$
Storage, -25°C to $+80^{\circ}\text{C}$

Humidity: 95% RH max, 0°C to $+40^{\circ}\text{C}$
80% RH max, $+40^{\circ}\text{C}$ to $+50^{\circ}\text{C}$

Overall Dimensions: $3\frac{1}{4}"$ high, $8\frac{1}{2}"$ wide, and 12" deep, including panel controls and connectors.

Weight: 8 pounds net, 14 pounds packed for domestic shipment.

Stand: Adjustable, removable, tilt-up stand provided for best viewing in bench use.

Section 2

OPERATION

2.1 UNPACKING

The Series 2000 digital multimeter was shipped in a protective packing case which contained the following items:

- One Series 2000 digital multimeter,
- One line cord (3-wire),
- One instruction manual,
- One certificate of traceability to NBS Standards,
- One warranty card, and
- One copy of the test and inspection data for this instrument.

Before discarding the carton, ascertain that all these have been removed.

If the carton showed signs of rough handling or damage, inspect the multimeter carefully and report the damage to the shipping company immediately. Fill out the warranty card as directed and return it to the factory.

2.2 OPERATING CONTROLS AND INDICATORS

The front panel controls and indicators are identified in Figure 2-1 and the functions described in Table 2-1. The rear panel controls are identified in Figure 2-2 and described in Table 2-2.

2.3 POWER CONNECTIONS

Series 2500 DMM is shipped with the power switch preset for the AC voltage source anticipated in the user area and the setting is recorded on the Test Data Sheet forwarded with the instrument. (In the United States this is 115V.) The AC source selection switch, S201, is located on the rear panel of the DMM, and its setting may be changed, if necessary. Use a small-blade screw driver to set S201 to the proper value as stamped on switch.

2.4 GUARD CONNECTIONS

Instrument construction provides a GUARD circuit connected to the internal shield surrounding the analog and A/D sections of the instrument and isolated from any analog input or external ground. Prior to any measurement, a proper GUARD connection must be made in order to bring the internal shield as close as possible to the voltage potential of the low side of the input circuit. The low side of the input is separated from internal grounds and is brought out as a front panel connection where it may be connected as required.

Table 2-1

FRONT PANEL CONTROLS AND INDICATORS

NOTE

Complete operating instructions follow the description of controls and indicators.

Fig. Ref.	Control/Indicator	Description	Function
1.	ON	Push-push switch & light indicator	Applies AC power to the unit from the connected source.
2.	DC	Push switch & light indicator	Selects DC voltage measurement mode of DMM operation. Is interlocked with other modes so that it is pushed out upon selection of another mode.

OPERATION

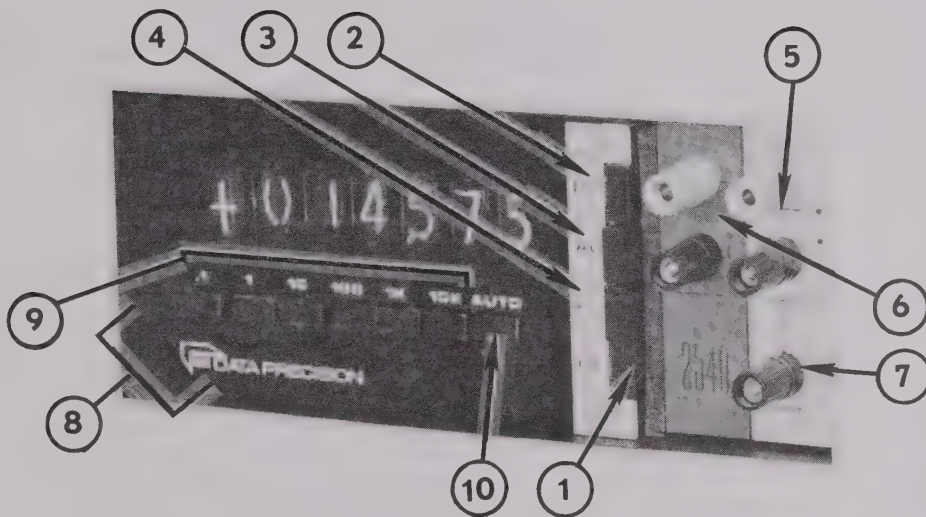


Figure 2-1. MODEL 2500 DMM Front Panel Controls and Indicators

OPERATION

Table 2-1 (Continued)

FRONT PANELS CONTROLS AND INDICATORS

Fig. Ref.	Control/Indicator	Description	Function
3.	AC	Push switch & light indicator	Selects AC voltage measurement mode of DMM action. Is interlocked with other modes so that it is pushed out upon selection of another mode.
4.	k Ω	Push switch & light indicator	Selects resistance measurement mode of DMM operation. Is interlocked with other modes so that it is pushed out upon selection of another mode.
5.	Vx	Two 5-way binding posts	Connection for input voltage, AC or DC, or resistance. (2-wire.)
6.	Rx	Two 5-way binding posts	Current source and sink terminals for resistance connection. Connection for voltage ratio reference input.
7.	GUARD	One 5-way binding post	External connection to guard shield.
8.	DISPLAY	NIXIE Tube indicators	Displays digital readout for a maximum of 120000. Decimal point is selected automatically and appears in the appropriate NIXIE tube to indicate value of a direct reading. Sign is displayed automatically when in DC measurement mode.
9.	<u>RANGE DC</u> 0.1 1 10 100 1K 10K	Push switch for manual range selection	Selects value of full scale range to be used by DMM in measuring input. Is interlocked so that only one may be in at a time. 0.1 for use with low level option A1; 10K for use with k Ω function only.
10.	AUTO	Push switch for automatic range selection	Initiates DMM operation to locate range for which the input signal will be measured between 10% and 120% of full scale.

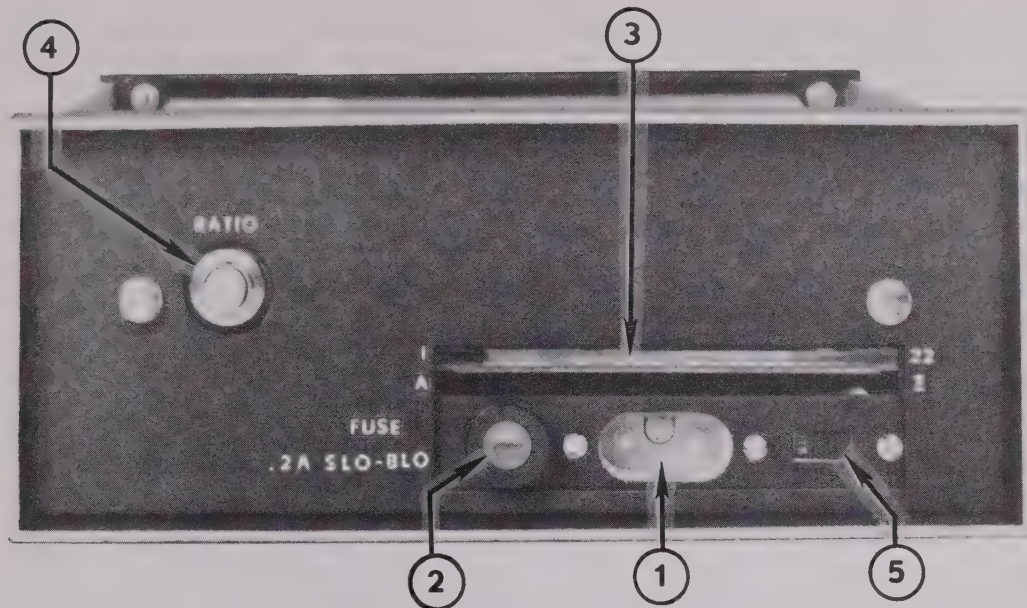


Figure 2-2. SERIES 2000 DMM Rear Panel Controls and Indicators

Table 2-2
REAR PANEL CONTROLS AND INDICATORS

Fig. Ref.	Control/Indicator	Description	Function
1.	POWER	3-conductor connector	Connector for line cord.
2.	FUSE	Receptacle and holder	For a 2/10 amp slow-blow line fuse.
3.	REMOTE	PC Connector	Provides digital output of measured value, indicates selected range of operation, and provides input for remote control of range and remote triggering of DMM operations. (See Table 2-3).
4.	RATIO	Push-push switch	Selects ratio mode of multi-meter operation in which external source is used instead of the internal reference.
5.	LINE VOLTAGE SWITCH	115/230V switch	Connects proper transformer voltage taps so that Series 2000 will work in user area

OPERATION

The GUARD connection should be made to minimize the common mode currents through the voltage measuring circuit, and it should be connected to the low side as close to the voltage source as possible. If it is not feasible to connect at the source, make the connection between GUARD and the low side of the input at the DMM front panel.

2.5 RANGING

a. Manual Ranging

The DMM is a direct reading instrument in any voltage or resistance range setting, and displays ten times the actual when making Ratio measurement. When any one of the fixed ranges is chosen, the display will automatically indicate correct polarity of high input terminal referred to low (in DC), and will read the input voltage to $5\frac{1}{2}$ significant figures (up to 119999). An out-of-range input signal will result in two effects simultaneously --

1. A 120000 reading on the display (and decimal point).

2. A blinking "1" in the most significant digit.

When the DMM is switched to the correct range, the reading will be steady at less than 120000.

Zero's in the most significant digits indicate that the full scale range may be decreased. Full resolution capability of the instrument is being used when the reading is between 010000 and 119999, 10% to 120% of full scale, with proper decimal point location.

b. Auto Ranging

When Auto Range is chosen, the meter will automatically settle at that range wherein the reading is between 10% and 120% of full scale.

At the end of each conversion, the range sensing circuit interrogates its result to determine whether the answer is above 119999 or below 010000. If above 119999, the ranging circuit starts the next conversion at the highest range scale. At the end of the succeeding conversion, if the reading is below 010000, the auto-range circuit drops the

range one level and performs the next cycle conversion. The DMM reduces the range scale one level at a time, until the reading is obtained on scale between 010000 and 120000.

Decimal point indication on the display follows the range change to keep the result direct reading. As soon as an on-scale reading is reached, the result may be read. Note that each reading is discrete and independent and is a complete measurement in itself.

2.6 ZEROING

In all modes of operation, Series 2500 DMM instruments self-adjust for zero, and no zero-adjustment is required.

NOTE

If no input is connected to the instrument and a sensitive range is selected, spurious readings may appear because of the high impedance input. These are of no consequence and do not indicate any incorrect performance when the instrument is properly connected for use.

2.7 VOLTAGE MEASUREMENTS

(D.C. Measurement Instructions - all instruments, A.C. Measurement Instructions Models 2535 and 2540).

a. General

The same procedure is used in AC voltage and DC voltage measurements. Precautions to avoid pickup and stray signals should be strictly observed because high frequency spurious inputs may be mistaken for acceptable signals in the AC measuring mode. Refer to paragraph 2.4 for information on GUARD connection. If possible, enclose both input leads in a shield and connect the shield to GUARD at the instrument end, and to the low side of signal at the source end.

OPERATION

b. Procedure

(See paragraph 2.8 for Ratio.)

1. Select appropriate voltage measurement mode, AC or DC.
2. Connect input circuit to V_x (Figure 2-3).
3. Make appropriate GUARD connections.
4. a) If using Manual Ranging (paragraph 2.5 a.), select most sensitive range that does not cause DMM to indicate an overrange condition. This will utilize full 5 digits of DMM resolution capability.
- b) If using Auto Ranging (paragraph 2.5 b.), wait until display stabilizes at on-scale range before reading.

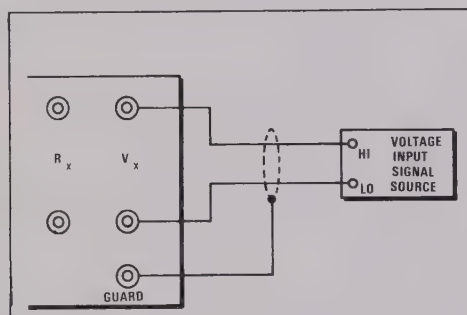


Figure 2-3. Voltage Measurement Connections

c. Waveform and Error Comments-AC Mode

In measuring input AC voltages, the DMM circuitry blocks any incoming DC, and the instrument operates within specification accuracy for any superimposed DC voltage up to 500 volts. The DMM measures the average value of one-half cycle of the resulting AC waveform, and calibrates the output display in RMS of an equivalent sine wave. (For further elaboration, turn to paragraph 4.3)

2.8 VOLTAGE MEASUREMENTS (RATIO)

a. General

The Series 2500 DMM will measure the ratio of any AC or DC voltage within normal operating limits referenced to an external DC reference voltage between +1 volt and +11 volts. The displayed ratio value will be 10 times the true ratio.

b. Procedure

1. Press RATIO push button at Rear Panel (Figure 2-2). Observe corresponding lamp lighted on front panel.
2. Select appropriate AC or DC mode. Observe corresponding lamp lighted on front panel.
3. Select appropriate manual range or auto range.
4. Install links as shown in Figure 2-4.
5. Connect voltage input signal to the front panel V_x connectors as in Figure 2-4.
6. Connect the reference voltage input signal to the front panel R_x connectors as shown in Figure 2-4.
7. Read output after display is stable. Divide by 10 to obtain true ratio of unknown to known reference. Sign of display reading will indicate relative polarity of applied voltages for DC inputs.

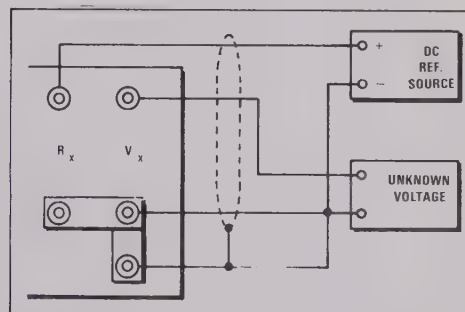


Figure 2-4. DMM Connections for RATIO Measurement

2.9 RESISTANCE MEASUREMENT

a. General

The Series 2500 DMM measures any resistor between 1.19999 k Ω full scale and 11.9999 megohms full scale and offers full four-wire measurement capability to achieve the specified accuracy. For rapid measurements, where extreme accuracy is not necessary, the convenience of two-wire resistance measurements is also afforded.

b. Four-Wire Measurements

1. Select k Ω measurement mode. Observe that appropriate lamp is lighted at front panel.
2. Connect the V_x terminals to inner connection points, A, of the unknown resistor as shown in Figure 2-5.

OPERATION

3. Connect the current source and sink to the outer connection points, B, of the unknown resistor as shown in Figure 2-5.

4. Connect guard to the low side (current sink) of the circuit as shown in Figure 2-5.

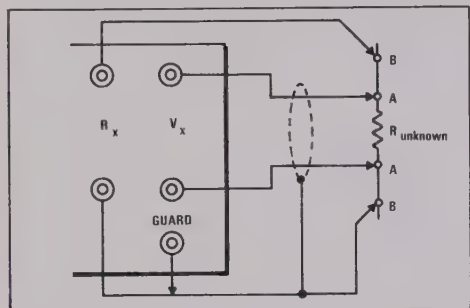


Figure 2-5. Four-Wire Resistance Measurement

5. Select appropriate manual or auto range switch for expected resistance. Note that highest range of 10K is available in resistance measurement mode.

6. Observe display. As soon as decimal point location is stable, a correct reading may be made. An over range condition will result in a blinking indication as in voltage measurements (see paragraph 2.5a).

7. When measuring high resistance values, it is desirable to shield the resistor through to the connections A and B to reduce the effects of any spurious voltage.

c. Two-Wire Measurements

When making two-wire resistance measurements, connect the unknown resistance and the current source and sink to the connection points as shown in Figure 2-6. Perform the measurement as in steps 4. through 7. in paragraph 2.9a above.

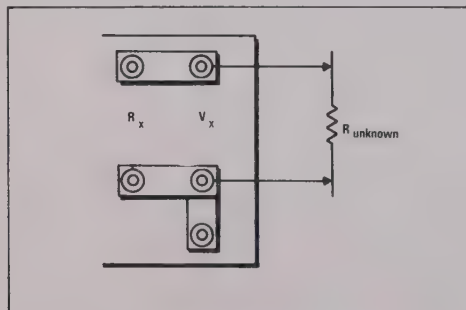


Figure 2-6. Two-Wire Resistance Measurement

2.10 REMOTE OPERATION

a. Set-Up

To obtain remote control and to transmit data from Series 2500 DMM --

1. Prepare a cable with 44-pin connector VIKING 2VK22D/1-3 or equivalent, and cabled as shown in Table 2-3.

2. Remove protective covering from the PC Board connector at Rear Panel and connect cabled connector.

b. Output Signals Specifications and Applications

1. Data Output - Parallel format of five binary-coded decimal digits and sign are transmitted with DTL/T2L compatibility. Logic is positively true:

Logic "1" +2.4V
Logic "0" +0.4V sink for 4 mA

Polarity positive is logic "1".

Signals remain as latched on output lines between conversions.

2. Range scale in use is indicated by logic "0". Inactive ranges are logic "1"'s.

(Decimal point is indicated by range in use.)

3. End of Conversion (EOC) is indicated by positive going transition of voltage on EOC line, at which time (during transition), the data output is being updated. The negative going voltage transition of the EOC output signal occurs at the start of conversion in each measurement cycle and serves as a forewarning of the positive going transition (and upcoming data update) to occur after 100 milliseconds and within 220 milliseconds thereafter.

4. Overload - A zero logic level on this line indicates the input of a signal more than 120% of the selected full scale range, necessitating a range change. This output thus serves to indicate existence of incorrect data on the output lines and may be used to inhibit input of incorrect data to receiving printers, computers, etc. It also transmits a short negative pulse at EOC.

OPERATION

c. Remote Control

1. General - In order to exercise external trigger control of Series 2500 DMM, ALL front panel range switches must be placed in the open (non-selected) position.

2. External Trigger - Application of a 2.4V positive voltage pulse between 1 μ sec and 100 milliseconds wide causes the instrument to initiate the measurement cycle and to update the data output until the next trigger command. The BCD data remains on the output lines between updates, permitting computer processing or printing (logging), and the repetition rate of the external trigger may be adjusted to allow the necessary time between data updates for data receptors to complete their processing (printing, computer input, editing, etc.).

It is also possible to operate range control remotely and internally trigger:

(a) Set range switches to Open.

(b) Choose range by grounding proper line.

(c) Connect trigger enable (pin J) to external trigger (pin 21) to rear panel.

It is also necessary to select the range to be used by grounding the appropriate line (either logic level or direct ground).

3. Trigger ENABLE - Logic zero state inhibits conversions when unit is triggered from internal source.

When the level is changed to logic "1" on the ENABLE line, the instrument will make a conversion at the next appearance of a positive pulse or at the next succeeding trigger pulse.

Table 2-3

REMOTE CONTROL/OUTPUT CABLE			
MODEL 2500			
A	Ground	1	Ground
B	10^1	2	8
C	8,000	3	4
D	4,000	4	2
E	2,000	5	1
F	1,000	6	10^4
H	10^0	7	80
J	Enable	8	40
K	NC	9	20
L	NC	10	10
M	NC	11	10^3
N	800	12	NC
P	400	13	NC
R	200	14	Read Output
S	100	15	80,000
T	10^2	16	40,000
U	NC	17	20,000
V	NC	18	10,000
W	NC	19	100,000
X	NC	20	+
Y	Overload	21	Ext. Trig.
Z	Ground	22	Ground

Section 3

CALIBRATION

Data Precision 2000 Series Digital Multimeters (DMM) are extremely precise and stable instruments. Their 6-month specified accuracy should last for longer than the specified period. It is advised to check the instrument periodically. When doing so, follow all procedures carefully and observe all precautions.

3.1 CALIBRATION VERIFICATION

Data Precision Company recommends establishing and maintaining a performance history log of the 2000 Series DMM. Transfer the certified factory performance test data as the initial entry. In order to have a locally available test performance for comparison, it is suggested that the instrument be tested against an available standard as soon as it is unpacked and the test results be recorded at that time. The instrument should be checked thereafter at least every six months.

3.2 PRELIMINARY SET UP CONDITIONS

a. Establish a solid ground connection from the case to the power source ground. If the third wire of the three-wire power cord does not carry through to main power ground, ground the meter case with a clip lead attachment.

b. Accuracy of standards used to calibrate the multimeter should be verified before recalibrating the instrument. Errors of standards should be no worse than 20% of the tolerances specified for the multimeter.

3.3 CALIBRATING EQUIPMENT TABLE

The following equipment is recommended for use when called out in the calibration procedure. Substitute units may be employed provided they meet the accuracy characteristics specified below.

Feature Under Test	Standard Type/ Model No.	Accuracy Requirements
DC Volts Measurement	COHU/Model 355	10V range $\pm .001\%$ rdg + 5 μ V 100V range $\pm .001\%$ rdg + 20 μ V 1000V range $\pm .001\%$ rdg + 40 μ V 1000V range $\pm .001\%$ rdg + 40 μ V
AC volts	HP/Model 745A and 746A	1mV to 100V: 50Hz-20kHz $\pm .02\%$ rdg $\pm .002\%$ range + 10 μ V 20Hz-100kHz $\pm .05\%$ rdg $\pm .005\%$ range + 50 μ V 100V to 1000V: 50Hz-20kHz $\pm .04\%$ rdg 20Hz-50kHz $\pm .08\%$ rdg
Resistance	JULIE/DMR-105A (.001%) JULIE/NB-106-1M (.0015%) JULIE/NB-107-10M (.003%)	1 kilohm to 10 megohm $\pm .001\%$ in decades

Table of Recommended Calibrating Equipment

CALIBRATION

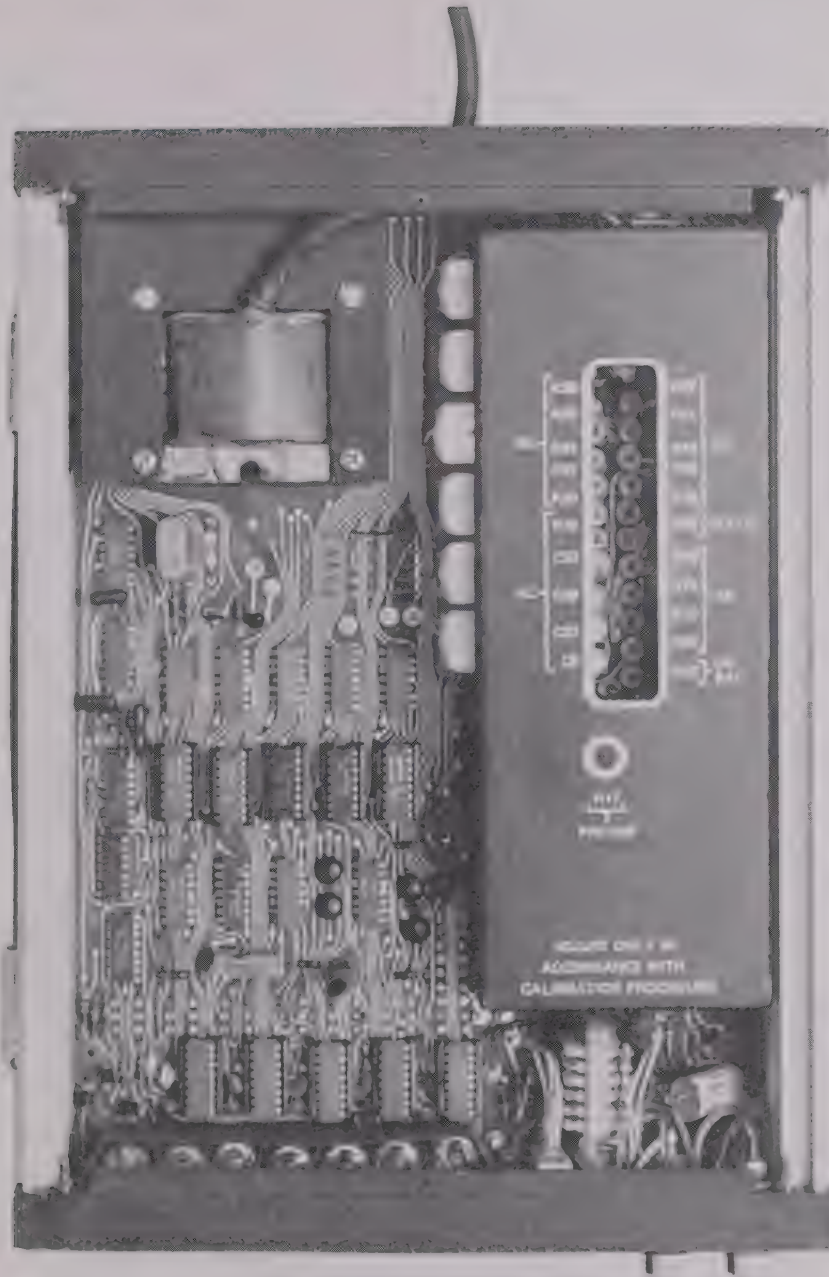


Figure 3-1. Series 2000 DMM

CALIBRATION

3.4 ACCESS TO CALIBRATION ADJUSTMENTS

All calibration adjustments are accessible after the top cover has been removed (see Figure 3-1). The actual calibration potentiometers are mounted on the circuit board, but may be reached through an opening provided in the guard shield. A summary table of Calibration Procedure is located on the inside top cover of the instrument.

CAUTION

Do not remove the Guard during Calibration Process.

3.5 CALIBRATING SEQUENCE

Perform the calibration in the following sequence of measurement modes:

1. DC Voltage Measurement Mode
2. Resistance Measurement Mode
3. AC Voltage Measurement Mode
4. Ratio Measurement Mode.

3.6 DC VOLTAGE MEASUREMENT MODE

Depress "ON" switch; wait one hour for calibration.

a. Zero Adjust: R45, R46

1. Set range to 10V Full

Scale

2. Select DC Volts mode
3. Connect (approx.) 10

megohm resistance across input Vx

4. Adjust R45 for ± 0.00000

display value

5. Connect shorting bar

across input Vx

6. Adjust R46 for ± 0.00000

display value

7. Repeat steps 3. through 6. as necessary

b. Balance Adjust: R83

1. Set Range to 1V Full

Scale

2. Apply approximately 1V

to input Vx

3. Read display. Record

4. Reverse input polarity.

Record. Compare with step 3. above

5. Adjust R83 until values of 3. and 4. are exactly same on display

6. Repeat steps 3. through

5. as necessary

c. Reading Adjustments

For each full scale range, apply positive full scale voltage and adjust the appropriate potentiometer for full scale value on the display.

Set F.S. Range to	Adjust	For Reading of
1) 10-Volt Range	R87	+1.00000
2) 10-Volt Range	R51	+10.0000
3) 100-Volt Range	R43	+100.000

3.7 RESISTANCE MEASUREMENT MODE

Turn unit "ON." Depress k Ω mode switch.

NOTE

Calibration is accomplished using the 4-wire resistance set-up (Figure 3-2). Adjust until display reads known value of resistor.

Set F.S. Range to	Range Switch	Connect R Value of ohms	Adjust	For Reading of
1 k ohm	1	1.00000 k	R30	1.00000
10 k ohm	10	10.0000 k	R32	10.0000
100 k ohm	100	100.000 k	R34	100.000
1,000 k ohm	1k	1.00000 M	R38	1000.00*
10,000 k ohm	10k	10.000 M	R36	10000.0*

*Noise may obliterate last decade.

CALIBRATION

3.8 AC VOLTAGE MEASUREMENT MODE

NOTE

Connect LO voltage input to Guard.
Check signal source to assure that
it is free of harmonics.

a. Select AC-Volt Mode

b. Zero Adjust: R59

1. Select 100V full scale

range

2. Connect shorting bar across Vx

3. Adjust R59 for display

reading of 000.000

c. Low Frequency Full Scale Adjustments

At a frequency of approximately
100 Hz, apply the designated voltage
to terminals Vx, and adjust the appro-
priate calibrating potentiometer for the
indicated display reading.

and adjust the designated calibrating ad-
justment for the designated display read-
ing. Use insulated H.F. type tweeking
tool.

3.9 RATIO DC VOLTAGE MEASUREMENT MODE

a. Select DC voltage mode at the
front panel and push the RATIO button at
the rear panel.

b. Apply full scale (+10V DC) simul-
taneously to the Vx input and to the Rx
input in parallel to front panel.

c. Adjust calibrating potentiometer
R86 for a reading of +10.0000.

Set F.S. Range to	Apply VRMS to Vx	Adjust	For Reading of
1V	1.00000	R69	1.0000
10V	10.0000	R73	10.000
100V	100.000	R75	100.00
1000V	500.00	R78	0500.0

d. High Frequency Full Scale Adjustments

Change frequency of signal gen-
erator to approximately 50 kHz, apply
the designated voltage to terminals Vx,

Set F.S. Range to	Apply VRMS to Vx	Adjust	For Reading of
1000V	0200.00	C9	0200.0
100V	100.000	C30	100.00
10V	10.0000	C28	10.000
1V	1.00000	C27	1.0000

3.10 POST-CALIBRATION

As calibration is completed, enter date below and initial. Turn off power. Reassemble unit by replacing cover.

CALIBRATION RECORD

CALIBRATION RECORD

Section 4

PRINCIPLES OF OPERATION

4.1 GENERAL

The principles of operation of Series 2000 DMM are presented in two main subdivisions. Initially, in paragraphs 4.1 through 4.6, the functional performance of each of the major subsystems is presented in brief. This is intended to provide an understanding of the general function of the unit: of how the different types of input signals are processed through to the display in the various modes of operation. The remainder of Section 4 contains detailed circuit explanations. Such material is useful for further study and understand-

ing of the instrument operation and for detailed corrective maintenance, but may be omitted until needed without detracting from the effective use of the Series 2000 DMM.

4.2 SYSTEM BLOCK DIAGRAM

In its simplest form, the Series 2000 DMM is represented by the Block Diagram of Figure 4-1. The system consists of an input Signal Conditioning block, followed by the TRI-PHASIC™ Analog to Digital (A/D) Converter block, whose decoded outputs are driving signals for the Timing and Display block. The

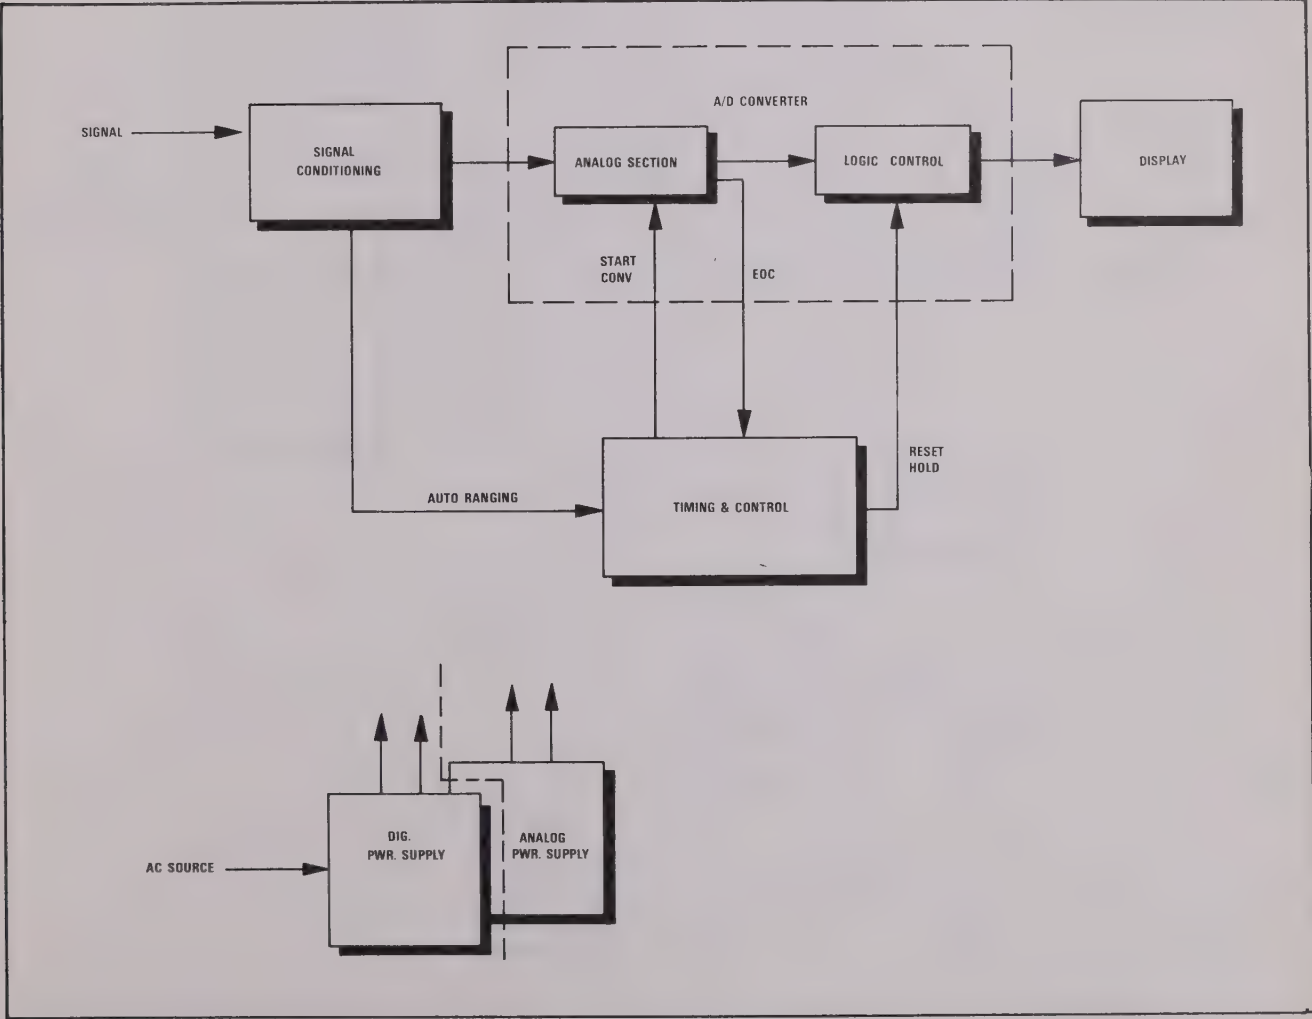


Figure 4-1. DMM Simplified Block Diagram

PRINCIPLES OF OPERATION

Timing & Control block and two Power Supply blocks complete the unit.

The major blocks in Figure 4-1 physically comprise the following:

Analog Block Diagram
(Figure 4-2)

Digital Block Diagram
(Figure 4-3).

The analog portion of the TRI-PHASIC A/D converter accomplishes the conversion in the three phases of (1) self zeroing, (2) unknown integration, and (3) reference integration, the latter two compensated by the stored value of compensating offset.

In the Analog Block Diagram (Figure 4-2), one of the three signal condition-

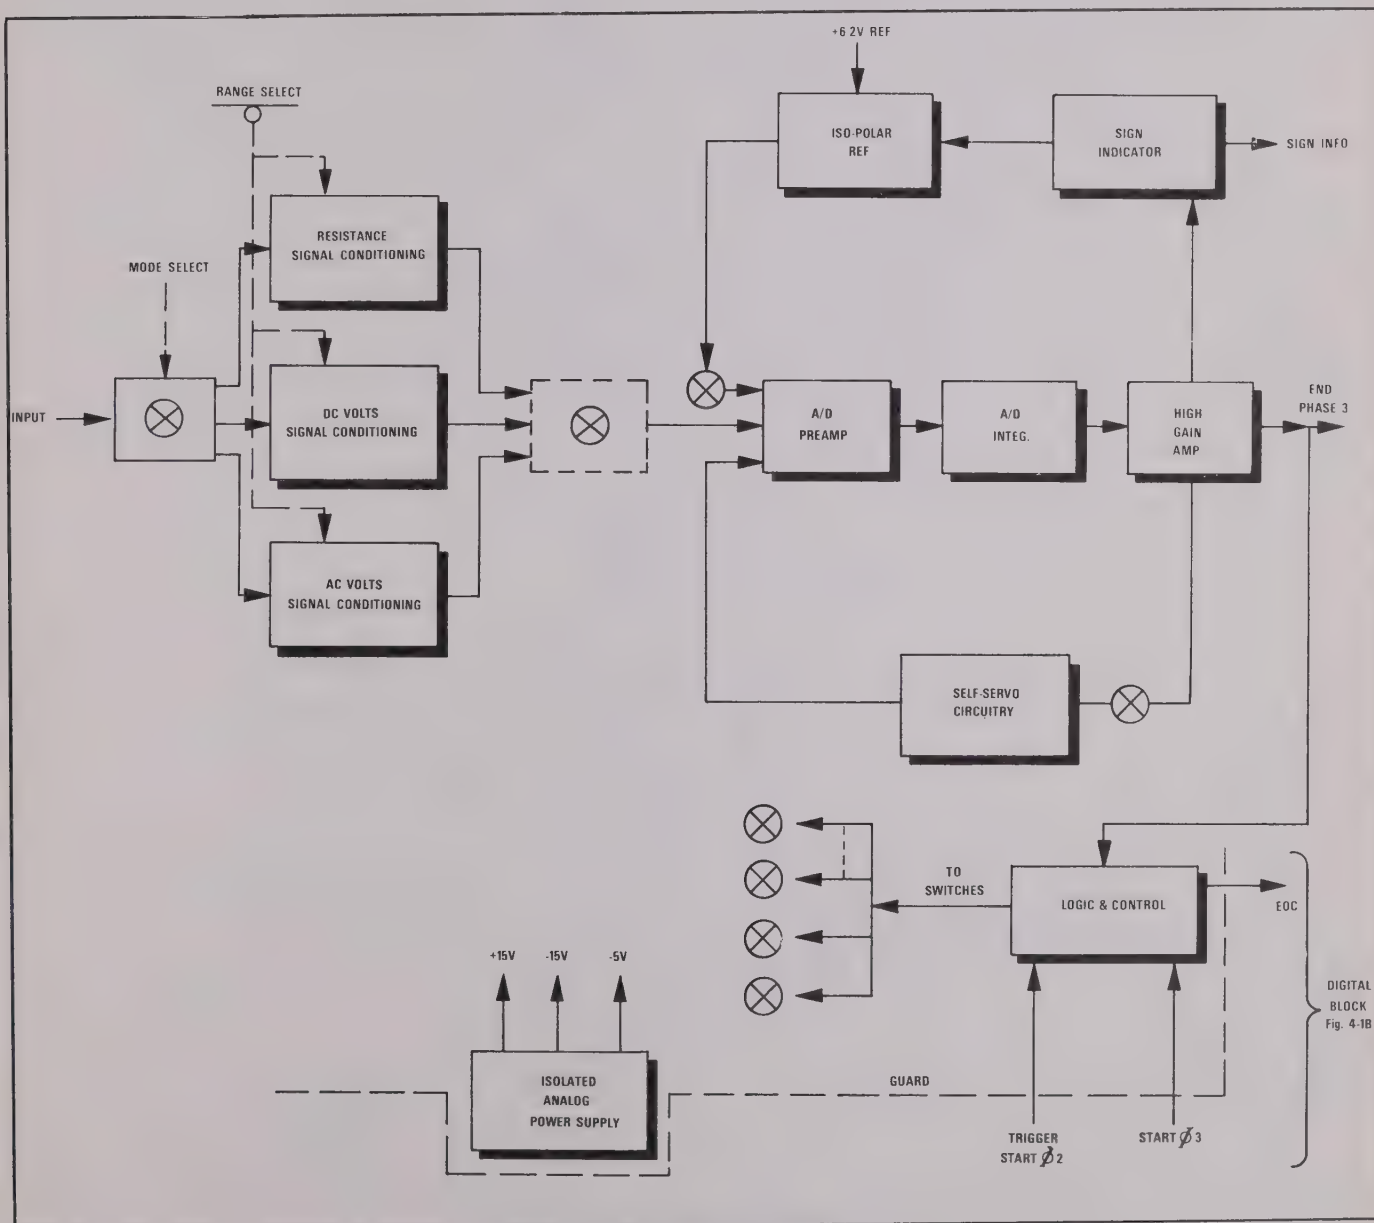


Figure 4-2. DMM Analog Block diagram

ing blocks (for Resistance, DC Volts, and AC Volts measurements) is connected via a switching network as the input to the A/D preamplifier. The preamplifier output is integrated and then processed by the high gain amplifier. The high gain amplifier outputs: (1) drive the sign indicator at the end of phase 2 to obtain the switching control signals that select the appropriate polarity of the ISO-POLAR™ reference voltage to be applied (via the switching network) to the A/D preamplifier in phase 3 and at the same time drive the Display to indicate sign, and (2) indicate end of phase 3. The high gain amplifier in phase 1 also drives the self zeroing circuitry to develop the offset signal to be applied during the phases 2 and 3 as an input to the A/D preamplifier. Logic and Control circuitry in the Analog Block Diagram receive transformer-coupled "trigger" and "start-phase 3" pulses from the digital blocks to initiate phase 2 and phase 3 converter action, respectively, in each

conversion cycle and develop end of conversion pulses to be transmitted via transformer coupling to the digital blocks to end phase 3. An isolated and triple-shielded Analog Power Supply furnishing +15V and -5V completes the DMM Analog Block section.

In the Digital Block Diagram (Figure 4-1B), the Trigger block generates a control pulse (from its own internal timing circuitry or from external command) as the "start convert" command to the Enable FF. If not blocked by the External Enable signal, the Enable FF gate permits the Crystal Clock pulses to drive the Decade Counter Chain block to start phase 2 operation. At 100,000 counts (end of phase 2) a carry pulse (10^5 CARRY) is transmitted to the Analog Block to start phase 3, while the decade chain continues its counting. When an EOC pulse is received from the Analog Block, the digital control block applies a stop command to the Enable FF stopping the count. At the same time, the Control

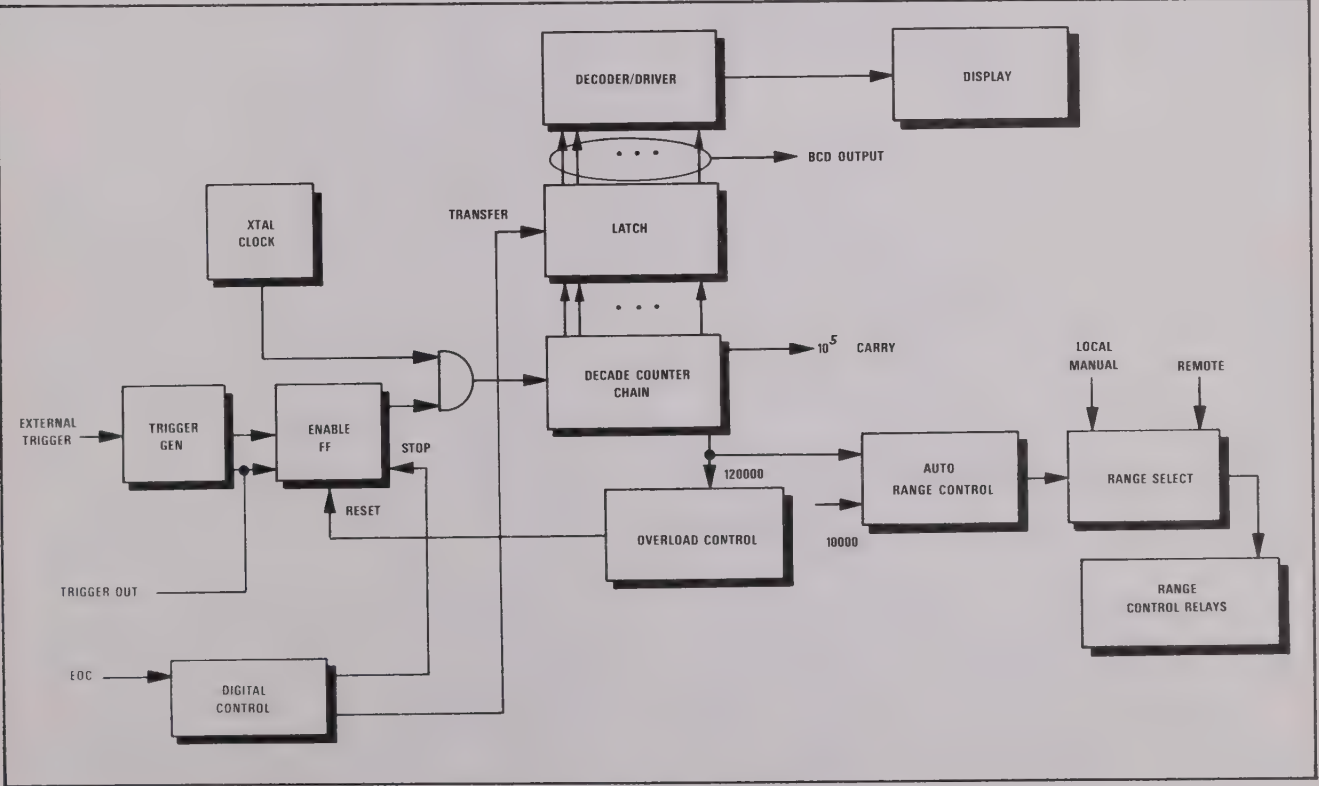


Figure 4-3. Series 2000 DMM Digital Block Diagram

PRINCIPLES OF OPERATION

block generates a transfer command to enable the transfer from the Counter to the Latches, Decoders, and Drivers, updating the NIXIE™ display. The updated count (at end of conversion) is held in the Latch and the Display until the next update and is also available as BCD output from the Latch block for remote data output applications.

The Range Select block is driven by one of three sources: manual range selection, remote range selection, or (when in auto range) a command developed when the range of a particular conversion results in a phase 3 count of less than 10,000 or more than 119,999.

Paragraphs that follow now trace the signal through the functional blocks of Figures 4-1, 4-2, and 4-3.

4.3 SIGNAL CONDITIONING BLOCK

Figure 4-2

An input signal to be measured is introduced into the Signal Conditioning block where it is attenuated according to the range scale chosen, so that a normalized full scale value of ± 1.0 volts DC is delivered to the A/D Converter block. Overrange capability of 120% of full scale is obtained by accurate operation of the Signal Conditioning block to an output value of ± 1.2 volts.

Signal Conditioning of DC voltage inputs from $\pm 1V$ to $\pm 1000V$ full scale is accomplished by inserting appropriate attenuating factors for the selected full scale range. Signal conditioning in the 0.1V full scale (option) range is accomplished in the A/D Converter block.

For AC voltage inputs, the Signal Conditioning block rectifies and filters the input signal so that the output, a DC signal, represents the average value of the sine wave multiplied by the conversion factor of 2.22 to yield the RMS equivalent (Figure 4-4).

In the Ratiohm™ resistance measurement technique, a voltage is connected across a range-selected accurately calibrated resistance in series with the unknown resistance, and the voltage drop across the unknown resistance is treated as an unknown DC voltage to be measured as before. In phase 3, however, the voltage drop across the calibrated resis-

tance is used as the reference. Because the unknown and standard resistors are in series, the ratio of voltage drops is a direct measure of unknown resistance.

Attenuation components in the Signal Conditioning block are relay operated in response to control signals. These may be initiated by operating the front panel push buttons at the DMM, by control signals transmitted from a remote station via the rear panel connector, or by control signals generated within the DMM when in AUTO ranging.

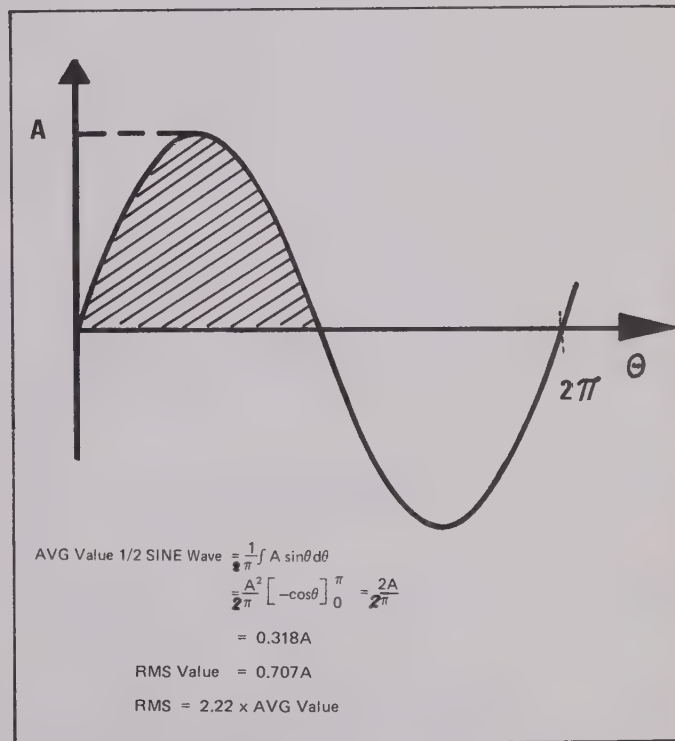


Figure 4.4. RMS/AVG Scaling Constant

4.4 TRI-PHASIC A/D CONVERTER BLOCK

Figure 4-2

The three phases of performance of the TRI-PHASIC A/D Converter are:

- Phase 1: Accumulation and storage of offset
- Phase 2: Integration of Input minus offset
- Phase 3: Integration of Reference minus offset

PRINCIPLES OF OPERATION

In Phase 1---

- a. Inputs are disconnected from the A/D Converter;
- b. Amplifier is clamped;
- c. Long-term non-zero offsets are servo-accumulated and stored for later use;
- d. Offset is updated continuously until the DMM phase 1 action ends in response to the trigger command.

In Phase 2---

- a. Clamp is removed and input is connected to the amplifier;
- b. Integration of input signal, algebraically reduced by the stored offset value, proceeds for 100 milliseconds as determined by Crystal Clock;
- c. Result of the 100-millisecond integration appears as a voltage of the integrating capacitor.

In Phase 3---

- a. Input is disconnected from A/D;
- b. Voltage of opposite polarity is selected from ISO-Polar reference, algebraically reduced by value of stored offset, and the difference integrated to discharge the integrating capacitor linearly to zero;
- c. At the zero crossover, end of conversion is generated, and transmitted to digital control circuitry.

4.5 TRIGGER GENERATOR AND CLOCK

(Digital Block Diagram, Figure 4-3)

Primary control for DMM measurement is the trigger which initiates each conversion (start of phase 2). The trigger, in its internal DMM circuitry, is generated by the discharge of a neon tube after an RC path charges a capacitor to the neon tube break-down voltage. The trigger is factory selected for a pulse repetition rate of approximately 3 per second.

The trigger may be blocked and a conversion cycle delayed indefinitely by grounding the ENABLE input for as long as desired. The display, or BCD equivalent, is held until a new trigger is generated. In addition, each conversion may be remotely triggered from an external source by a circuit which is activated when all

front panel range select push buttons are in the OUT position.

4.6 DECADE COUNTER CHAIN, LATCH, AND

DECODER. (Digital Block Diagram, Figure 4-3)

The decade counter chain, latch, and decoder are composed of monolithic IC units (one for each of five decimal digits in each of the counter, latch, and decoder blocks) under control of digital control flip flops.

During phase 2, the counter fulls up to 99,999, and the 5th decade carry pulse switches the actions of the Analog block from phase 2 to phase 3 operations.

During phase 3, the counter continues counting until it is stopped by digital control initiated by the EOC (end of conversion) pulse from the A/D Converter block.

The digital control also enables the transfer from decade counter chain to the Latch which acts as an isolating circuit and storage memory. The BCD data are connected to decoder drivers where they activate appropriate decimal lines in the NIXIE tubes.

4.7 RANGING (Digital Block Diagram)

Range scaling is accomplished by relays which may be activated in any one of three ways:

- a. Manually - by pushing front panel range select push buttons;
- b. Automatically - by digital logic control. When in AUTO Range, if the counter reaches a count of 120000 in phase 3, the AUTO Range control flip flop transmits a level output that selects the highest range possible (according to the DMM model configuration) and for subsequent conversion of less than 10000 counts steps down the selection one range step at a time to the range scale of the maximum resolution;
- c. Remotely - when in remote trigger control, a discrete range scale may be selected, by grounding directly, or by a logic low level command.

PRINCIPLES OF OPERATION

4.8 POWER SUPPLY BLOCK

The Power Supply block may be connected for either a 115-volt or 230-volt AC Source of frequency from 47 to 420 Hz. The block is essentially two separate sets of supplies, driven from the same input transformer primary. The analog supply is triple shielded, floating, and incorporated in a "guarded" area for proper isolation. It develops $\pm 15V$ regulated supply voltage for the analog circuitry, $-5V$ for the digital control in this section, and develops the 6.2 volt, oven controlled, extremely low temperature coefficient, reference source for the A/D Converter. Common ground for the precise reference is used as the high voltage for the isolated digital control section, where the low voltage level is the -5 volts.

The transformer primary drives three additional secondaries whose outputs are rectified and provide $+20$ volts for relay operation, $+180$ volts for NIXIE tube operation, and a regulated $+5$ volts for digital logic. These appear in the digital section of the converter and use the digital ground as their return.

4.9 DETAILED OPERATION

A more complete function diagram of the Series 2000 DMM is illustrated in Figure 4-5. The major blocks comprising the unit are divided into subunits or are repeated to indicate the several functions performed sequentially by the block, and this division forms a basis for complete systems understanding, detailed circuit explanation, and maintenance. Complete schematics, from which simplified schematics and block diagrams have been derived, are contained in Section 6 and are prepared as fold-outs for convenient reference when reading the following text.

The sequence of functions illustrated in Figure 4-5 consists of the following:

1. Operating mode and Full Scale Range are selected. Proper attenuation elements for the selected range are connected in the Signal Conditioning block.

2. Input signal is applied.

3. Prior to the trigger pulse starting a conversion measurement, the A/D Converter input is clamped, and the Signal Conditioning output is removed from the A/D Converter. During that time, phase 1 drift integration proceeds and the self zeroing circuit determines the A/D amplifier accumulated drift and stores it for phase 2 and phase 3 operation.

4. Following the trigger pulse generated in the Timing & Control unit;

- a) The clamp is removed from the A/D Converter.

- b) The Signal Conditioner Output is connected to the input of the A/D Converter.

- c) The self-zeroed drift is introduced as an algebraic negative offset.

- d) The counter is reset to zero and starts its fixed count for the phase 2 integration.

5. When the count has reached 100,000 (100 millise.),

- a) The second integration is stopped.

- b) The sign of the input is interrogated by strobing the integrator output.

- c) The unknown signal input is removed from the integrator.

- d) The appropriate polarity of internal reference voltage is applied to the A/D input.

- e) The reference voltage reduced algebraically by the stored drift (as in phase 2) is integrated during phase 3 integration.

PRINCIPLES OF OPERATION

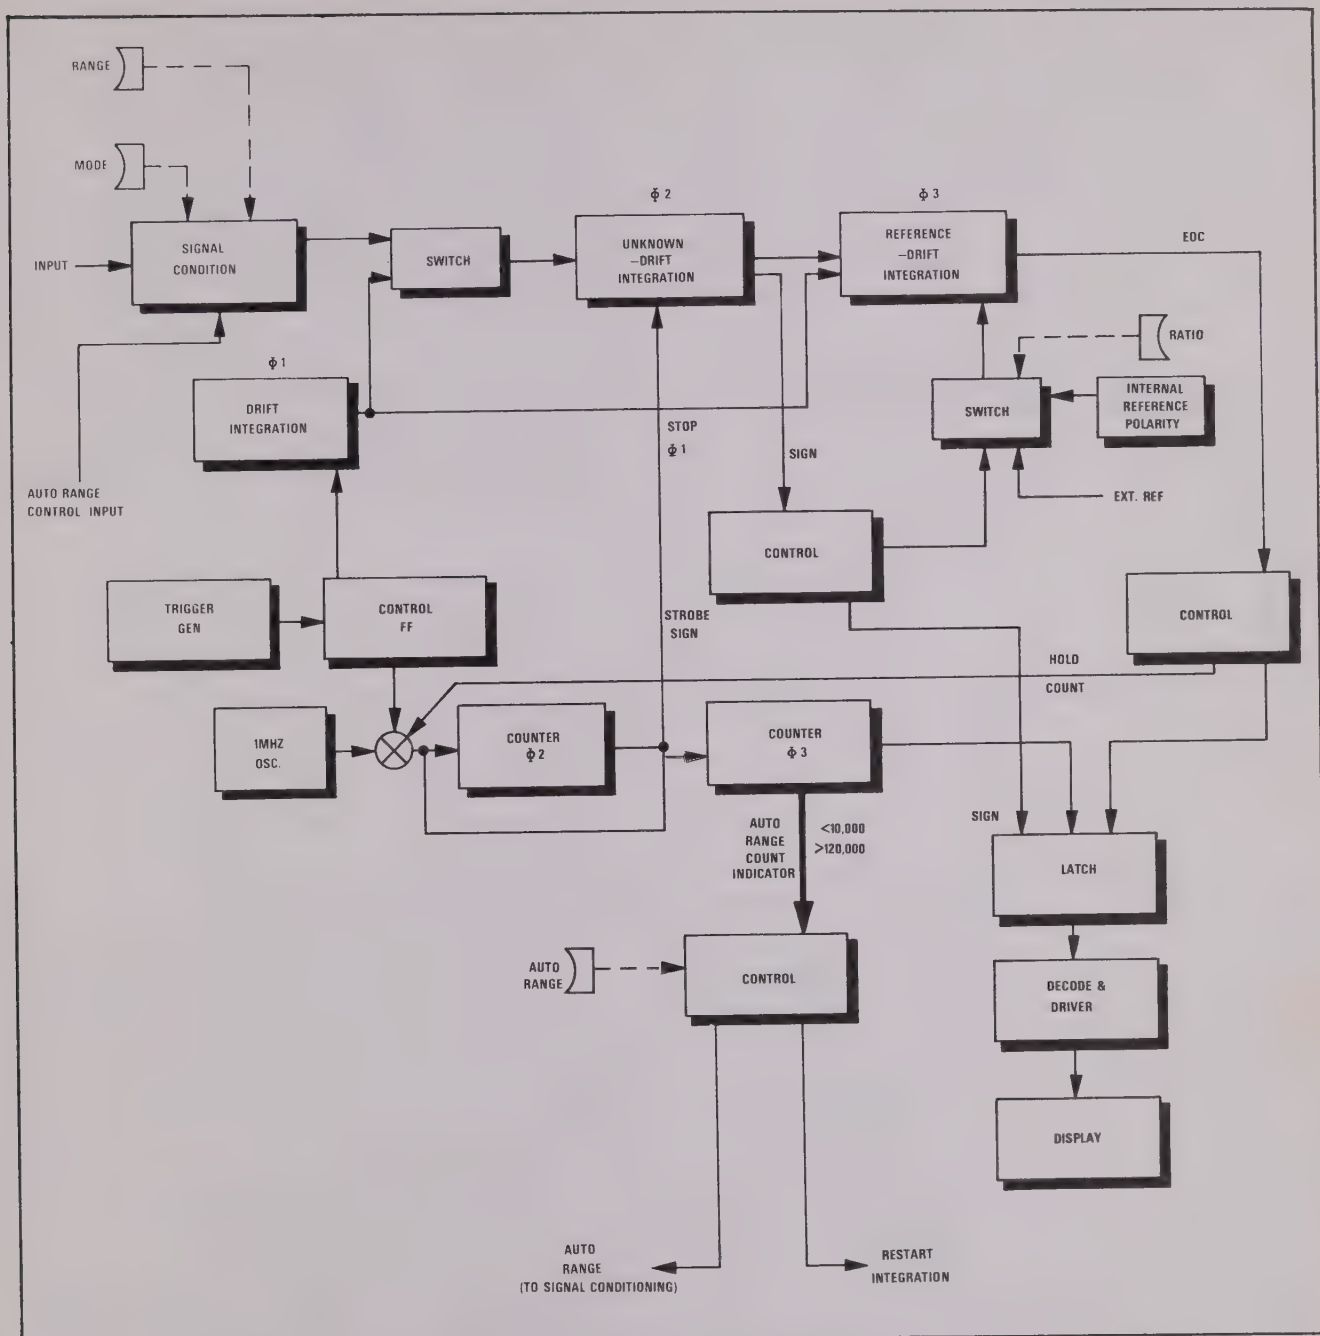


Figure 4-5. DMM Functional System Block Diagram

6. When the integrated reference compensates the integrated unknown input (when the output of the integration returns to the starting point),

- a) Phase 3 integration pro-

cess ends.

- b) The input clamp is re-established.
- c) The clock input to the counter is stopped.

PRINCIPLES OF OPERATION

d) A READ OUT signal is transmitted indicating End of Conversion.

e) The accumulated count is transferred to the display.

The timing sequence is illustrated in the chart of Figure 4-6, indicating the three phases of the operation.

Detailed explanations of these functions are presented in the following sequence:

a. Input signal conditioning (Figure 4-5A)

b. Phase 1 Drift Integration

c. Phase 2 Unknown-Drift Integration (Figure 4-5C)

d. Phase 3 REFERENCE-DRIFT Integration (Figure 4-5D)

e. Digital Control and Display (Figure 4-5E)

f. Ranging circuits and Remote display and control functions.

4.10 SIGNAL CONDITIONING DETAILS

a. DC Voltage

Input DC voltages are applied through the HI and LO input terminal, and

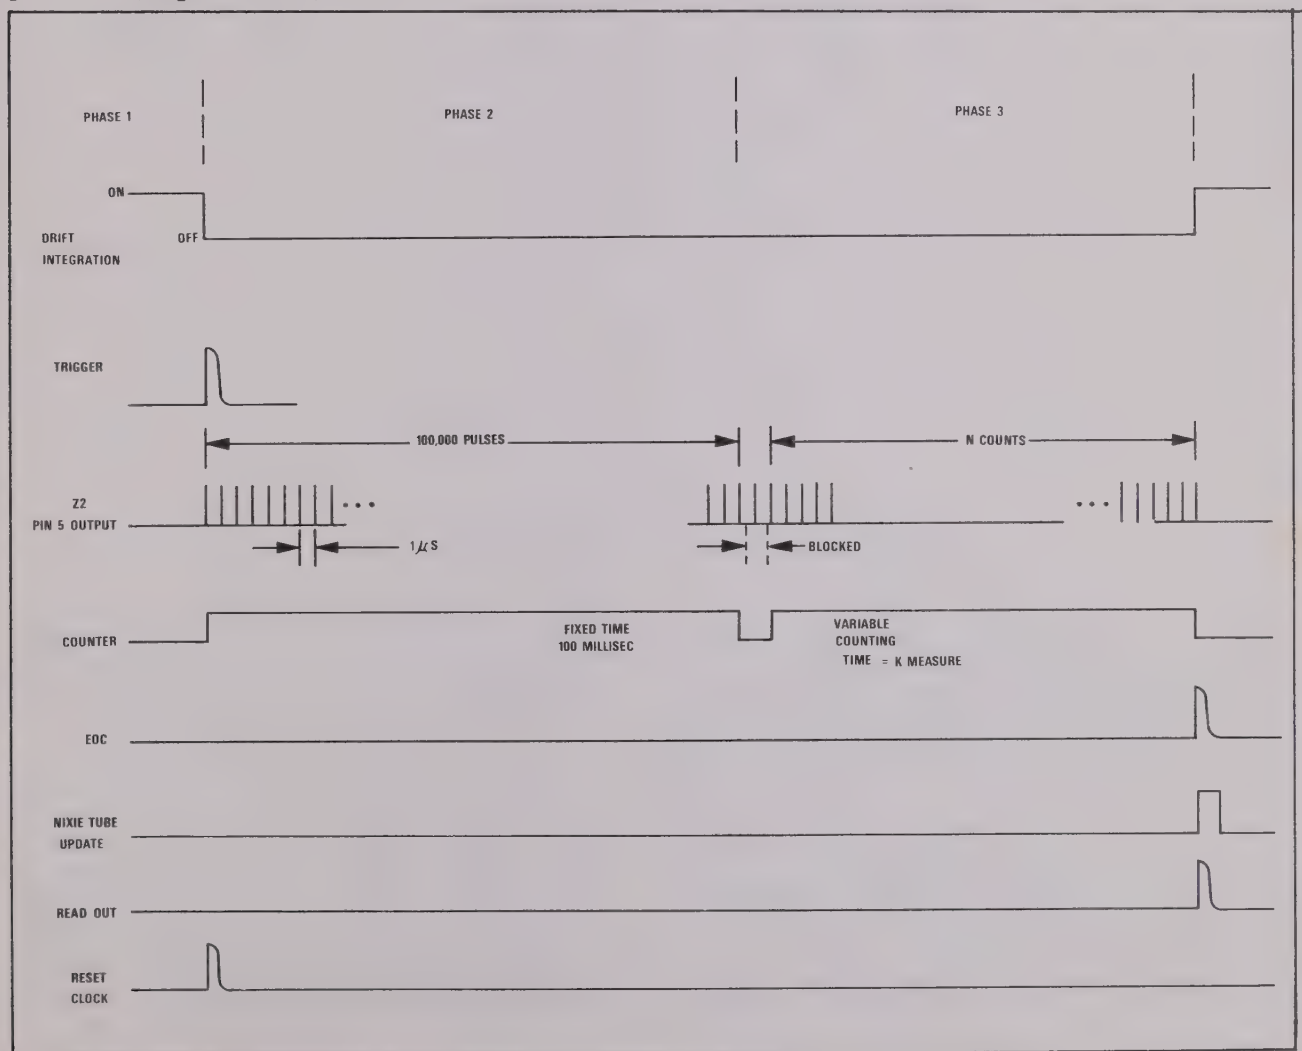


Figure 4-6. DMM System Timing Diagram

PRINCIPLES OF OPERATION

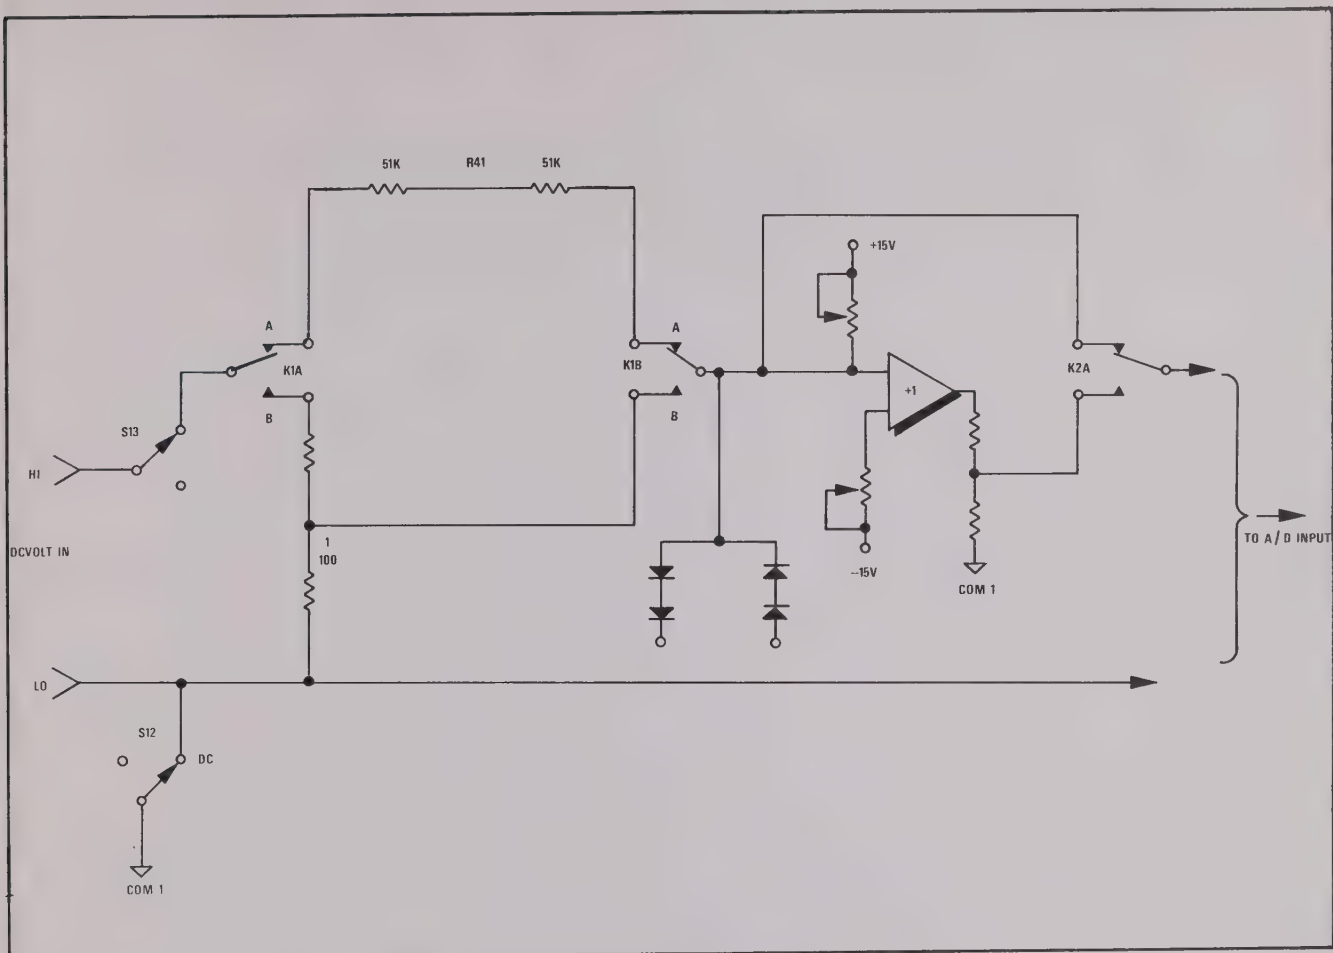


Figure 4-7. DC Voltage Signal Conditioning Simplified Schematic

connected to the input attenuator network through the contacts of Mode Switch S12 and S13 when placed in DC Volts Mode. Relay actions of K1 and K2, determined by the range selection, then establish the attenuator actions.

A simplified schematic of the DC Voltage signal Conditioning action is shown in Figure 4-7.

The relay pair (K1A and K1B) and relay K2A provide four range selections from 1V Full Scale to 1000V Full Scale. (Range change from 1.0V to 0.1V Full Scale is accomplished in the A/D Converter.) Action of the relays and resultant attenuation of the input signal

on the different range scales are summarized by the table below.

Full Scale Range Select	Relay K1 1/100	Relay K2 1/10	Result. Atten.
1 Volt	OFF	OFF	1
10 Volts	OFF	ON	1/10
100 Volts	ON	OFF	1/100
1000 Volts	ON	ON	1/1000

Full scale voltage delivered to the A/D Converter is 1 volt on all ranges except the 0.1 Volt scale. In that range

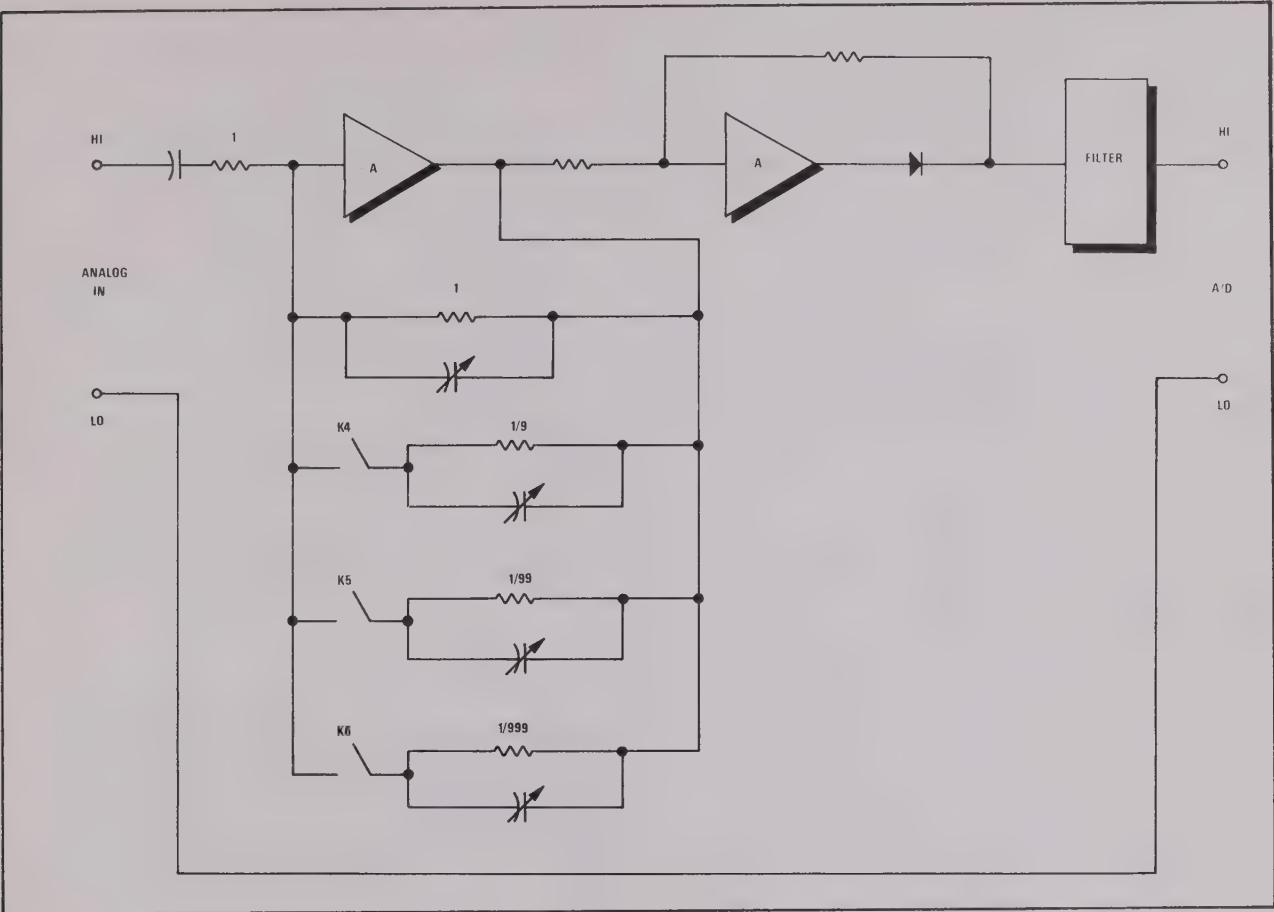


Figure 4-8. AC Voltage Signal Conditioning Simplified Schematic

the full scale output of the Signal Conditioning block is 0.1 volt. In all cases, overrange values, up to 120% of full scale are converted accurately in the A/D Converter, up to a maximum input of 1000 volts DC.

The signal conditioner amplifier is a high impedance, unity gain, isolation unit, provided with voltage and current offset adjustments. It is connected only when relay K2 is activated. The input network, including R41 and the biasing diodes, is designed to protect the Multimeter from accidental connection of high voltages up to ± 1000 volts regardless of the range selector setting.

When not in DC Volt Measurement Mode, the input is removed from the indicated circuitry.

b. AC Voltage

In AC Voltage Mode, the input is connected to a broad band active attenuator followed by an active rectifier and filter. Networks in the feedback path of the input amplifier determine the attenuation for the selected full scale range. Capacitor trimmers are adjusted to maintain constant feedback ratios over the range of input signal frequencies. Manual push button action or automatic ranging signals control the relay-operated selection of the appropriate attenuation decade. A simplified schematic of the circuit is shown in Figure 4-8. This illustrates the amplifier and its feedback decades, the half-wave rectification of the second amplifier output, and the low pass filter which passes the average

PRINCIPLES OF OPERATION

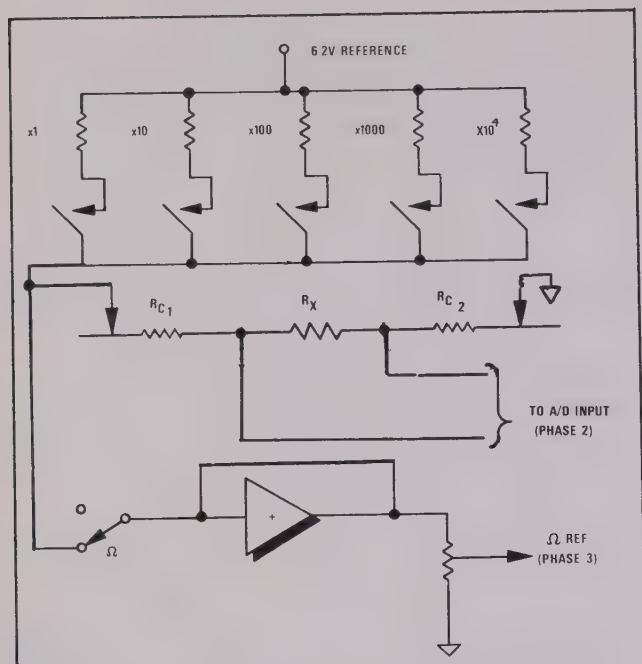


Figure 4-9.

Resistance Measurement Signal Conditioning Simplified Schematic

DC component of the rectified output.

The filtered, rectified DC Voltage output is scaled to the RMS value of the applied input signal and feeds the A/D Converter.

4.11 RATIOHMIC RESISTANCE INPUT CONDITIONING DETAILS

Connections for Resistance measurements are shown in the schematic of Figure 4-9. The unknown resistor is made part of a resistance series set consisting of a selected range scale resistor, the undetermined contact resistances R_{C1} and R_{C2} , and itself. This set is driven from the temperature controlled +6.2V reference voltage. During phase 2, the voltage drop across R_X is connected to the A/D Converter where it is processed in the same manner as a DC input signal. During phase 3, the voltage drop across the selected range scale resistor is buffered by the unity gain amplifier, divided by 6.2 using the calibrated divider network, and connected to the converter as the Reference input.

The indicated circuit operation features the following:

- The same current develops the unknown and reference voltage signals.
- The contact resistance voltage drops do not affect performance.

4.12 A/D CONVERTER DETAILS

Operation of the Tri-Phasic A/D Converter in its 3 phases is described with the aid of simplified schematics of Figure 4-10A and Figure 4-10B, derived from the complete reference drawing in Section 6.

Referring to Figure 4-10A, during phase 1, switch Q1 is open, switches Q2, Q23, and Q25 are closed. Opening of Q1 removes the Signal Conditioned input from the A/D preamplifier A1. Closing of Q2 clamps the input to A1, and, with Q23, closes a path whereby C34 is charged from the ISO-Polar reference to 1 volt. Closing of Q25 permits capacitor C36 to store a charge compensating for the accumulated non-zero offset in A1, A2, and Z29.

Appearance of the trigger pulse in the secondary of transformer L2 (Figure 4-10B) signals the start of phase 2, and initiates the control actions by flip flop Z31A. The trigger causes pin 5 to go high and consequently Q1 to close. The output Z31A pin 8 goes low, and consequently opens transistor switches Q2, Q23, and Q25.

- Opening Q23 opens the charging path to C34 (Figure 4-10A) and leaves C34 charged to 1 volt and isolated during phase 2.

- Opening Q25 opens the charging path of C36 and leaves it charged with the accumulated compensation for zero drift applied to the input of the differential integrating amplifier A2.

- Closing Q1 connects the Signal Conditioned output to the A/D Converter input.

Phase 2 integration action takes place in the chain of three active elements: amplifier A1, amplifier A2, and amplifier Z29. Amplifier A1 is a high gain, high input impedance, low offset amplifier whose feedback resistors R93 and R94 determine the closed loop gain.

PRINCIPLES OF OPERATION

The output of amplifier A1 is one input to integrating amplifier A2 whose integration constant is determined by C35 and R95. The other input to amplifier A2 is the voltage on C35, the stored value of the voltage compensating for the accumulated zero offset derived in phase 1.

Output of amplifier A2 drives high gain amplifier Z29 to saturation during phase 2. Its output polarity is used to indicate the sign of the unknown input.

Phase 2 integration proceeds until the appearance across the secondary of L4 of a positive-going pulse signalling a 10^5 carry from the digital block. This now appears as a negative pulse clocking flip flop Z30A pin 2 and as a direct set for flip flop Z31A (pin 4). The resulting actions controlled by these flip flops initiate the phase 3 operation of the A/D Converter.

The output, pin 5, of Z31A, which had been high from the start of phase 2, now goes low opening Q1 thereby removing the signal input from the A/D amplifier. Action of flip flop Z30A in response to the clocking pulse depends upon its input conditions just prior to receiving that pulse. This in turn was determined by the output of amplifier Z29 during phase 2. Amplifier Z29 was driven to saturation in the positive or negative direction corresponding to the sign of the input signal.

If the input signal had been positive, Z30A pin 11 would have been low and the clocking pulse would not have changed the high level at pin 6, thus producing no pulse across the primary of "sign" pulse transformer L5. If the input signal had been negative, Z30A pin 11 would have been high and the clocking pulse would cause Z30A pin 6 to go low producing a pulse across the transformer L5 primary and transmitting a negative sign indication to the Digital circuitry. The voltage level developed by flip flop Z30 at pin 9 controls the sign of the reference signal to be switched to the amplifier input at the start of phase 3. (Refer to Figure 4-11 in conjunction with Figure 4-10B.)

During phase 2, both Q22 and Q24 are open. The low level output at Z30 pin 9 had kept Q22 open; and the output of Z28

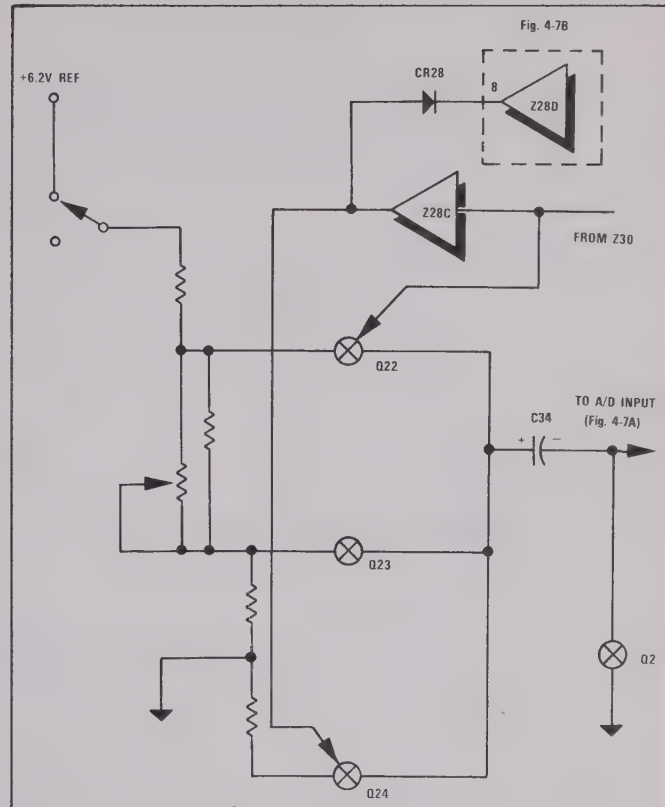


Figure 4-11. ISO-Polar Reference Switching Simplified Schematic

pin 6 had been clamped low through CR28 to Z28D, keeping Q24 open. If the input signal had been positive, Z30 pin 9 would have remained low, keeping Q22 open. The carry pulse control action removes the clamp on the Z28 pin 6 output permitting the output of Z28 pin 6 to go high, closing Q24. This action places the high side of C34 at reference zero potential and negative one volt at the A/D amplifier input. If the input signal had been negative, Z30 pin 9 would go high, closing Q22 and connecting the high side of C34 to reference +2V causing a positive one volt at the A/D amplifier input.

Control actions for the end of conversion (end of phase 3) are initiated by the zero crossing of the Z29 output, sensed by the gating action of Z32C and Z32D, and developed in digital control flip flops Z31. At each gate Z32C and Z32D, two of the three inputs are high during phase 3. As the output of Z29

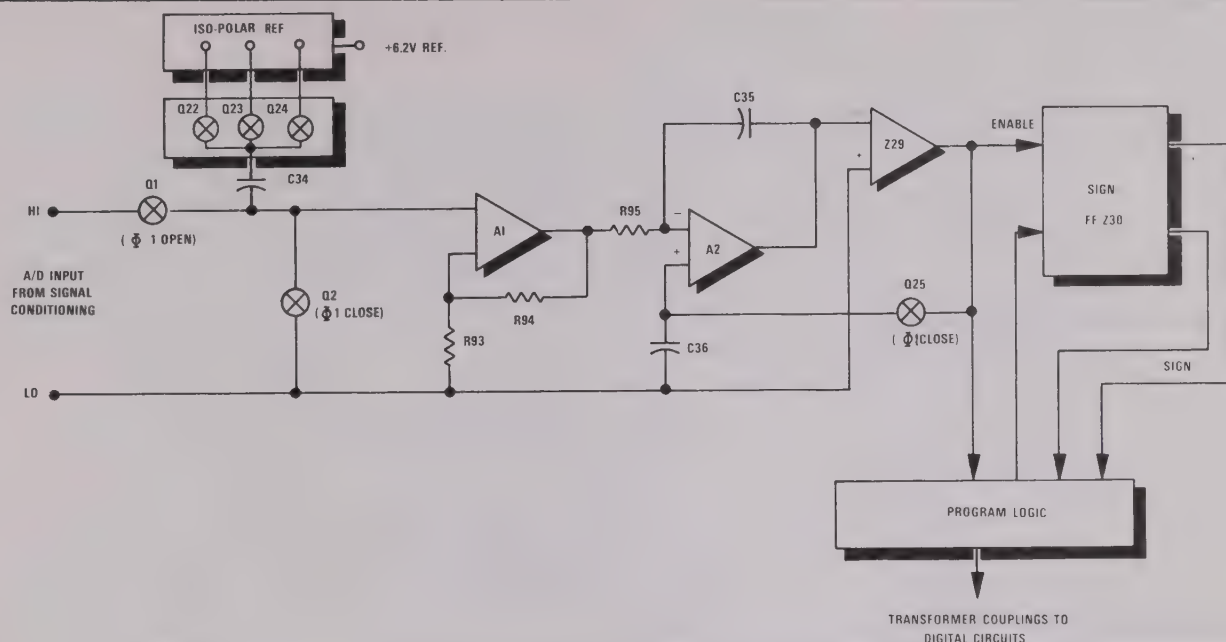


Figure 4-10A. Tri-Phasic A/D Converter Simplified Schematic

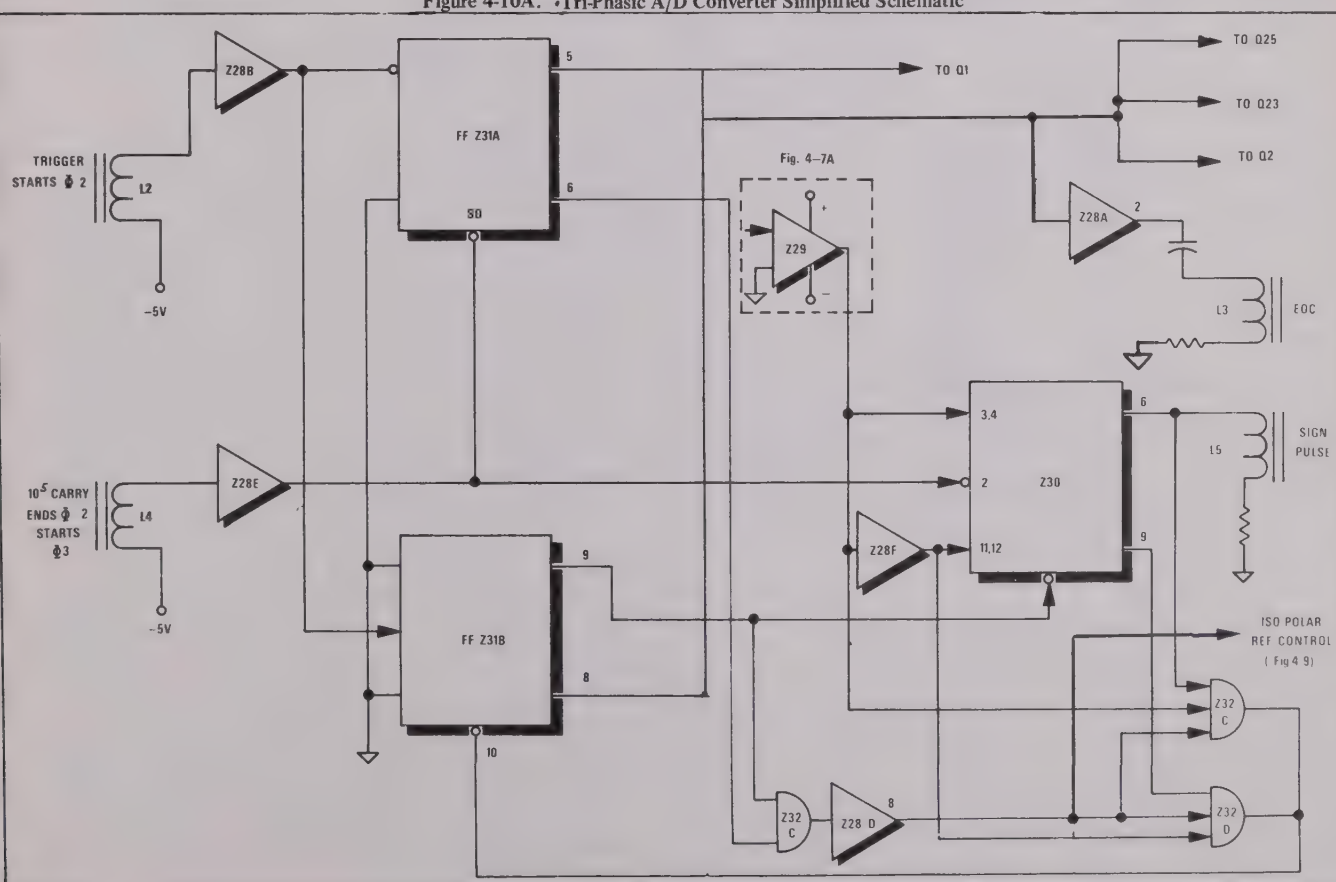


Figure 4-10B. Tri-Phasic A/D Converter Control Simplified Schematic

PRINCIPLES OF OPERATION

LOGIC LEVELS

crosses zero in either direction, one of these gates is enabled and develops the negative direct set pulse at flip flop Z31 pin 10. The Z31D output goes high, is inverted by Z28A, and develops a pulse across EOC transformer primary, signaling end of conversion to the digital circuitry. The Z31D output also controls the resetting of A/D converter to phase 1 operation. It --

- a. Closes Q25
- b. Closes Q2
- c. Clamps Z28 pin 6; opens Q24
- d. Direct sets Z30; opens Q22
- e. Closes Q23
- f. Opens Q1.

In summarizing the actions of the A/D converter circuitry during the three phases of operation, the levels and signals of the gates, flip flops, etc. are tabulated below.

4.13 TRIGGER GENERATOR AND COUNTER

a. Trigger Generation

The trigger pulse initiating each conversion process may originate either from an external source or from internal circuitry shown in the simplified form of Figure 4-12. Capacitor C1 charges toward 180V through R14 until the firing voltage of DS8 is reached. The DS8 neon gap breaks down, and a pulse approximately 100 usec wide and 4 volts magnitude is developed across R16 and connected to the SET ENABLE input of the control flip flop (Z2 pin 2). The sawtooth charge-discharge signal at the junction of R15 and DS8 and resulting trigger timing signal across R16 are also included in Figure 4-12.

Non activation of all of the ranging push buttons disconnects the internal trigger signal (Manual or Automatic) and permits an external trigger pulse to be connected to the DMM flip flop circuitry. If desired, the internal trigger generator may also be used during remote control of the DMM by connecting the output ENABLE of rear panel connector, tab J, to the EXTERNAL TRIGGER input, tab 21.

With the trigger pulse enabling Z2A, the next clock pulse toggles Z2.

ACTION	Z	PIN	LEVEL
INITIAL CONDITIONS Ø1	Z31	1	High
		2	High
		4	High
		5	Low
		6	High
		8	High
		9	Low
		10	High
	Z30	10	Low
		3	High
		6	High
		9	Low
		11	Low
	Q1		Open
Q2		Closed	
Q22		Open	
Q23		Closed	
Q24		Open	
Q25		Closed	
Z28	8	Low	
Ø2 STARTS WITH POSITIVE PULSE THROUGH L2	Z31	1	Clock pulse
		13	Clock pulse
		5	High
		6	Low
		8	Low
		9	High
	Z30	10	High
	Z28	8	Low
	Q1		Closed
	Q2		Open
	Q22		Open
	Q23		Open
	Q24		Open
	Q25		Open
Ø3 STARTS WITH CARRY PULSE THROUGH L4	Z31	4	Neg. pulse
		6	High
		5	Low
	Z30	2	Clock pulse
		3	High if input pos. Low if input neg.
		11	Low if input pos. High if input neg.
		6	High if input pos. Low if input neg.
		9	Low if input pos. High if input neg.

LOGIC LEVELS (cont.)

ACTION	COMP PIN		LEVEL
	L5		Pulse if input neg. No pulse if input pos.
	Z28	8	High
	Q1		Open
	Q2		Open
	Q22		Closed if input neg. Open if input pos.
	Q23		Open
	Q24		Open if input neg. Closed if input pos.
	Q25		Open
END OF Ø3; Z29 PIN 7 CROSSES ZERO	Z32	6 or 8	Goes neg. pulse
	Z31	10 8 9	Low High Low

ACTION	COMP	PIN	LEVEL
END OF CONVERSION; NEGATIVE PULSE THROUGH L3	Z30	10 6 9	Low High Low
	Z32	8 6	High High
	Z28	8	Low
	Q1 Q2 Q22 Q23 Q24 Q25		Open Closed Open Closed Open Closed
RETURNING TO Ø1 OPERATION			

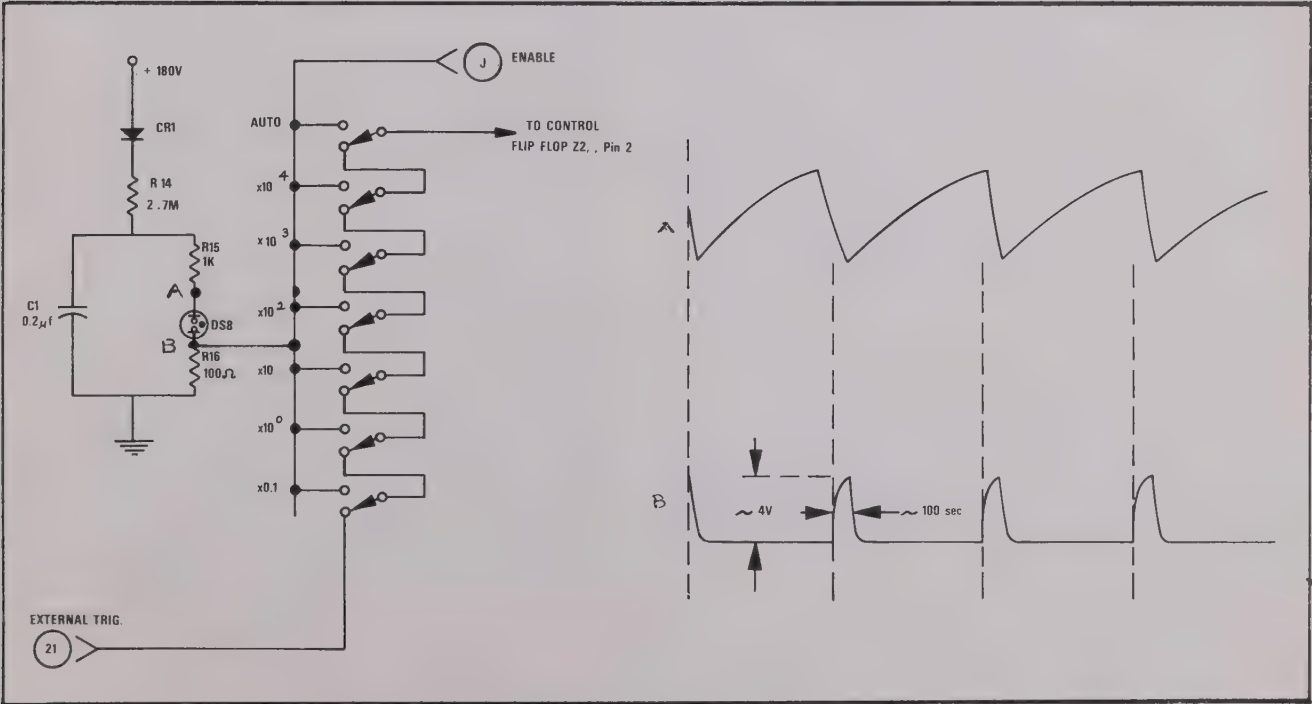


Figure 4-12. Trigger Generator Simplified Schematic and Waveforms

PRINCIPLES OF OPERATION

Pin 5 goes high and pin 6 goes low providing a control output with the following results:

1. After inversion through Z3 pin 3, transistor Q5 conducts; its collector goes low isolating the latching circuit from the counter. The latch and display retain the stored count until the next conversion update, and an output signal, READOUT, is available at the rear panel connector to indicate this event in the cycle. This is a High (T^2L/DTL) output level between conversions.

2. The leading edge of the negative going waveform is differentiated (C5, CR20, and R21) as the input to Z1 (pin 13), inverted, and generates a positive going pulse to reset the decade counter IC's, Z4 through Z8.

3. The inverted counter reset pulse, at the output of Z1 (pin 10) presets the control flip flops Z20 pin 10 and pin 4, and Z2 pin 10.

4. Z3 pin 4 is enabled, allowing the clock to drive the counter.

b. Counter Chain

The crystal-controlled clock is a series-mode crystal circuit consisting of crystal Y1 and inverter Z1. It develops 1 MHz pulses which are gated into the counter during phases 2 and 3. The counter registers accumulate the count during phases 2 and 3 until receipt of the EOC (End of Conversion) pulse at the EOC transformer secondary. This resets flip flop Z2, and pin 5 goes low, blocking the timing pulses at gate Z3 (4, 5, 6). Simultaneously, Z2 pin 6 goes high cutting off Q5, collector voltage goes high, permitting the count in Z4-Z8 and Z2 to be transferred to the latches, and through them to the decoding and display driving registers Z15 and Z19.

Outputs of the counter chain are transferred through the latching registers as BCD data. These are immediately available at the tab connector of the DMM rear panel for remote display or control purposes. In the DMM, the decoding registers Z15 through Z19 convert BCD to decimal signals for their respective NIXIE tubes.

If the DMM is in a manual range selection, and the developed count in phase 3 is less than 120,000, the conversion cycle is complete.

c. Overload

If an end of conversion pulse is not received during phase 3 by the time the counter reaches 120,000 (a display of 120,000), an OVERLOAD condition exists, and this event is sensed at gate Z3. One input to Z3 (pin 9) is set at a high level by the toggled output of Z20 pin 5 when the count reaches 10^5 in phase 3. When the counter reaches 20000, the second input to Z8 (pin 10) goes high and activates the gate. The gate output, Z3 (pin 8) is a negative waveform, available at rear panel connection, pin Y, as an OVERLOAD indicating signal for remote transmission. The overload indicating negative level also is connected at the output of Z1 pin 2 and acts in the same circuitry through Z11 pin 2 as a direct set for flip flop Z2 pin 4.

The overload condition, generating high levels of 10^5 and 2×10^4 , back bias CR47 and CR46, respectively, and the combined action cuts off transistor Q2 to turn off the digit indicator (MSD-1) of the most significant digit in display tube DS2. At the start of the next conversion cycle, when the counter is reset, the back bias levels are removed, and the display responds to the 10^5 count to turn DS2 on during the conversion. Thus, the most significant digit blanks as a result of successive overload conditions.

d. Sign

DS1 is the display unit for the sign indication. It is enabled in DC mode only, and is turned on by the action of the sign pulse transformer L5 via latch flip flops Z14. It is strobed into the first latch at carry pulse and transferred to second latch at EOC.

PRINCIPLES OF OPERATION

4.14 RANGING (Figure 6-4, Drawing 35-1003)

a. Manual Control

All range selections are controlled by the actions of Relays K1 through K6, and decimal point selection is slaved to the relay actions. Each relay activation is controlled by a switching transistor (Q12, Q13, Q14, or Q15) driven by its inverter Z24 pins 2, 4, 6, or 8. The truth table included in the reference detail schematic of Section 6 relates the relay actions for each full scale range selection. In manual ranging, grounding the appropriate line via the switch at the front panel, either by grounding the line, or by applying a logical zero at a remote station, operates the required relays via the appropriate inverter, for each selected range. Selection of the highest range $\times 10^4$ (for resistance measurement only) biases off all transistor switches Q12 through Q14, and satisfies the truth table conditions for that range.

b. Auto-Ranging

The non-Automatic position of the S7 switch (for Manual Mode) disables the control flip flops Z21 and Z22, A and B, gates Z23, and inverter Z24 (pin 12). The circuitry is enabled when switching to Auto Range, lifting the ground and operating in response to control signals through gates Z21 (pins 3 and 6).

Voltage Auto Ranging

Either of two events causes the Auto Ranging circuit to change its full scale range:

1. An overload indicated by count of 120000 sensed at gate Z21 pin 3;
 2. An underrange, indicated by a count under 10000 at end of conversion, sensed at gate Z21 pin 6.
- In either event, the gate output is negative going.

Overload

At the overload voltage event, the negative going action of gate Z21 pin

3 acts as a direct set on flip flop Z22A and Z22B. The flip flop outputs apply enabling levels to gate Z23 pins 12 and 13, and cause the output at pin 11 to go low, acting to select the highest voltage range, 10^3 .

If the succeeding conversion results in an underrange condition, then, at the READ event, gate Z21 pin 6 is negative going and clocks both flip flops Z22A and Z22B resulting in the stepping of the range selection to the next lower range. The process is repeated, dictated by enabling levels at the flip flops, until the range of maximum resolution for the input signal is selected.

Resistance Measurement Auto Ranging

When in auto ranging during Resistance measurement mode, the mode-switched circuitry disables transistor Q21 and lifts the clamp from flip flop Z21 pins 10 and 11. When an overrange condition is sensed by gate Z21 pin 3, its output causes Z21 pin 11 to go high; then through inverter, Z24, causes pin 12 to go low, producing the same result as closing switch S6A. This action results in the selection of the highest ohms measurement range scale (10^4).

In addition to controlling the relay selection for $\times 10^4$ scale, the action disables flip flops Z22B for the next event by a negative level at pin 2 of flip flop Z22B, and a consequent negative level at pin 12 of Z22A. If an underrange condition should occur at a succeeding conversion, Z21 pin 6 output will not change the states of flip flop Z22A or Z22B. It will, however, set flip flop Z21 pin 8 high and pin 11 low, and through the inverter action of Z24 pin 12 activate Q11 and the $\times 10^3$ range scale select relay. In addition, it will enable flip flop Z22A, and thereby establish the conditions for subsequent toggling response to the next sensing of underrange conditions in the same manner as for voltage measurement auto ranging.

Section 5
OPERATOR & FIELD MAINTENANCE

5.1 GENERAL

Series 2000 Digital Multimeters use solid state components and integrated circuits (except for display tubes), and are designed for reliable long-life operation. Except for calibration verification, no operator maintenance should be required, and there should be no normal requirement for opening the DMM case. Should any malfunction require corrective action within the warranty period, arrangements should be made to obtain factory assistance.

CAUTION

Data Precision provides this maintenance information primarily for users of Series 2000 Digital Multimeters in need of repair after the expiration of the Warranty period. The information is intended for users who are qualified and competent to effect any needed repairs. The equipment may be returned for repairs at a nominal fee if the user should elect to have the factory make repairs.


Should the qualified user attempt to troubleshoot and repair the DMM, he will find that Series 2000 DMM contains a number of features especially designed for simplified unambiguous troubleshooting and fault indication. Among these are:


- a. Full and complete design and parts data in this Instruction Manual;
- b. A positive troubleshooting procedure intended for effective use by competent technical personnel in isolating and correcting all but the most subtle and intricate problem sources;
- c. Mechanical parts layout and identification for logical and easy location.

5.2 PARTS GROUPING AND THE TEST STAND-OFF GRID

The printed circuit board is etched to show the grouping into major functions of the components (Figure 5-1). These correspond, generally, to the schematics in Section 6. The separate groups are individually named, the designations appearing along the edge of the board. When the Guard Shield is removed, the floating Analog power supply and the analog portion of the A/D Converter and Signal Conditioner are revealed. The two amplifiers of the A/D Converter and the CLAMP/UNCLAMP switching module are separate modular components. They are mounted on the base PC board as integral component assemblies.

Verifying signal values throughout the circuit is considerably simplified mechanically by strategically positioned stand-offs, connected to circuit components for easy access to points where performance may be monitored. Each installed stand-off is identified by an E-number on the schematics, and etched on the PC board. Access to every major critical portion of the circuit has been assured.

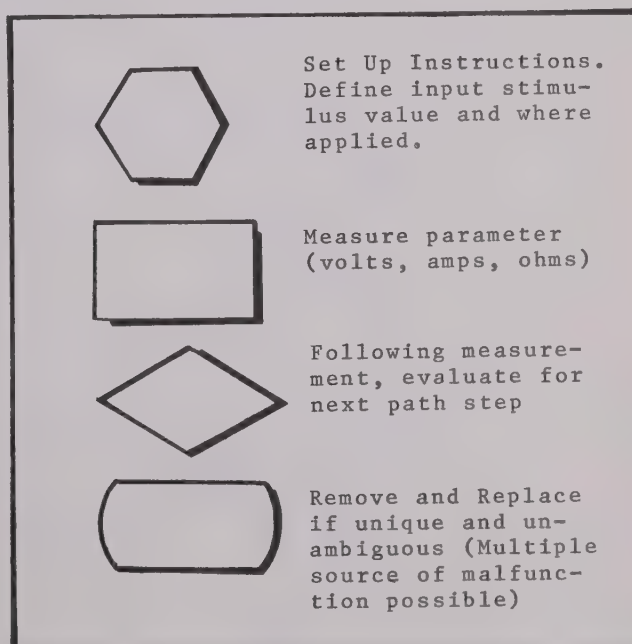

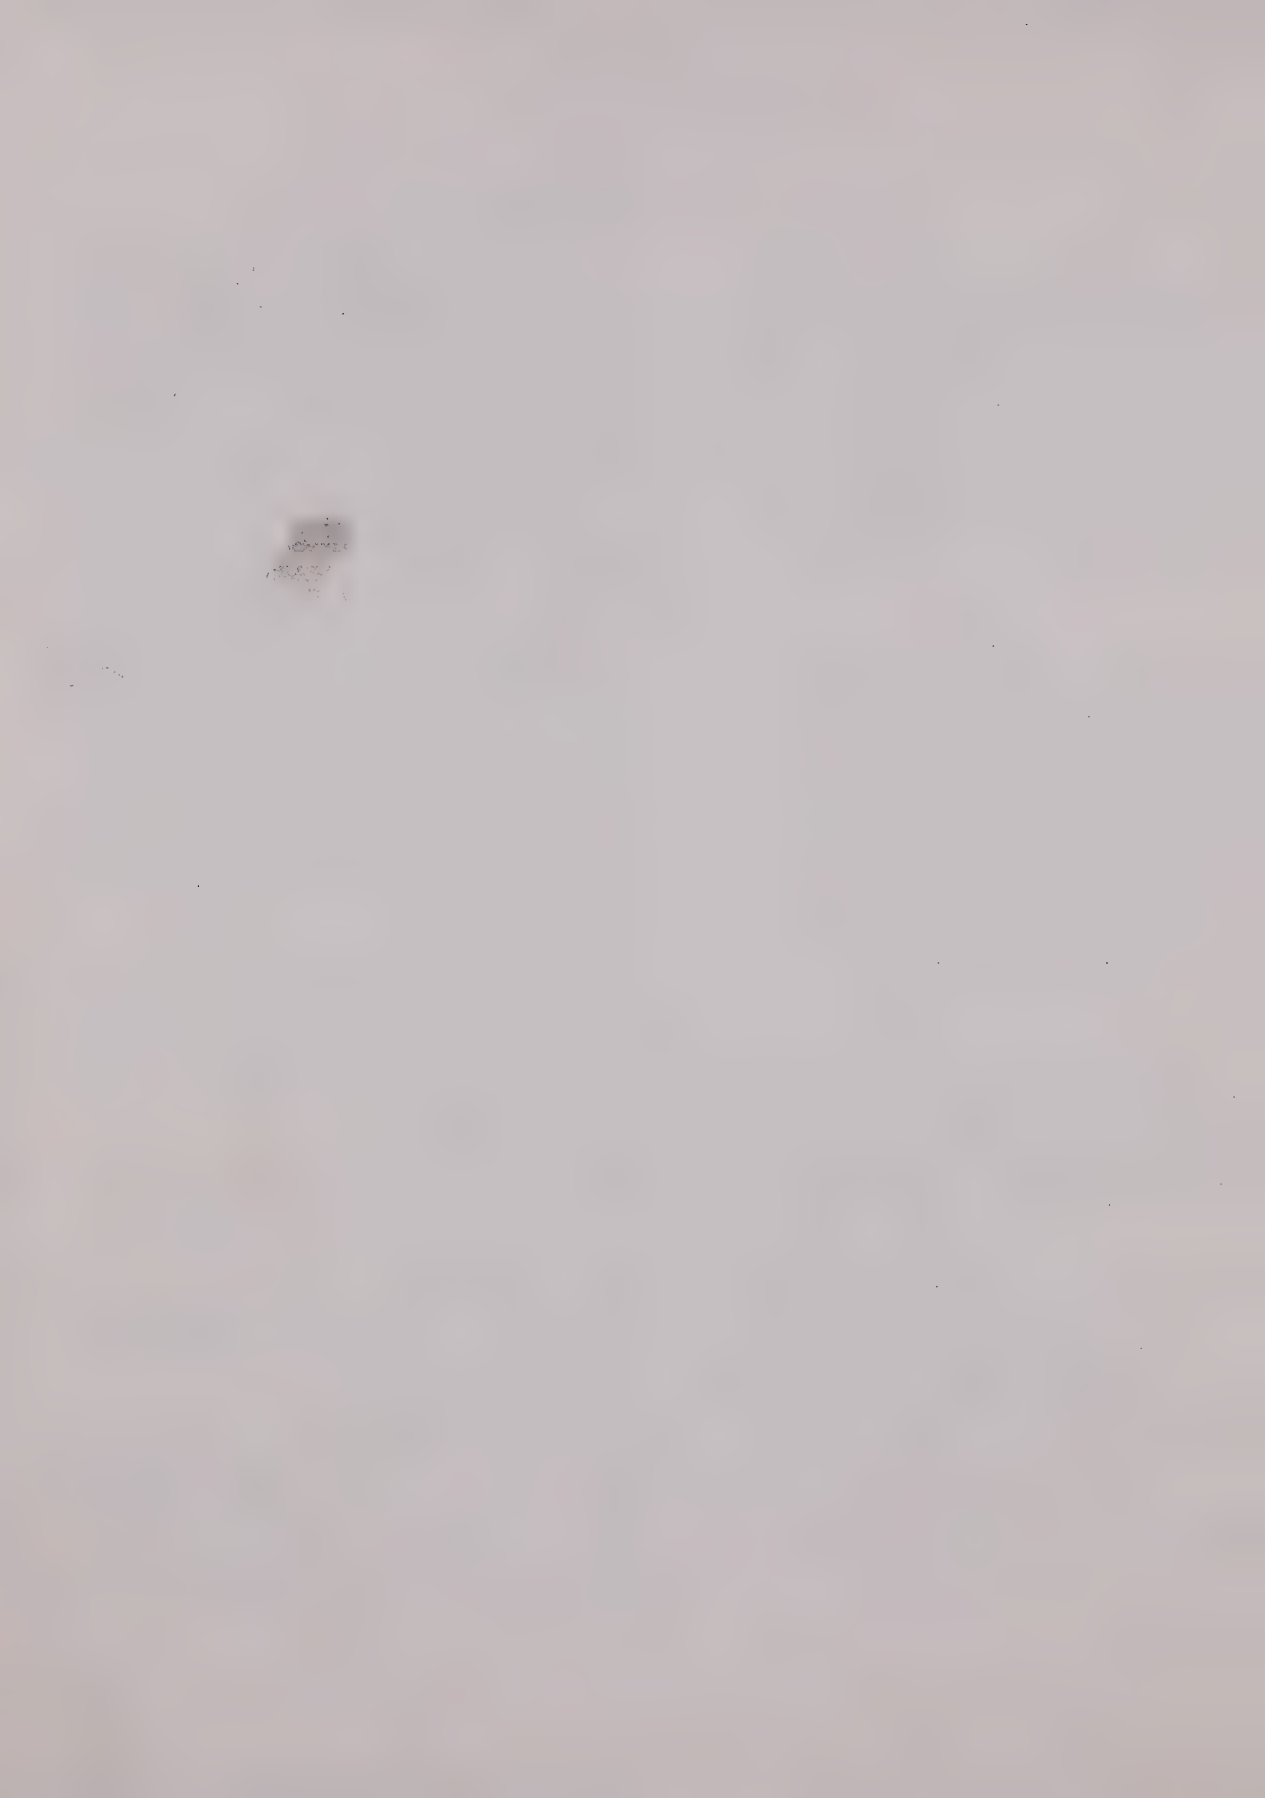

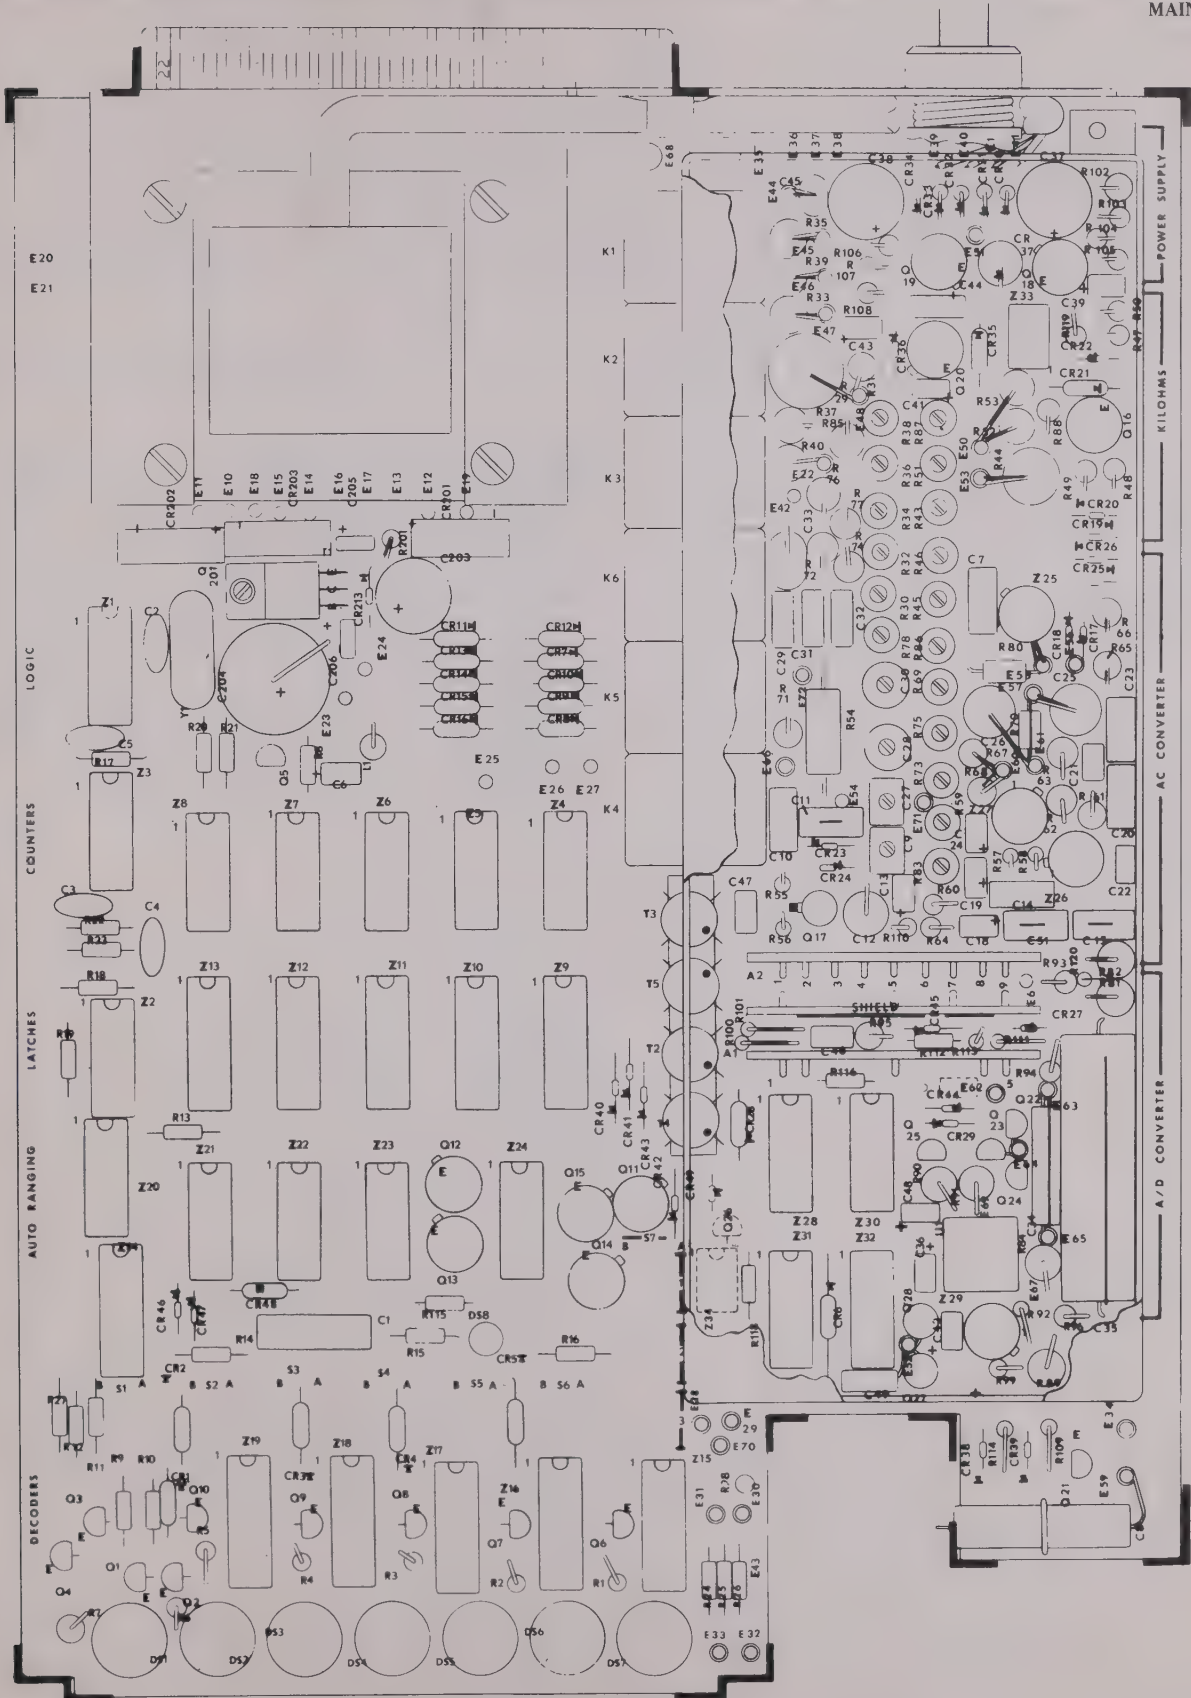


Figure 5-1. Parts and Stand-Off Layout on PC Board Assembly

The troubleshooting and maintenance procedures are intended for experienced technicians. Use of the flow chart directs the technician to the appropriate circuitry and reference schematic for subsequent detailed component fault isolation, replacement and repair.

5.3 THE TROUBLESHOOTING FLOW CHART

Figure 5-2 is a coded plan for troubleshooting any Series 2000 DMM. The chart presents the logical sequence for performing tests so that an interpretation of test results will isolate the circuit components that are functioning properly. The complete sequence then leads the technician to the only components that may be the source of trouble. Signal tracing the isolated faulty circuit group and reference to the schematic for correct values normally will uncover the faulty component.

A standard graphic code has been used in the flow chart:

5.4 USING THE TROUBLESHOOTING FLOW CHART

As shown in Figure 5-2, one starts by activating the POWER push button and checking to see if the POWER lamp is lit. If not, the chart directs the maintenance man to perform Test No. 1 as defined in the integral Table of Tests. Test No. 1 calls for the measurement of a DC voltage between stand-offs E18 and E19, and checking for a nominal voltage of +140 volts. If the voltage is present, then, according to the chart, it is concluded that neon display lamp DS13 and its circuitry are in need of further isolation.

If the voltage check of Test No. 1 indicates an incorrect value of the DC voltage, then the chart directs the maintenance technician to use Reference Dwg. 35-1002 and to measure the other

output voltages in accordance with Tests 2.1 and 2.2. The Table of Tests also indicates the driven circuits for each of the supply voltages. These may be the cause of incorrect voltage measurements when checking power supply levels and should be checked for excessive current drains by examining driven components and their nearby components for signs of elevated temperatures. The reference drawing includes the pin identification of the components driven by each supply.

Continue through the flow chart as directed, and the successive steps will confirm the proper operation of incremental portions of the DMM as they contribute to the performance as a whole. An incorrect reading in any step identifies the circuit components as a group within which the malfunction most probably originates.

The testing sequence represented by Figure 5-2 is concluded with a calibration to complete the maintenance process. Complete DMM function will have been verified by this process, but only those coded outputs actually tested are verified. Any pattern of missing digits may not be detected in these tests, and such a symptom is indicative of a malfunctioning counter, latch, or decoder IC.

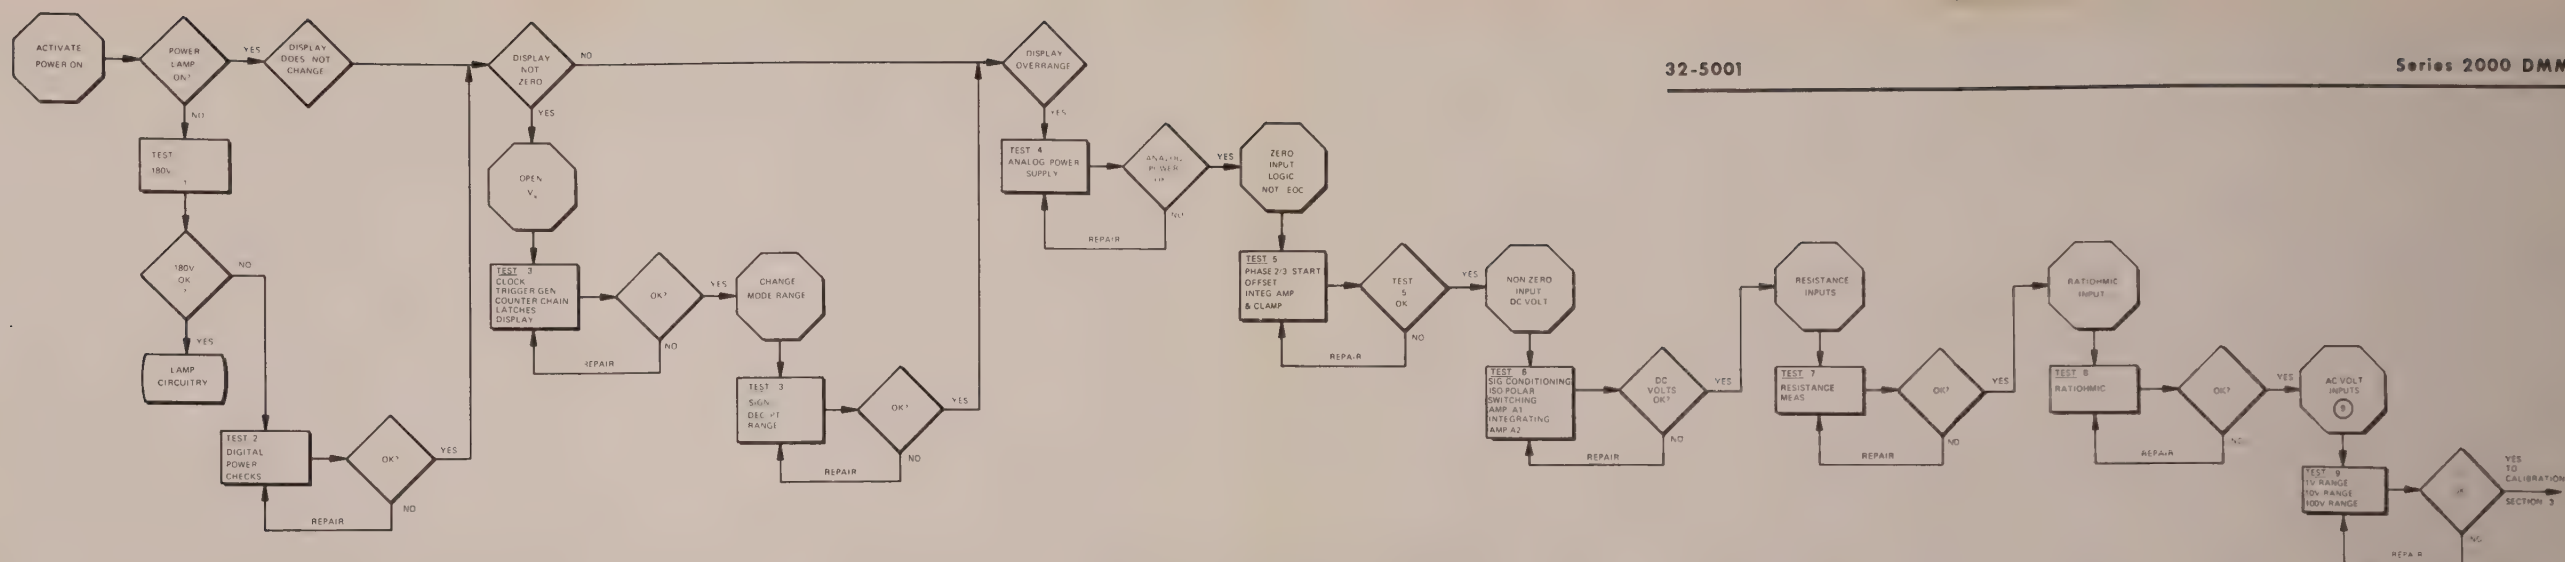


Figure 5-2. Series 2000 DMM Troubleshooting Flow Diagram

TEST NO.	SET-UP	PARAMETER	TEST POINTS	NOMINAL VALUE	LIMITS	IF N.G., CORRECTIVE ACTION REFERENCE	IF O.K., PROPERLY FUNCTIONING SUBSYSTEM
1	Activate Power ON	DC Volts	E18: E19	+140V	+125V to +155V	Power Supply Drawing 35-1002	Neon & Nixie Supply
2.1		DC Volts	E17: E19	+20V	18 to 22	Power Supply Drawing 35-1002	Relay Supply
2.2		DC Volts	E16: E19	+5V	4.5 to 5.5	Power Supply Drawing 35-1002	Digital Logic Supply
3	Open Vx Short Z1A pin 1 to GND						φ1, φ2, φ3; No EOC, 120000 Count
3.1		Frequency Count	Z2A pin 1	1 MHz	±1 kHz	Clock Circuit Drawing 35-1005	Clock
3.2		Waveform Analysis	Rear Conn Pin J	Amp >+2.5V Rep Rate ~3 pps	-0, +5 2.5-3.3	Trigger Gen Drawing 35-1005	Trigger Generator
3.3		Frequency	Z4 through Z8 and Z2 Pin 14 on each	1 MHz to 10 Hz (by 10) and 5 Hz	±0.1%	Decade Counter Drawing 35-1005	Decade Counter Chain and Binary Counter
3.4		Logic Levels	Rear Conn DATA OUT Tabs	BCD for 120000		Latches Z9-Z13 Drawing 35-1005	Latch
3.5		Display	Front Panel	120000, Blinking "1"		Display Drawing 35-1005	Display

TEST NO.	SET-UP	PARAMETER	TEST POINTS	NOMINAL VALUE	LIMITS	IF N.G., CORRECTIVE ACTION REFERENCE	IF O.K., PROPERLY FUNCTIONING SUBSYSTEM
3.6	DC V Mode	Sign	Front Panel Display	"+"		Sign Circuit L5, Z14, etc. Drawing 35-1006	Sign Circuit
3.7	AC V Mode	Sign	Display	No Sign		Sign Circuit L5, Z14, etc. Drawing 35-1006	Sign Circuit
3.8	kΩ Mode	Sign	Display	No Sign		Sign Circuit L5, Z14, etc. Drawing 35-1006	Sign Circuit
3.9	No Range Activate	Impedance	Rear Panel Range Tabs 6, 11, T, B, H	Open Ckt		Auto Range Drawing 35-1003	x 10 ⁴ Range
3.10	All Modes a) x 1 b) x 10 c) x 100 d) x 1000 e) x 10000	Display, Relays	Display, Range Relays	Correct Decimal Point Relay per Table		Relay Table Drawing 35-1003	Decimal Point Display Relay Operation
3.11	Auto Range a) DC V b) kΩ c) Jumper Z2 Z2 pin 8 to Z3 pin 8	Decimal Point	Display	Decimal Point a) x 1000 b) x 10000 c) "0" x 1		Auto Ranging Drawing 35-1003	Auto Range
4.1		DC Volts	Z33 pin 8	+15V	±1V Ripple 1mV RMS	Power Supply Drawing 35-1002	Analog Power Supply

TEST NO.	SET-UP	PARAMETER	TEST POINTS	NOMINAL VALUE	LIMITS	IF N.G., CORRECTIVE ACTION REFERENCE	IF O.K., PROPERLY FUNCTIONING SUBSYSTEM
4.2		DC Volts	Z33 pin 4	-15V	±1V Ripple 1mV RMS	Power Supply Drawing 35-1002	Analog Power Supply
4.3		DC Volts	Z31A pin 7	-5V	±1V Noise 25 μV	Power Supply Drawing 35-1002	Analog Power Supply
5	Short E62 to E71 Jumper Z32A pin 6 to pin 7						Zero Input to A/D No EOC at End of Phase 3
5.1		Waveform	Z31A pin 5	Positive Pulses 100 msec		A/D Conv. Drawing 35-1006	Trigger & 10 ⁵ Carry Start and End Phase 2
5.2		DC Volts	Amp A1 pin 2	200 mV	+0, -	A/D Conv. Drawing 35-1006	A1 Operation OFF SET
5.3		DC Volts	Junction R96, R99	1V	±1V	A/D Conv. Drawing 35-1006	A2 and Clamp Circuits
6	Remove Short Connect Varying Vx DCV ±11V						Supply Varying Input Voltage Values
6.1	DCV Mode Range x 10	DC Volts	E35: E6	Track Input Values (Scope Ind.)		Signal Cond. Drawing 35-1004	DCV Signal Conditioning

TEST NO.	SET-UP	PARAMETER	TEST POINTS	NOMINAL VALUE	LIMITS	IF N.G., CORRECTIVE ACTION REFERENCE	IF O.K., PROPERLY FUNCTIONING SUBSYSTEM
6.2	+10V to Vx Sync. Scope to Z31 pin 5	Waveform	Amp A1 pin 2	+8 		A/D Conv. Drawing 35-1006	ISO POLAR Switch Module, Amps A1, EOC Integrating A2
6.3	Reverse Input Vx Polarity	Waveform	Amp A1 pin 2	Reverse Polarity		A/D Conv. Drawing 35-1006	ISO POLAR Switch Module, Amps A1, EOC Integrating A2
7	Connect for Resistance Measurement 2-Wire Connect Resistances in each Range kΩ Mode	Resistance Measurement	Display	Track Input Value Changes		Signal Cond. Drawing 35-1004	Ohms Converter Signal Conditioning
8	Apply +10V to Both Vx and Rx RATIO Mode 10V Range	Display Count	Display	10.0000	±.1000	Ratiohmic Ckt Drawing 35-1004	Ratiohmic Function
9.1	ACV Mode Range x 1 Apply 11V, 200 Hz	Waveform	Z26 pin 6 CR25, Cathode	1V RMS sin Wave Half-Wave		Signal Cond. Drawing 35-1004	ACV Signal Conditioning
9.2	x 10 Range Apply 10 VRMS 200 Hz	Display Count	Display	Approx. 10		Signal Cond. Drawing 35-1004	ACV Signal Conditioning
9.3	x 100 Range	Display Count	Display	Approx. 100		Signal Cond. Drawing 35-1004	ACV Signal Conditioning

Section 6

REFERENCE MATERIALS

Section 6 contains reference information in tabular and schematic form.

6.1 Parts Lists

Table 6-1	DMM Assembly
Table 6-2	Amplifier Module A1
Table 6-3	Amplifier Module A2
Table 6-4	Switch Module Assembly
Table 6-5	PC Card Assembly

6.2 Reference Schematics

Figure 6-1	Signal Conditioning Schematic, Dwg. 35-1004
Figure 6-2	A/D Converter Schematic, Dwg. 35-1006
Figure 6-3	Counter and Display Schematic, Dwg. 35-1005
Figure 6-4	Ranging Schematic, Dwg. 35-1003
Figure 6-5	Power Supply Schematic, Dwg. 35-1002

Table 6-1. DMM ASSEMBLY

Circuit Symbol	Description	Part Number
C52	Capacitor .01uf,250V	13-210013
C201,202	Capacitor .005uf,1KV	13-118010
DS9-13	Lamp NE2H	15-201001
F201	Fuse 3AG,2/10A,SloBlo	
L201,202	Inductor 220pHy	15-100002
R41,117	Resistor 51K,10%,4W,CC	HM5135
S201	Switch	46256LFR
T1	Transformer	C38-1002
	Switch Assembly	A38-1011
	Link,Shorting	B36-1008
	Link,Shorting	0938-9760
	Switch	WH4UEEE

Table 6-2. AMPLIFIER MODULE A1

Circuit Symbol	Description	Part Number
C1,2	Capacitor 20pf	13-311003
CR1,2	Diode, 1N4148	14-110001
Q1	Transistor	B38-1004
Q2-5	Transistor MPS6516	14-236516
Q6-10	Transistor MPS6515	14-236515
R1,2	Resistor 10K,1%,MF	12-341002
R3,4,5	Resistor 1K,5%,1/4W,CC	12-021029
R6,7	Resistor 100K,5%, 1/4W,CC	12-021049
R8	Resistor 27.4K,1%,MF	12-332742
R9	Resistor 3.32K,1%,MF	12-333321
R10	Resistor 7.5K,1%,MF	12-337501
R14	Resistor 1.8K,5%, 1/4W,CC	12-021829

Table 6-3. AMPLIFIER MODULE A2

Circuit Symbol	Description	Part Number
C1,2	Capacitor 30pf	13-211004
CR2	Diode 1N4148	14-110001
Q1	Transistor	B38-1004
Q2,3,5,6	Transistor MPS6516	14-236516
Q8,9	Transistor MPS6515	14-236515
R1,2	Resistor 10K,1%,MF	12-341002
R3,4,5	Resistor 1K,5%, 1/4W,CC	12-021029
R10	Resistor 39K,5%, 1/4W,CC	12-023939
R14	Resistor 3.3K,5%, 1/4W,CC	12-023329

Table 6-4. SWITCH MODULE ASSEMBLY

Circuit Symbol	Description	Part Number
Q1	Transistor 2N5246	A32-2010-1
Q2	Transistor 2N5246	A32-3010-2
R1-5	Resistor 10 ,10%,1/4W	12-021008

Table 6-5. PC BOARD ASSEMBLY

Circuit Symbol	Description	Part Number
A1	Assembly Amp 1	PL30-1002
A2	Assembly Amp 2	PL30-1001
C1	Capacitor .22uF	13-210236
C2	Capacitor 27pF,DM15	13-311022
C3,5	Capacitor 1000pF,DM15	13-311036
C4,51	Capacitor 1500pF,DM15	13-311038
C6,36,44,48, 205,206	Capacitor 12uF,10V	13-411050
C7	Capacitor 30pF,DM15	13-311004
C34	Capacitor 2uF,PolyCarb	13-510002
C35	Capacitor .68uF,10%, 50V,PolySty	13-550036
C37,38, 203	Capacitor 250uF,30V	13-620030
C39,41, 42,43	Capacitor 5.6uF,20V	13-411030
C45	Capacitor .018uF,10%, 50V,PolySty	13-550035
C46,50	Capacitor 50pF,DM10	13-310001
C47	Capacitor .01uF,Disk	13-118004
C49	Capacitor 3pF,DM15	13-311041
C204	Capacitor 2500uF,15V	13-620035
CR1,38	Diode SI-3	14-100002
CR2-20,22, 27-29,36, 39-49	Diode 1N4148	14-110001
CR21,48	Diode,Germ.S3742G	14-140001
CR30-34	Diode SI-1	14-100001
CR35,213	Diode 1N752A	14-120075
CR37	Diode,Ref.	14-130020
CR201, 203	Diode 100V Bridge, S1655	14-100010
CR202	Diode 300V Bridge, S1656	14-100011
DS1	Display, B5856	15-205856
DS2-7	Display, B5750	15-205750
DS8	Lamp, NE2H	15-201001
K1,6	Relay	15-170012
L1	Inductor,100pHy	15-100007
Q1-4, 6-10	Transistor 2N4410	14-234410
Q5,21	Transistor 2N3904	14-233904
Q11	Transistor 2N3645	14-233645

Table 6-5. PC BOARD ASSEMBLY (Continued)

Circuit Symbol	Description	Part Number
Q16	Transistor MPS6519	14-236519
Q18,20	Transistor 40319	14-2340319
Q19	Transistor 40314	14-2340314
Q22,23	Transistor 2N5246	32-3010-1
Q24,25,		
27,28	Transistor 2N5246	32-3010-2
Q201	Transistor 2N5296	14-235296
R1-7	Resistor, 15K, 10%, 1/2W, CC	12-031538
R8, 118	Resistor 2.2K, 5%, 1/4W, CC	12-022229
R9-12, 27	Resistor 10K, 5%, 1/4W, CC	12-021039
109, 111		
R13, 17,	Resistor 680 ,5%, 1/4W, CC	12-026819
100, 101		
R15, 49,	Resistor 1K, 5%, 1/4W, CC	12-021029
119		
R16	Resistor 100 ,5%, 1/4W, CC	12-021019
R18, 20,	Resistor 1.5K, 5%, 1/4W, CC	12-021529
22		
R19, 21	Resistor 3.3K, 5%, 1/4W, CC	12-023329
23, 127		
R24-26,	Resistor 100K, 5%, 1/4W, CC	12-021049
79		
R28	Resistor 10M, 5%, 1/4W, CC	12-021069
	Resistor Set:	A38-1008-2
R42	Item 1 (9.9M)	
R44	Item 2 (99.75K)	
R43, 51	Trimmer 500	12-651007
R45	Trimmer 25K	12-6500
R46, 86	Trimmer 100	12-6500
R47, 48,		
96	Resistor 15K, 1%	12-331502
R50	Resistor 261K, 1%	12-362613
	Resistor Set:	A38-1007-3
R52	Item 1 (89.75K)	
R52	Item 2 (10K)	
R80	Resistor 47M, 5%, 1/4W, CC	12-024769
	Resistor Set:	A38-1007-1
R84	Item 1 (42K)	
R81	Item 2 (10.096K)	
R89	Item 3 (10K)	
R85	Item 4 (37.95K)	
R82	Resistor 1M, 1%	12-392003
R83	Trimmer 100K	12-6500
R87	Trimmer 200	12-651005
	Resistor Set:	A38-1007-2
R91	Item 1 (52K)	
R90	Item 2 (10K)	
R92	Resistor 33K, 5%, 1/4W, CC	12-023339
R93	Resistor 4.22K, 1%	12-334221
R94	Resistor 30.1K, 1%	12-333012
R95	Resistor 150K, 1%	12-331503
R99	Resistor 3.01K, 1%	12-333011
R102	Resistor 1.1K, 1%	12-371101
R103	Resistor 8.66K, 1%	12-348661
R104, 106	Resistor 10K, 1%	12-341002

Table 6-5.. PC BOARD ASSEMBLY (Continued)

Circuit Symbol	Description	Part Number
R105	Resistor 6.19K, 1%	12-346191
R108	Resistor 100 ,5%, 1/2W, CC	12-031019
R112, 113	Resistor 20K, 5%, 1/4W, CC	12-022039
R114	Resistor 4.7K, 5%, 1/4W, CC	12-024729
R116	Resistor 100M, 10%, 1/4W, CC	12-021078
R120	Resistor 1M, 5%, 1/4W, CC	12-021059
R201	Resistor 1K, 5%, 1/2W, CC	12-031029
S1-7	Switch	A38-1010
T2-5	Transformer, Pulse	B38-1005
U1	Assembly Switch Module	PL30-1003
Y1	Crystal 1MHz	A38-1012
Z1, 24, 28	IC 9937	14-319937
Z2, 20,		
22, 31	IC 9094	14-319094
Z3, 21, 23	IC 9949	14-219949
Z4-8	IC 7490	14-337490
Z9-14	IC 7475	14-337475
Z15-19	IC 7441	14-337441
Z25	IC LM308	A32-3009
Z29	IC LM311	14-300311
Z30	IC 9945	14-319945
Z32	IC 9962	14-319962
Z33	IC N5558U	14-305558

Table 6-5A. PC BOARD ASSY OPTIONS

Circuit Symbol	Description	Part Number
C8	Capacitor .15uF, 600V, PolySty	13-510004
C9, 27	Capacitor 2-9pF	13-800002
C10	Capacitor 10pF, 520V, DM10	13-310002
C11	Capacitor 10pF, 1KV	
C12, 25,	Capacitor 1uF, 50V, PolyC	13-510001
26		
C13, 18,		
19	Capacitor 5.6uF, 20V	13-411030
C14	Capacitor 150pF, DM15	13-311015
C15	Capacitor 20pF, DM10	13-210006
C20, 23	Capacitor 5pF, DM10	13-310001
C28, 30	Capacitor 15-60pF	13-810001
C29	Capacitor 100pF, DM15	13-311011
C32	Capacitor 1200pF, DM15	13-311037
CR23-26	Diode 1N4148	14-110001
Q17	Transistor	38-1004
	Resistor Set:	A38-1006
R29	Item 1 (6429)	
R33	Item 2 (61.875K)	
R35	Item 3 (618.75K)	
R30	Trimmer 25K	12-651014
R31	Resistor 162K, 1%, 60C	12-400001

Table 6-5A. PC BOARD ASSY OPTIONS (Continued)

Circuit Symbol	Description	Part Number
R32	Trimmer 250	12-651006
R34	Trimmer 2.5K	12-651010
R36	Trimmer 500	12-650007
	Resistor Set:	A38-1007-3
R37	Item 1 (89.75K)	
R40	Item 2 (10K)	
R38	Trimmer 25K	12-650014
R39	Resistor 6.19M, .1%, 60B	12-400002
	Resistor Set:	A38-1008-1
R54	Item 1 (1M)	
R71	Item 2 (1M)	
R72	Item 3 (110K)	
R62, 63, 74	Item 4 (10K)	
R76	Item 5 (1.1K)	
R61	Item 6 (1.69K)	
R65, 66	Item 7 (2.49K)	
R67	Item 8 (301K)	
R68	Item 9 (178K)	
R55, 56, 57	Resistor 39K, 5%, 1/4W, CC	12-023939
R58	Resistor 8.2M, 5%, 1/4W, CC	12-028259
R59	Trimmer 100K	12-650016
R60	Resistor 150K, 1%, 55D	12-331503
R64	Resistor 100, 1%, 60D	12-361000
R69	Trimmer 5K	12-650011
R70	Resistor 100K, 5%, 1/4W, CC	12-021049
R73, 78	Trimmer 2.5K	12-650010
R75	Trimmer 250	12-650006
R77	Resistor 10K, 1%, 55C	12-341002
R110	Resistor 1K, 5%, 1/4W, CC	12-021029
Z26	IC LM301A	14-300301
Z27	IC 7715	14-307715

SUPPLEMENT 2500A1
LOW VOLTAGE OPTION (0.1Volt Full Scale)

GENERAL

The A1 Option provides the user with a manually selected 0.1V range as a direct reading display of the Model 2500 multimeter for DC voltage readings. This 3-page supplement describes the circuit changes, the theory of operation, calibrating procedures, and includes schematics of the circuit modifications. The modified schematics are identified with the same basic figure number as appears in the manual.

FUNCTIONAL OPERATION (Refer to para 4.10, 4.12, and 4.14)

The 0.1V range display is accomplished by changing the resistors in the feedback path of the A/D converter amplifier so that the gain during the integration of the unknown signal input integration is 10 times that during the reference integration. The signal conditioning configuration for the 1-volt scale is used during 0.1V range operation, and the decimal point has been shifted one decade to the left. The resulting displayed count will be direct reading for .1V (or 100mV) full scale.

Remote operation of the decimal point is accomplished by grounding the appropriate line for the 0.1V scale at the rear connector.

DETAILED OPERATION

- a. Display (See Ranging Logic Modification, Figure 6-4A)

The 0.1V range is chosen by pushing front panel button marked “.1”. This action closes S1B, completing the circuit from emitter Q31 to ground, thereby operating the 0.1 decimal point indication. Grounding S1B also grounds pin X on the rear connector for remote 0.1 decimal point indication. For remote control, externally grounding pin 5 results in 0.1V range operation when all front panel buttons are in the open, released, position.

- b. Tri-Phasic A/D Converter (See A/D Converter Modification, Figure 4-10C)

When the 0.1V range is selected, the A/D Converter gain is controlled during the three phases of the conversion cycle by the FET switches according to the tabular listing below. The revised schematic of figure 4-10C shows the location of the switches and their effect on the circuit.



	Q1	Q2	Q3	Q4
During Phase 1 (Auto-Zero)	OPEN	CLOSED	CLOSED	CLOSED
During Phase 2 (Integrate Unknown)	CLOSED	OPEN	CLOSED	OPEN
During Phase 3 (Integrate Ref)	OPEN	OPEN	OPEN	CLOSED

The resistor components R9, R10, R15 are factory selected so that R10 is exactly nine times R15, and as a result, the gain of the buffer amplifier stage during phase 2 is 10 times the gain during phase 3. During phase 2 the integrator capacitor stores 10 times as much charge as would otherwise be discharged during phase 3. (Therefore, when in 0.1V full scale, the count will take ten times as long as on the 1 volt scale.) Because the decimal point has been positioned one decade to the left of the one volt scale location, the resulting display is direct reading for 0.1V full scale.

CALIBRATION

Calibration of Series 2500 DMM with A1 Option in the DC Voltage Measurement Mode is detailed in this supplement as paragraph 3.6A. It replaces paragraph 3.6 of the basic manual. All other calibrating procedures remain unchanged.

A1 OPTION for MODEL 2500 (Low Level Option)

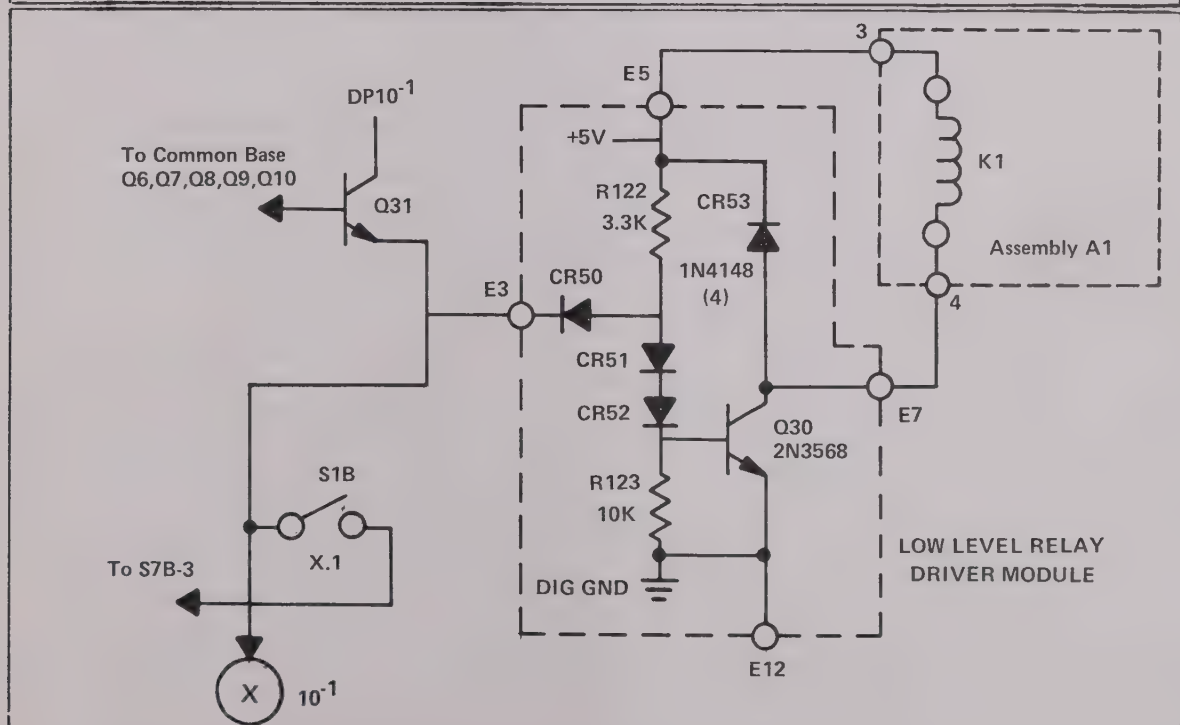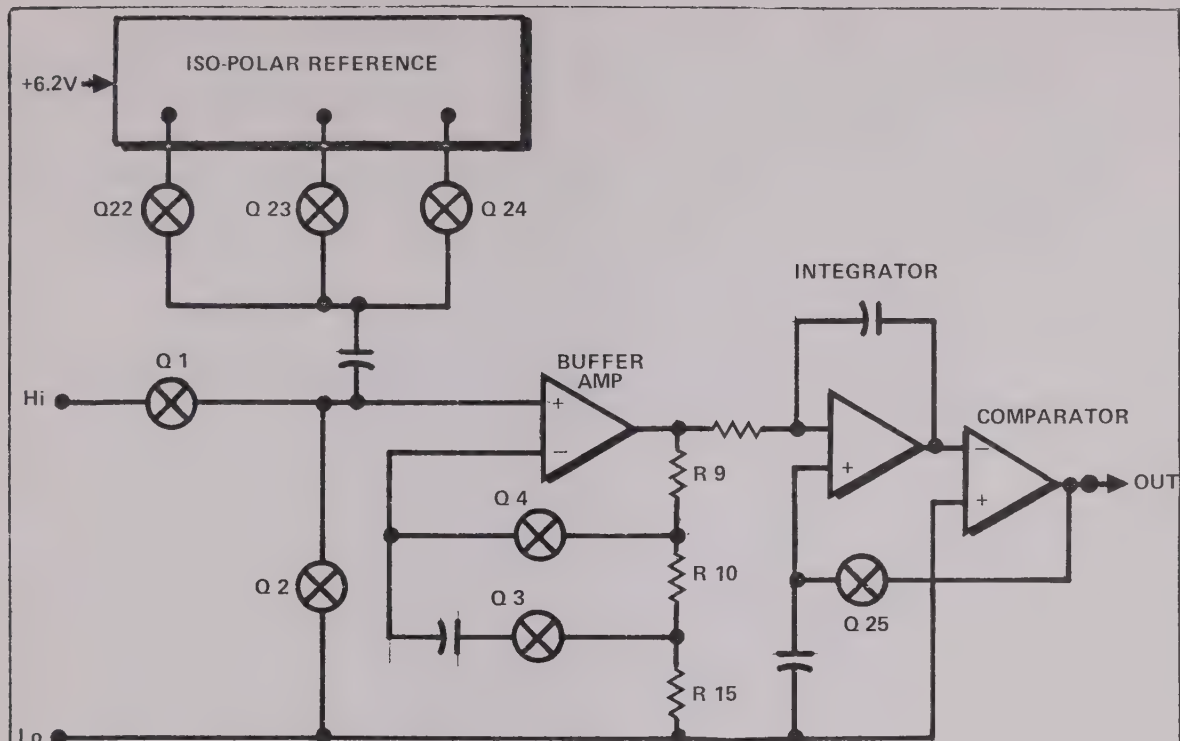

3.6A DC VOLTAGE MEASUREMENT MODE, MODEL 2500/A1

Depress "ON" switch; wait one hour for calibration.

a. Zero Adjust: R45, R46

- 1. Select DV
- 1. Select DC Volts Mode
- 2. Select .1V Full Scale
- 3. Connect shorting bar across input, Vx
- 4. Adjust R300 for ± 0.00000 display value
- 5. Set range to 10V Full Scale
- 6. Connect 10-megohm (approx) resistance across input Vx
- 7. Adjust R45 for ± 0.00000 display value
- 8. Connect shorting bar across input Vx
- 9. Adjust R46 for ± 0.00000 display value
- 10. Repeat steps 6 through 9 as necessary

b. Balance Adjust: R83

- 1. Set Range to 1V Full Scale
- 2. Apply 1V (approx) to input Vx
- 3. Read display, Record.
- 4. Reverse input polarity. Record
- 5. Adjust R83 until values of step 3. and 4. are exactly same on display
- 6. Repeat steps 3 through 5 as necessary.

c. Reading Adjustments

For each full scale range, apply positive full scale voltage and adjust the appropriate potentiometer for full scale value on the display.

Set F.S. Range to	Adjust	For reading of
1) 1-Volt Range	R87	+1.00000
2) .1-Volt Range	R17	+0.10000
3) 10-Volt Range	R51	+10.0000
4) 100-Volt Range	R43	+100.000

WIRING INSTRUCTIONS FOR REAR SIGNAL CONNECTOR OPTION

The mating connector supplied employs female contacts Amphenol #220-S02. A recommended procedure is given below for making soldered connections to these contacts.

1. Use AWG 24 stranded conductors, preferably Teflon insulated.
2. Wires must be stripped so that 1/16 inch of conductor remains exposed after insertion fully into the contact barrel.
3. Apply heat directly to the wire with the sharp end of a small chisel-tipped soldering iron.
4. Apply thin-gage resin-cored solder only to the exposed wire, allowing solder to wick up into the contact. Do not allow solder to be applied to the exterior cylindrical surface of the contact, as a buildup of solder will prevent its insertion.
5. Use solder sparingly to avoid developing a bead.
6. Insert the wired contact into the appropriate hole in the connector body by hand as far as it will go. Exert seating pressure with a smooth jawed long-nosed plier, gripping the exposed wire perpendicularly just behind the contact. The contact will seat home with a snapping action so that the entire contact is concealed in the connector body.
7. Install heat shrink tubing to cover wires left bare by stripping and soldering operation.
8. Install cable clamp.

A tool is required to remove contacts from the connector. Applicable part numbers are as follows:


1. Handle — Amphenol #356-200
2. Removal Bit — Amphenol #356-400-14.


For reference purposes, although not required by the above procedure, other Amphenol tools available are as follows:


1. Crimper for female contacts —
Amphenol #357-104 tool with
#357-304-2 bushing
2. Inserting bit — #356-400-11, used with the same handle as the removal bit.

Connector Specifications


Temperature Range:	-55°C to +125°C
Current Rating:	3A (wire form contacts) 5A (all other contacts)
Voltage Rating:	1500V AC (RMS) at sea level 375V AC at 70,000 ft.
Dielectric:	Polycarbonate Resin

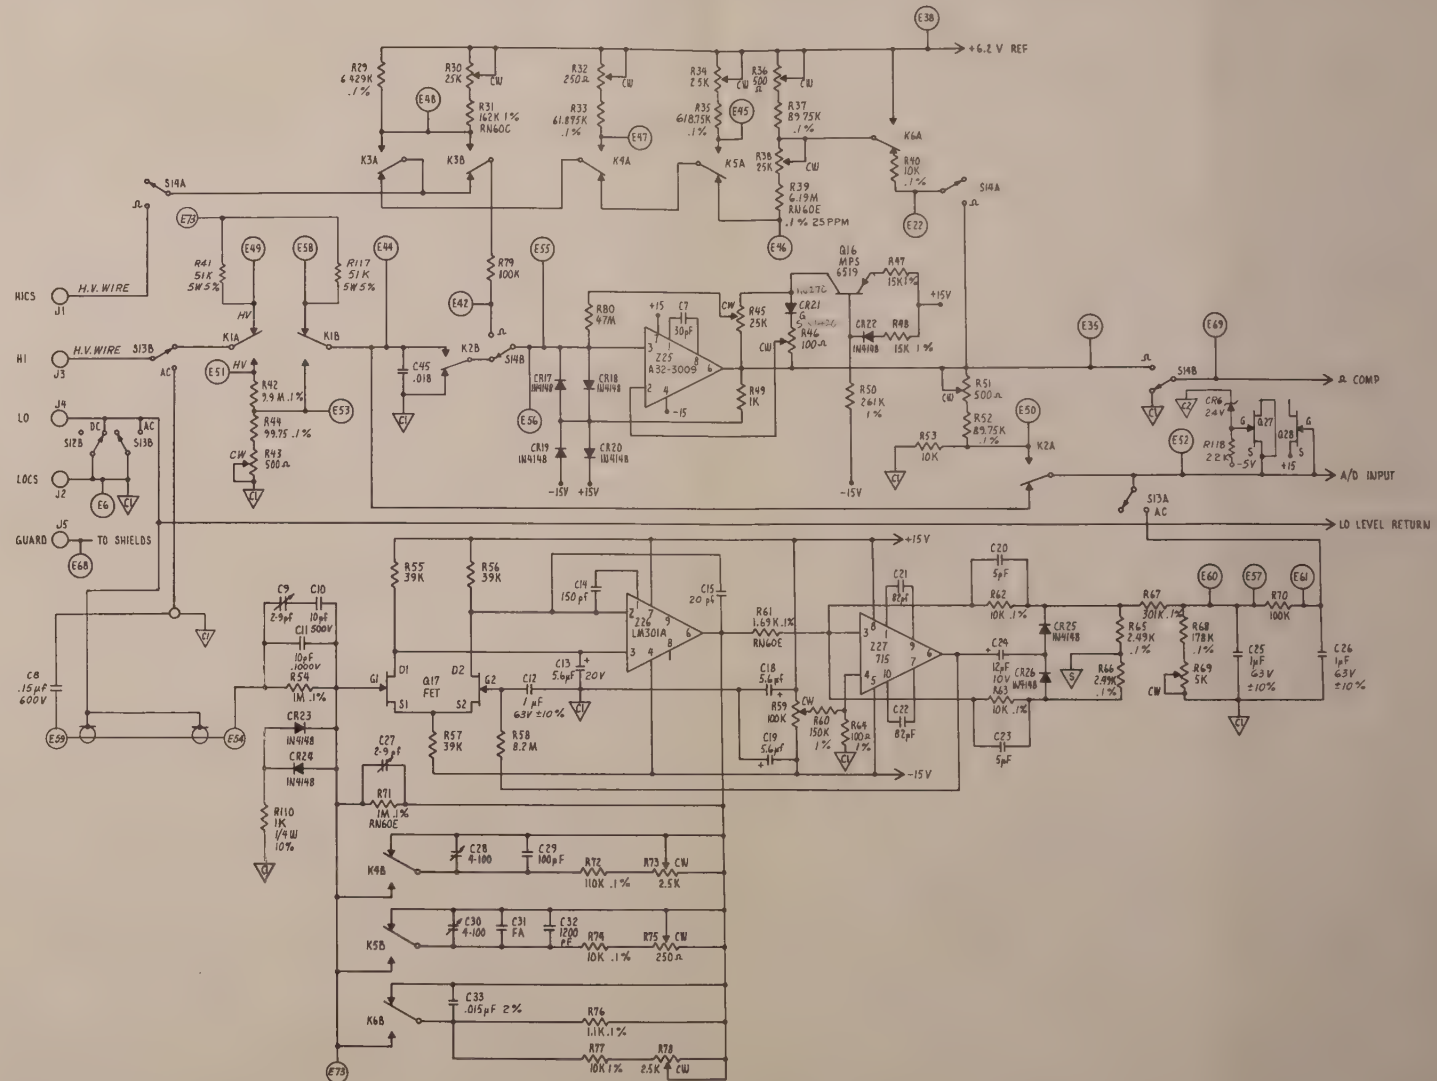


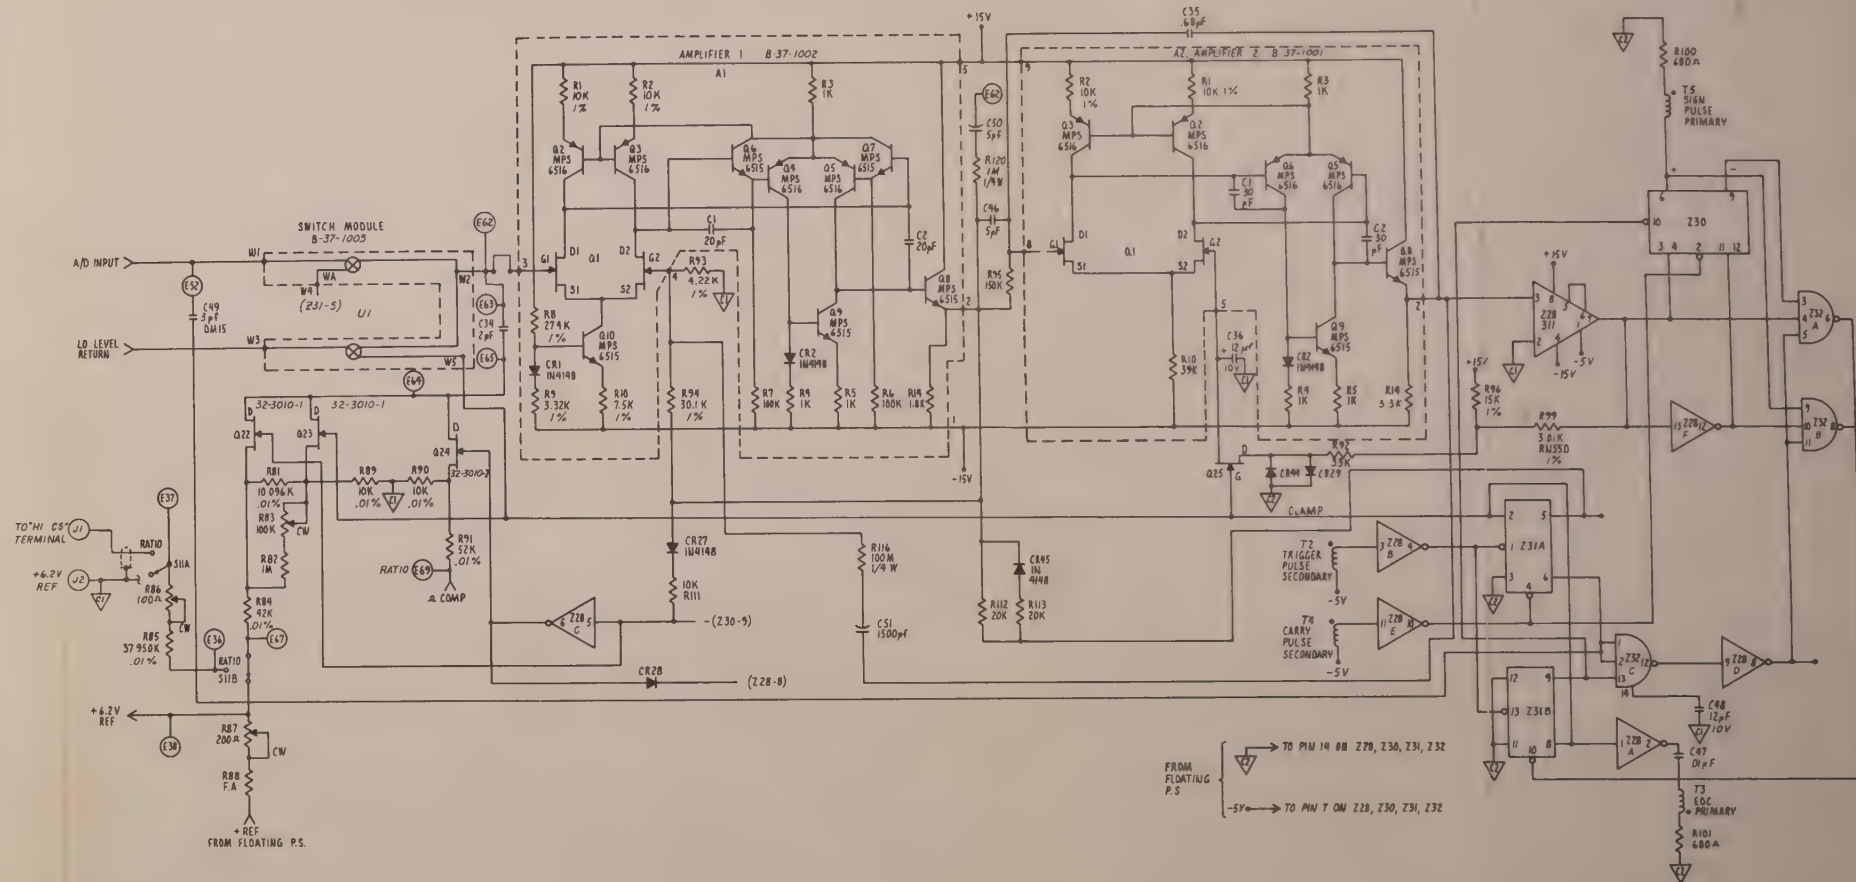

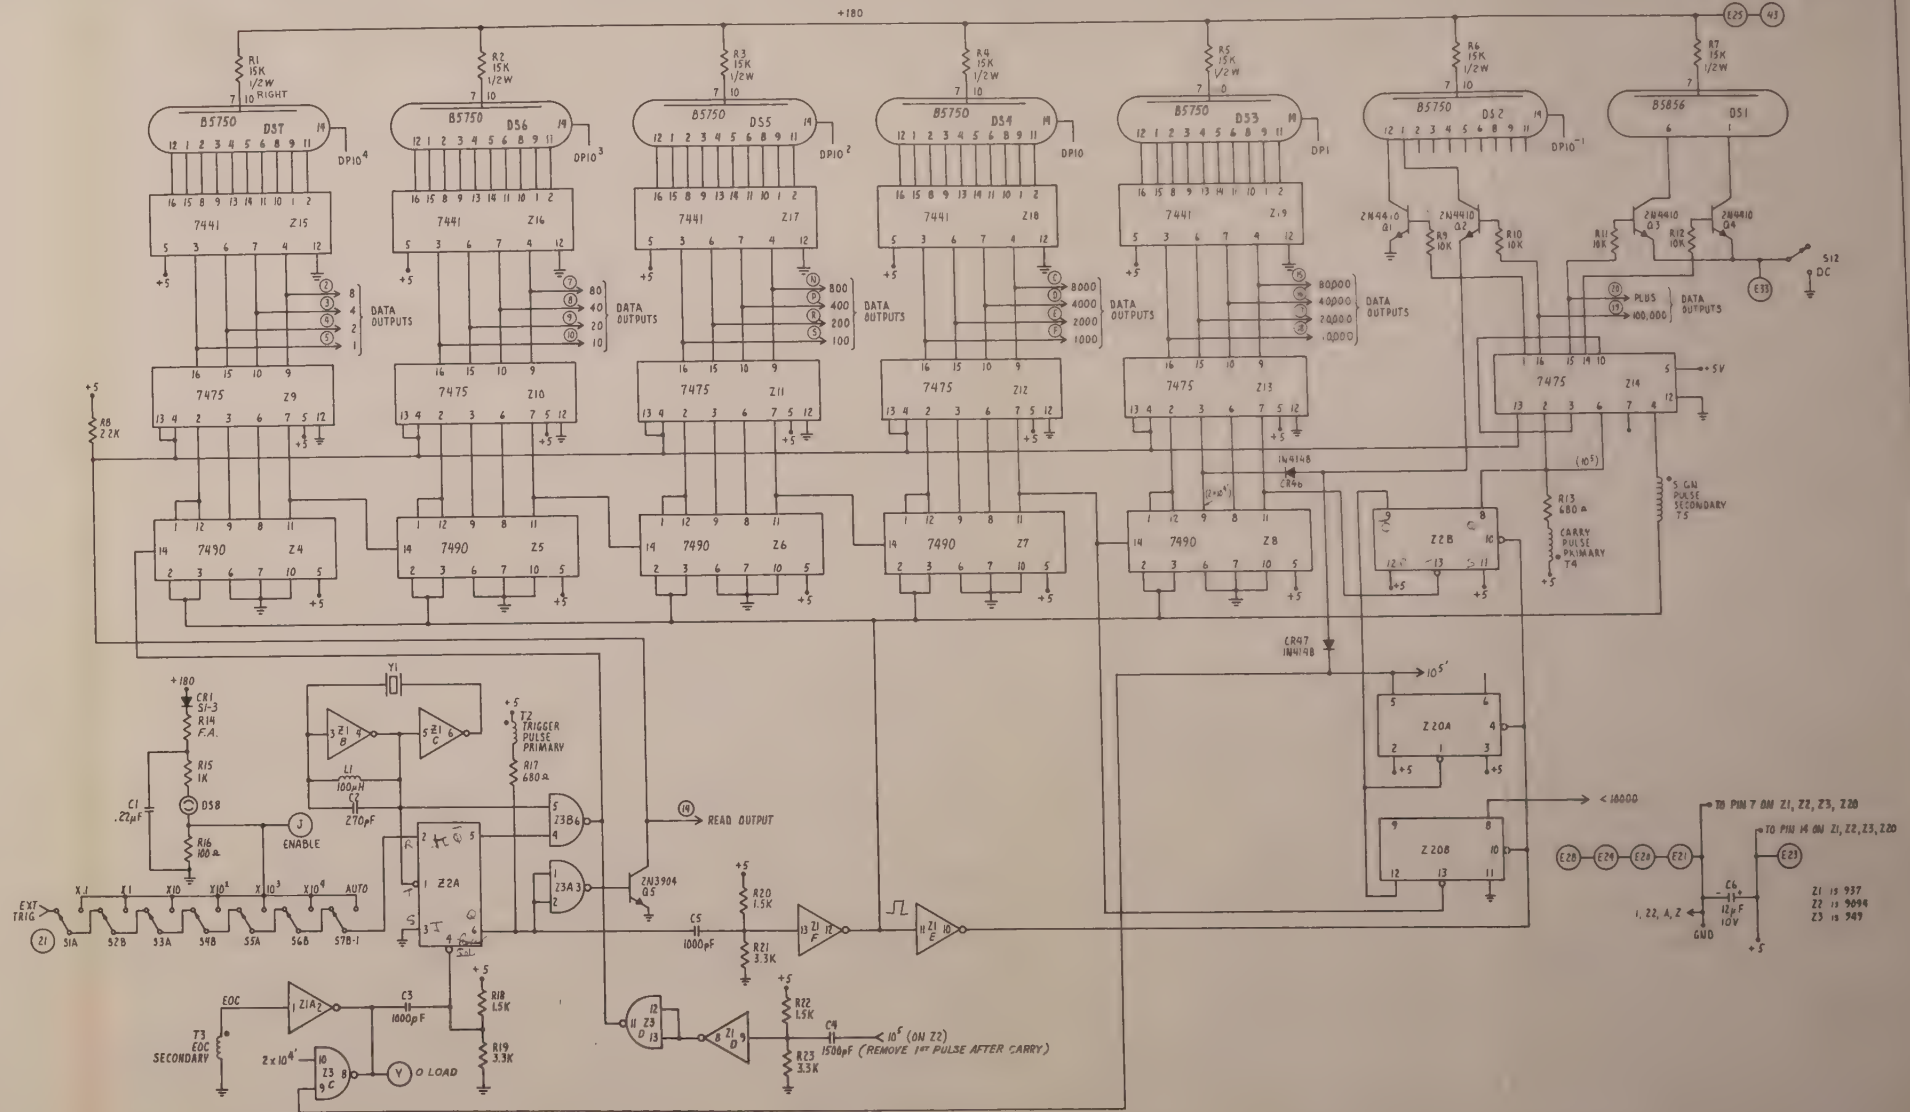



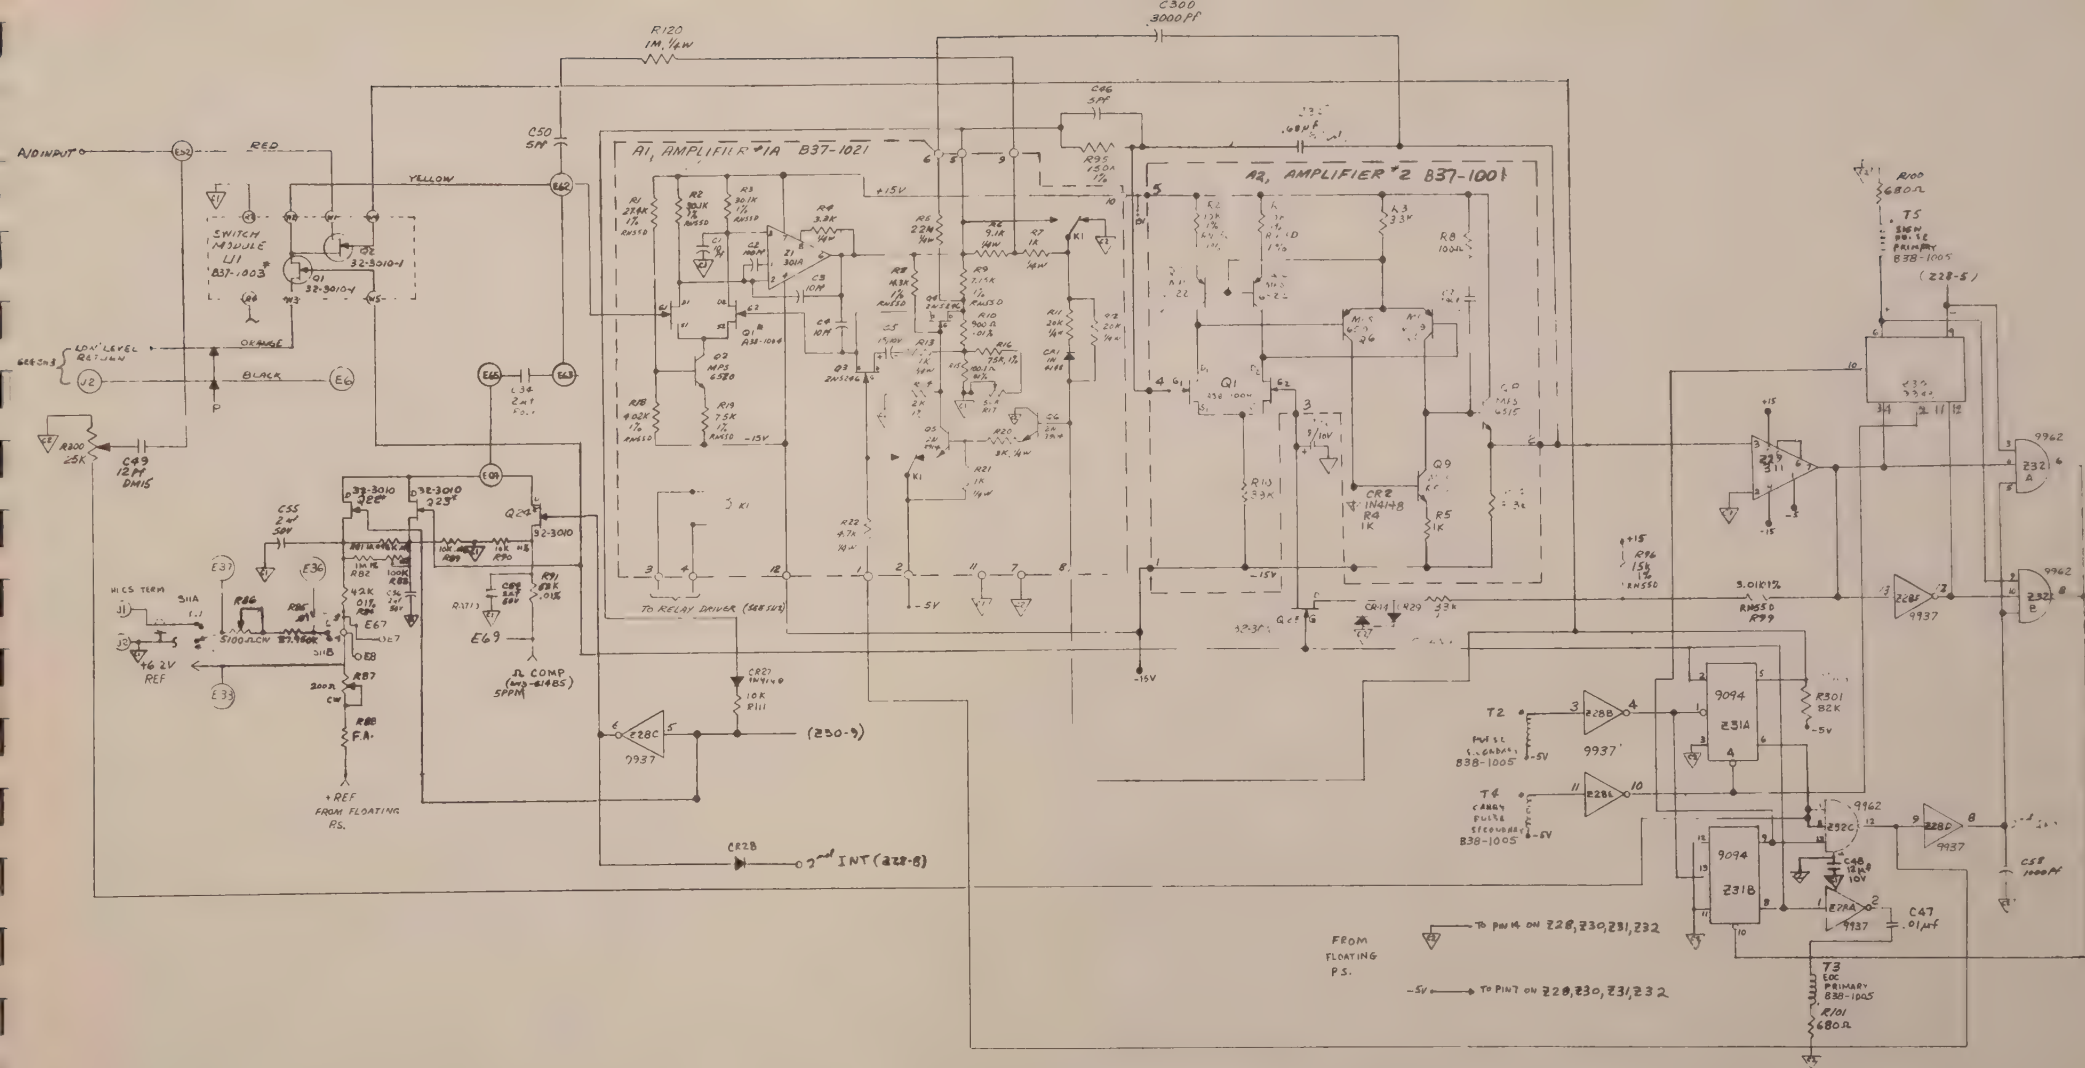

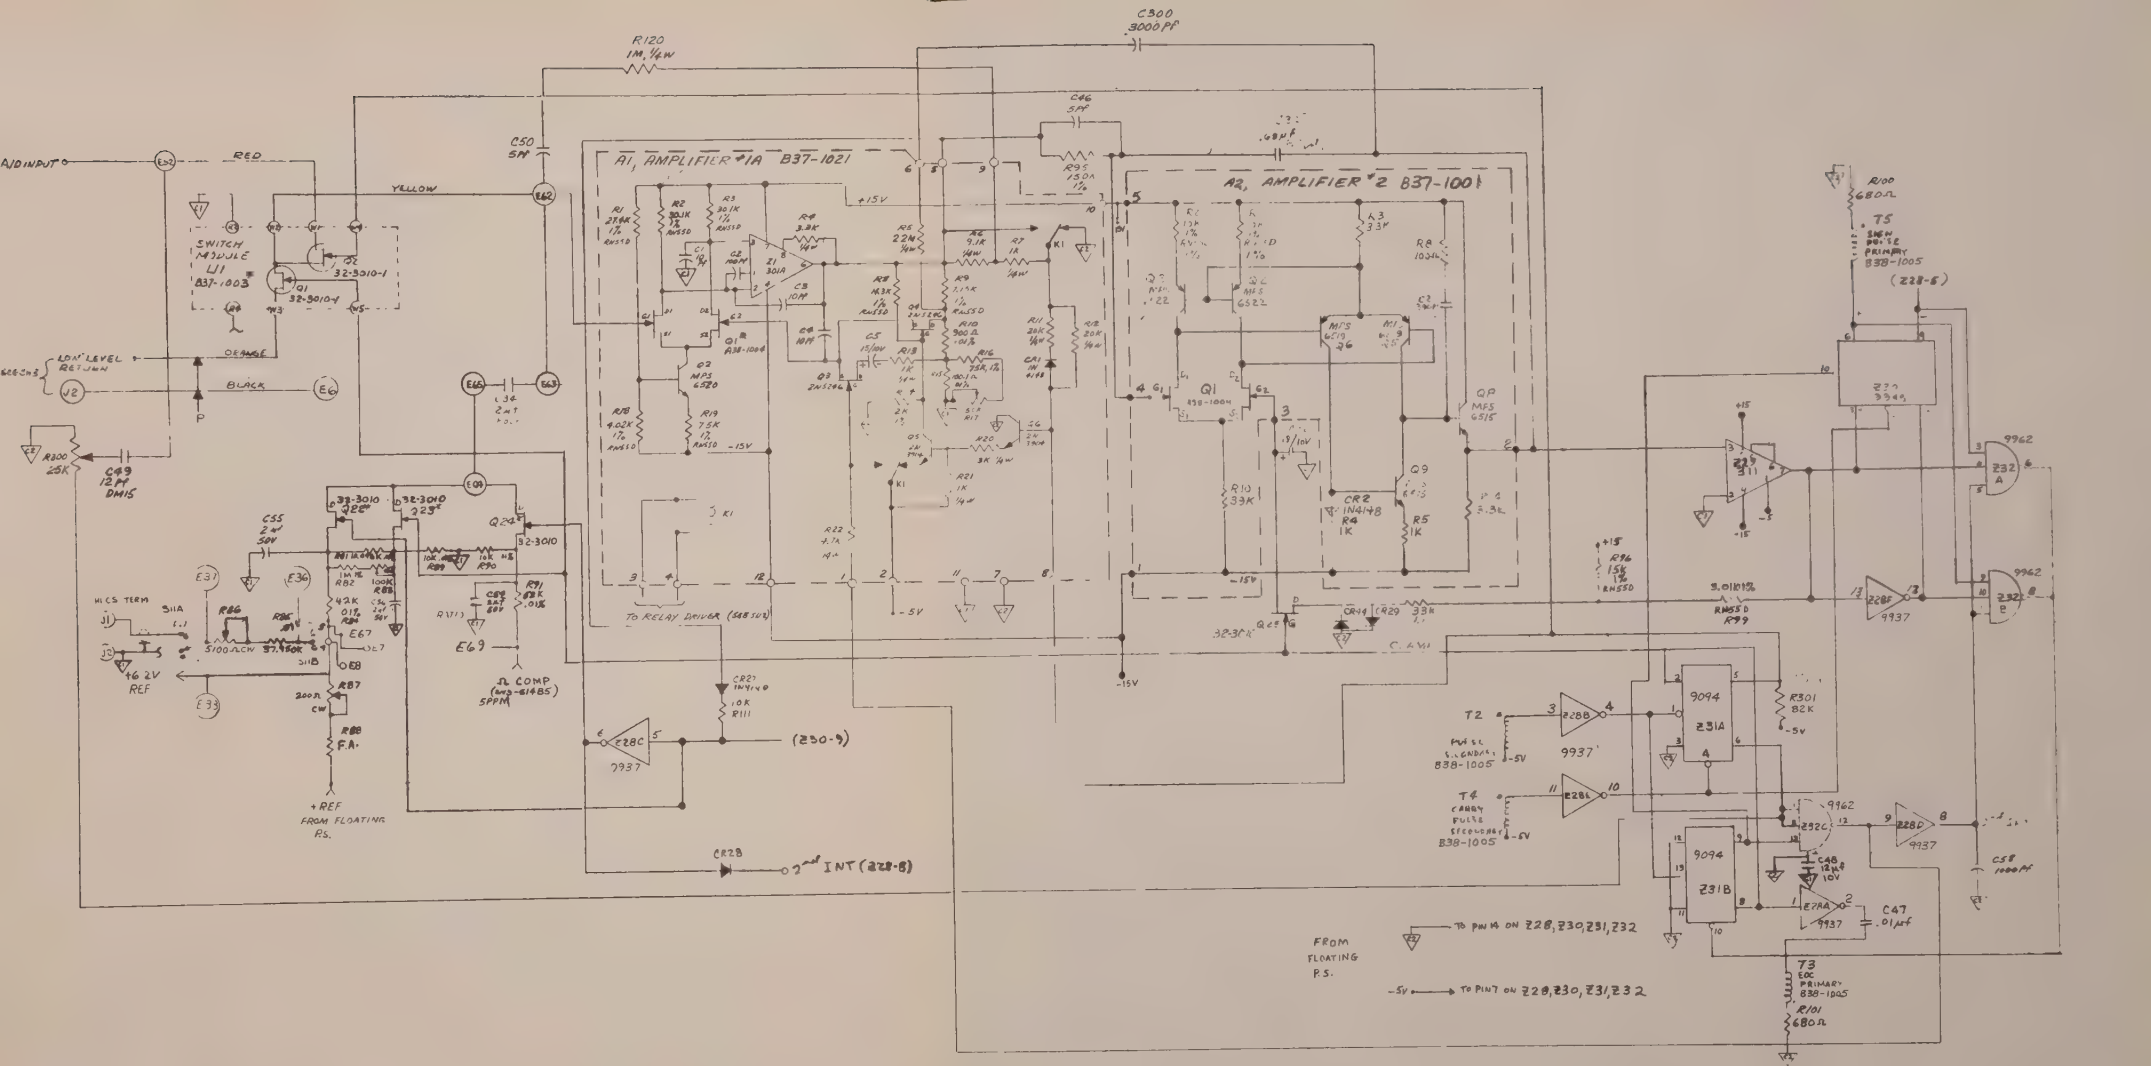

SCHEMATIC
DMM, DVM - A1 OPTION
(A/D CONVERTER)

SERIES 2000 DMM MODEL 2500/A2SUPPLEMENT**1. GENERAL**

Model 2500/A2 Digital Multimeter, shown in figure 1, is a 5-1/2 digit multimeter equipped for battery and line-power operating modes. It features the same high performance as other Series 2000 Digital Multimeters, including Tri-Phasic analog-to-digital converting and Iso-polar referencing. The multimeter function modes are identified by the basic model number, and are accomplished in either line or battery power with equally high performance quality. Model 2500/A2 provides 6 hours of battery powered operation from a fully charged battery module and includes a built-in charging circuit which will fully recharge the discharged batteries in 12 hours. Recharging is automatic in the AC/CHG setting while the line cord is plugged in, and features a special protective circuit to prevent battery overcharge and a protective circuit prevents battery drain when line cord is unplugged. The two sealed 9-amp-hour 6-Volt "Gelyte"* lead-acid batteries are guaranteed for at least 200 full discharge-charge cycles.

2. SPECIFICATIONS

Operating specifications for model 2500/A2 in measuring DC Volts, AC Volts, or Ohms are as defined for the ordered model of Series 2000 DMM. Specifications unique for the battery unit are tabulated below:

Batteries: (2 required, connected in parallel)

Type: Sealed lead-acid "Gelyte"
type PB 690
Voltage: 6 Volts
Mfr: Gould, Inc., Burgess Div.
Operating Time: 6 hours (min)
between charges

*"Gelyte" is a trademark of Gould Inc.

Recharge Time: 2x discharge time; max of 12 hours at 115V to 125V line for fully discharged batteries

Charging Power: 3/8 amp at 125V 60Hz

Dimensions: 5 1/2" x 8 1/2" x 12"

Power Modes:

AC/CHG: While line cord is connected, the batteries remain on charge the power ON light is lit, and the battery meter shows a charging action. Multimeter function modes operate normally (including Power ON push button) and function operations are powered by the AC line cord.

BAT: Multimeter function modes operate normally, powered by the batteries. Power ON light responds to the Power ON pushbutton. Battery condition meter indicates charge status of batteries.

3. OPERATION

Multimeter operating procedures are described in the basic manual. Controls and indicators for the Model 2500/A2 are listed and described in the tables that follow.

TABLE A2-1
FRONT PANEL CONTROLS AND INDICATORS

Fig. Ref.	Control/Indicator	Description	Function
1.	ON	Push-push switch & light indicator	In AC/CHG Mode Applies power from AC source for multimeter operations. In off position removes power from indication circuits; leaves "ON" indicator lighted; leaves power applied to battery charger In BAT Mode Applies power from battery to multimeter

Fig. Ref.	Control/ Indicator	Description	Function
2.	DC	Push switch & light indicator	Selects DC voltage measurement mode of DMM operation. Is interlocked with other modes so that it is pushed out upon selection of another mode.
3.	AC	Push switch & light indicator	*Selects AC voltage measurement mode of DMM action. Is interlocked with other modes so that it is pushed out upon selection of another mode.
4.	k	Push switch & light indicator	*Selects resistance measurement mode of DMM operation. Is interlocked with other modes so that it is pushed out upon selection of another mode.
5.	Vx	Two 5-way binding posts	Connection for input voltage, AC or DC, or resistance.
6.	Rx	Two 5-way binding posts	Current source and sink terminals for resistance connection. Connection for voltage ratio reference input.
7.	GUARD	One 5-way binding post	External connection to guard shield.
8.	DISPLAY	NIXIE Tube indicators (7 for Series 2500) (6 for Series 2400)	Displays digital readout for a maximum of 12000 (Series 2400) or 120000 (Series 2500). Decimal point is selected automatically and appears in the appropriate NIXIE tube to indicate value of a direct reading. Sign is displayed automatically when in DC measurement mode.
9.	RANGE DC 0.1 1 10 100 1000 k	Push switch for manual range selection	Selects value of full scale range to be used by DMM in measuring input. Is interlocked so that only one may be in at a time. 0.1 for use with DC preamp only, option A1/A2 k for use with k 10,000 function only.

Fig. Ref.	Control/ Indicator	Description	Function
10.	AUTO	Push switch for automatic range selection	Initiates DMM operation to locate range for which the input signal will be measured between 10% and 120% of full scale.
11.	Battery	Meter	In AC/CHG Mode Indicates battery potential under charge conditions In BAT Mode Indicates battery potential under discharge conditions Green zone from 30% of full scale to full scale. Red zone from 30% of full scale down, marked "low" Green/red transition is at 5.1 volts.
12.	BAT	Push Switch	Switches to battery operation. Disconnects line cord. Lights power indic. light. Battery oper. requires "on" switch to be on.
13.	AC/CHG	Push Switch	Switches to AC operation Batteries charge. Lights "ON" light unless line cord is dead or unplugged, "ON" switch does not have to be on for charging.

TABLE A2-2
REAR PANEL CONTROLS AND INDICATORS

Fig. Ref.	Control/ Indicator	Description	Function
1.	POWER	3-conductor connector	Connector for line cord.
2.	FUSE	Receptacle and holder	For 3AG 1/2 amp slow-blow line fuse.
3.	REMOTE	PC Connector	Provides digital output of measured value, indicates selected range of operation, and provides input for remote control of range and remote triggering of DMM operations.
4.	RATIO	Push-push switch	Selects ratio mode of multimeter operation in which external DC source is used instead of the internal reference.
5.	LINE VOLTAGE SWITCH	115/230V switch	Connects proper transformer voltage taps so that Series 2000 will work in user area.

4. FUNCTIONAL DESCRIPTION

4.1 General

Multimeter functions are performed in the same circuitry and in the same manner as described in the basic manual to which this is a Supplement.

Operation of Model 2500/A2 while in AC/CHG mode recharges the batteries when the line cord is connected while at the same time operating the multimeter from AC line power through the function controls at the front panel.

Operation of Model 2500/A2 while in BAT mode disconnects the battery charging circuit, and powers the multimeter from internal battery sources through the function controls at the front panel.

The front panel BAT-AC/CHG mode selection switch accomplishes the switching from AC line to battery power by connections in the primary and secondary of the main power transformer and in the battery pack section. When in AC/CHG mode, the line cord-transformer primary circuit is closed and outputs from a transformer secondary are connected to the battery pack charging circuits. When in BAT mode, the line

cord-transformer primary circuit is opened, and battery pack oscillator outputs are connected to the power supply transformer winding.

4.2 AC/CHG Mode

Figure A2-1 is a simplified schematic of the connections and operation of the charging circuit in AC/CHG mode. Line power is connected through switch contacts B4 and B5 of S1 to the transformer primary. A full wave rectifier circuit in the transformer secondary charges storage capacitor C3 and also provides multimeter 5-volt power through a second set of S-1 contacts. The charging circuit performs 3 functions:

1. Provides a fused charging current through transistors Q5, Q6, and associated components;
2. Provides a voltage-controlled charge-circuit cutoff to prevent battery overcharge
3. Provides a meter indicating circuit.

Battery charging is controlled through series transistor Q5, which is either in full conduction or is turned off by the action of the voltage cut out protection circuit. The potentiometer R14 is factory set so that if the battery voltage should exceed 6.9V Q8 will go into full conduction, cutting off Q7. This, in turn, cuts off Q5, thus opening the charge circuit.

Potentiometer R8 is factory adjusted so that the meter M1 will indicate a measure of battery potential while the charging circuit is activated. Potentiometer R8 is calibrated so that the meter M1 reads at the red-green boundary when the battery has discharged to 5.1 volts.

4.3 BAT Mode (figure A2-2)

In the BAT Mode, the battery power source is switched to activate a multi-vibrator oscillator, Q1 and Q4. The oscillator outputs, through a pair of driver stages, Q2 and Q3, are connected to a winding of the power transformer. In this mode the winding acts as a primary, and the remaining windings are secondaries as in AC operation. The driver outputs are also rectified in the battery bridge circuits and provide the source of +5V logic power.

The metering circuit, connected as before, now indicates the voltage output of the battery. A reading in the green indicates a usable voltage above 5.1V.

5. MAINTENANCE

There are no special maintenance or calibration procedures for battery pack operation. Consult the basic manual for calibration and maintenance instructions for the multimeter.

If the batteries do not provide more than four hours of operation after a minimum of 200 fully charged-recharged cycles, they should be replaced.

6. PARTS LIST SUPPLEMENT

Table 6-6A Battery Pack Assembly

Circuit Symbol	Description	DATA PRECISION Part Number
C1,2	Capac. .47 μ f 10% 35V	13-410007
C3	Capac. 8200 μ f 15V	38-1025
C4	Cap .022 μ f	13-110058
CR1,2,3,4	Diode, Rect S3A05	14-100007
CR5	Diode, Rect SI-1	14-100001
CR6,7	Diode Zener IN 752A	14-120075
CR8,9	Diode IN4148	14-110001
R1,2	Resistor, 39 Ω 1/2W 5%	12-033909
R3,6,12	Resistor, 2.2K 1/4W 5%	12-022229
R4,5	Res 100 Ω 1/4W 5%	12-021019
R7	Resistor, 560 Ω 1/4W 5%	12-025619
R8,20	Res Pot, 500 Ω	12-640004
R11	Res 220 Ω 1/4W 5%	12-022219
R13	Resistor, 68 Ω 2W 5%	12-056809
R14	Res Pot, 50 Ω	12-650003
R15	Res 30 Ω 1/4W 5%	12-023009
R16	Resistor, 47 Ω 1/4W 5%	12-024709
R17	Res 10K 1/4W 5%	12-021039
Q1,Q4	Transistor 2N3568	14-233568
Q2,Q3	Transistor, 2N5036	14-235036
Q5	Transistor, 2N5193	14-235193
Q7,9	Transistor, 40314(RCA)	12-2340314
Q8	Transistor, 2N3565	12-233565

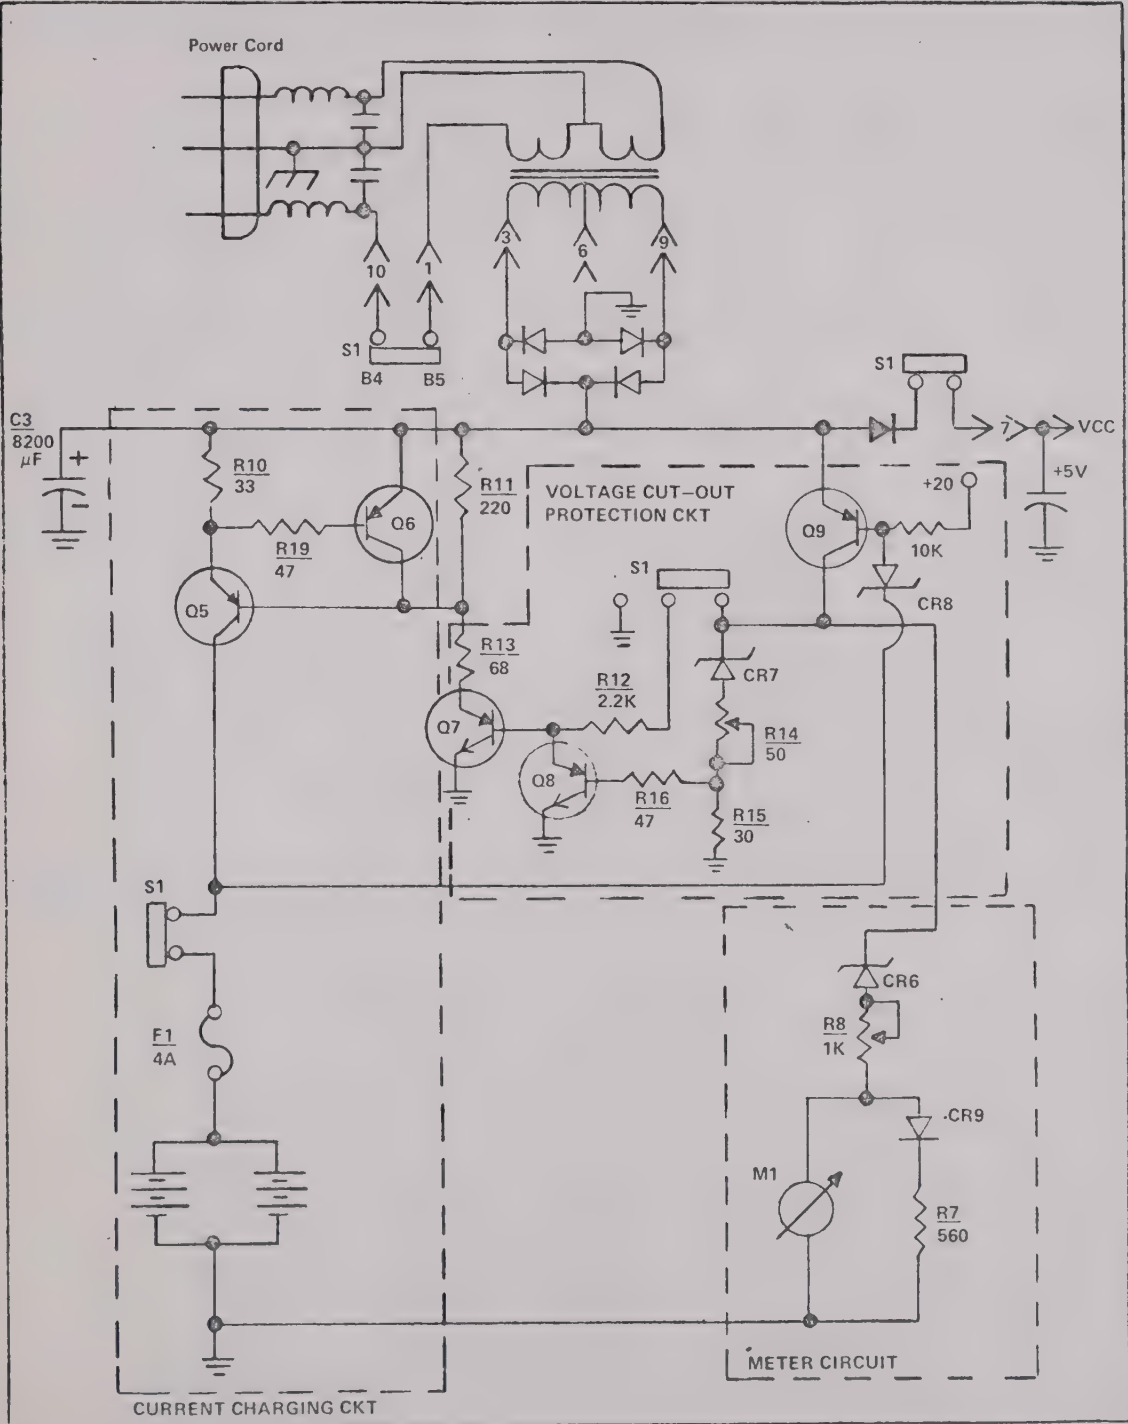


Figure A2-1. Battery Charging Circuit Schematic

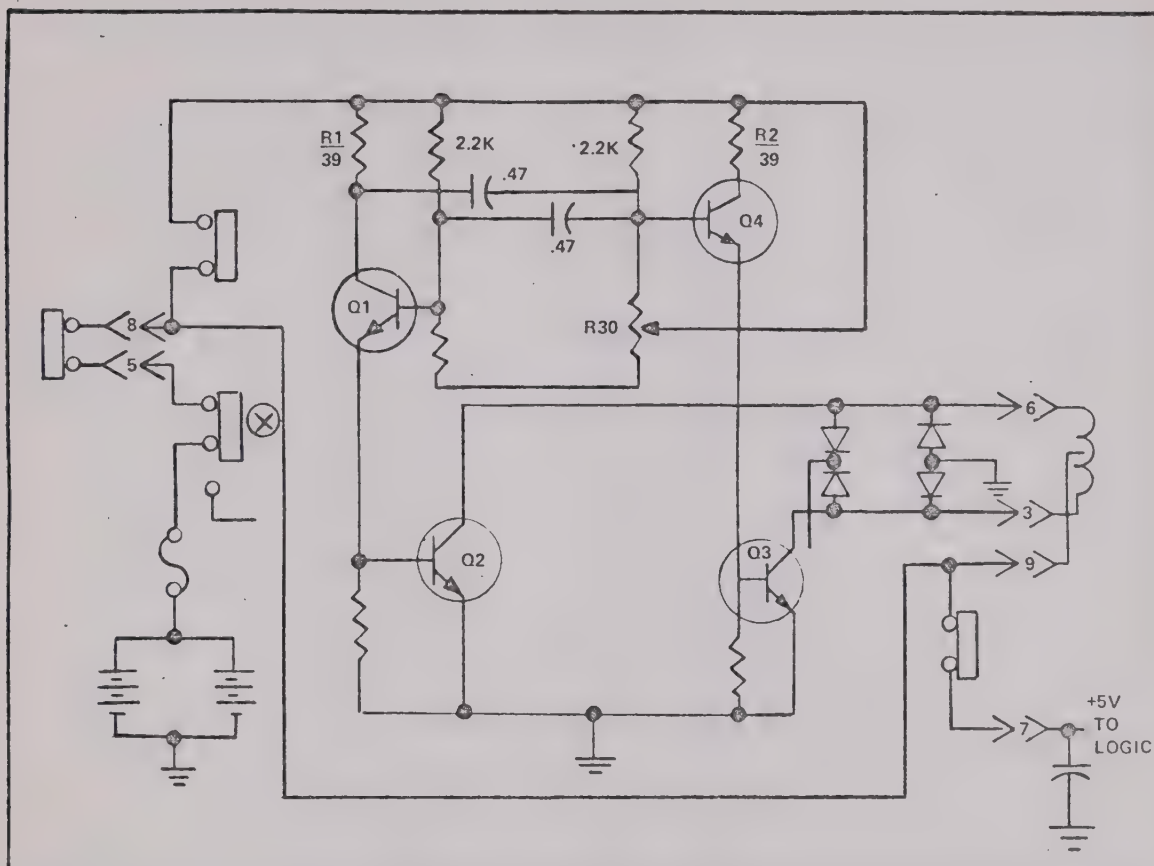


Figure A2-2. Battery - Use Schematic

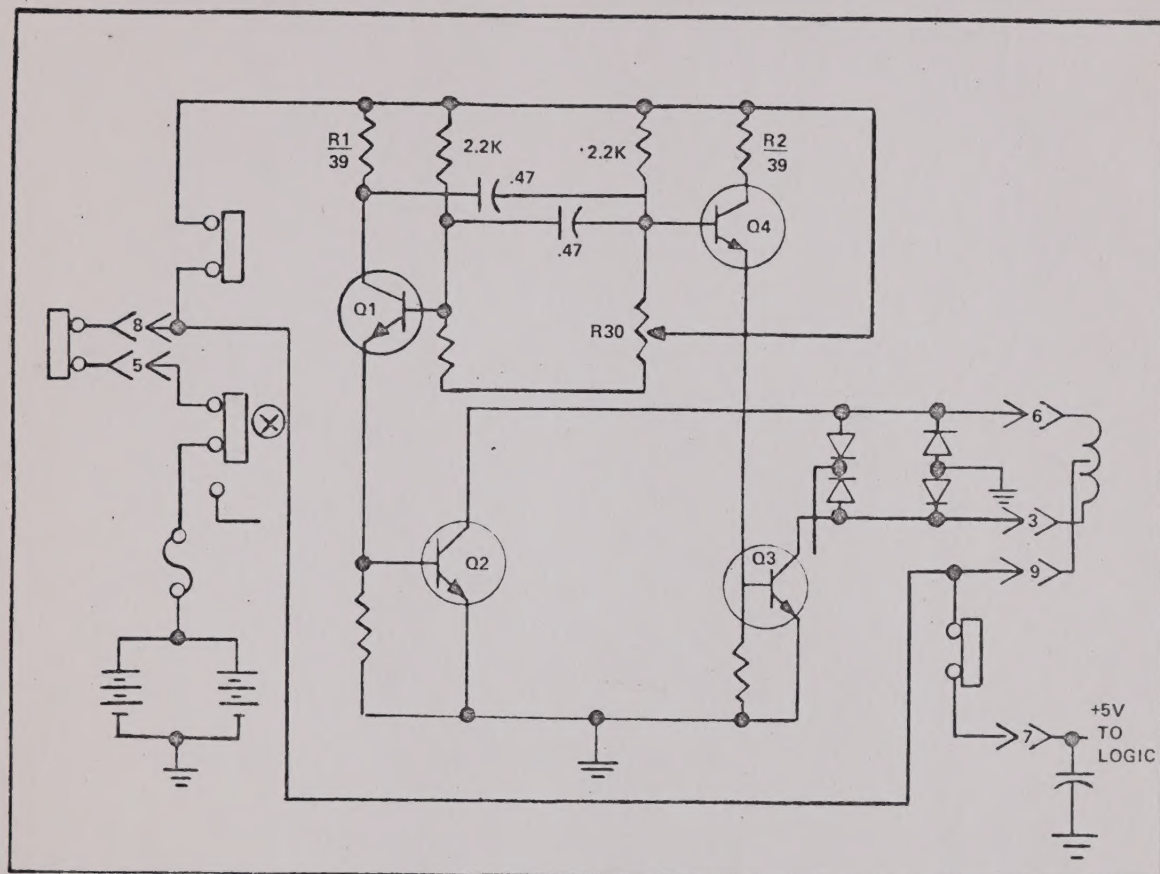


Figure A2-2. Battery - Use Schematic

